



U.S. Department  
of Transportation

**National Highway  
Traffic Safety  
Administration**

400 Seventh Street, S.W.  
Washington, D.C. 20590

Dear Crash Data Researchers/Users:

Thank you for choosing crash data from the National Highway Traffic Safety Administration (NHTSA) for your research or other use. The information contained in this motor vehicle crash report is collected, maintained and distributed in accordance with Public Law 89-564. In accordance with this Public Law, NHTSA is required not to release any case information until completion of quality control procedures. These procedures include a review of the case material to extract all names, licenses and registration numbers, non-coded interview material, non-research related researcher comments in the margins, non-factual data, and the production number portion of the vehicle identification number (VIN).

If you requested NHTSA to query its database files in order to identify a specific crash, then that query was made using non-personal descriptors you provided for use in our search. This motor vehicle crash may have been identified from a data search and matches the general, non-personal descriptors you provided, but we cannot confirm that this is the specific crash report you requested.

If you have any questions with regard to the above procedures, please contact the Field Operations Branch, Crash Investigation Division, National Center for Statistics and Analysis at 202-366-4820. Again, please be advised that we cannot confirm that this is the case that you have specifically requested nor can we certify the information to be correct.

\*\*\*    \*\*\*    \*\*\*



AUTO SAFETY HOTLINE  
(800) 424-9393  
Wash. D.C. Area 366-0123

TRANSPORTATION SCIENCES CENTER  
ACCIDENT RESEARCH GROUP

Division of Arvin/Calspan  
[REDACTED]

CALSPAN ON-SITE AIR BAG DEPLOYMENT INVESTIGATION  
CALSPAN CASE NO. 92-12  
VEHICLE - POLICE 1991 FORD LTD CROWN VICTORIA  
LOCATION - [REDACTED] CA  
ACCIDENT DATE - [REDACTED] 1992

Contract No. DTNH22-87-C-27169

Prepared for:

U.S. Department of Transportation  
National Highway Traffic Safety Administration  
Washington, D.C. 20590



### DISCLAIMERS

This document is disseminated under the sponsorship of the Department of Transportation in the interest of information exchange. The United States Government assumes no responsibility for the contents or use thereof.

The opinions, findings, and conclusions expressed in this publication are those of the authors and not necessarily those of the National Highway Traffic Safety Administration.

The crash investigation process is an inexact science which requires that physical evidence such as skid marks, vehicular damage measurements, and occupant contact points are coupled with the investigator's expert knowledge and experience of vehicle dynamics and occupant kinematics in order to determine the pre-crash, crash, and post-crash movements of involved vehicles and occupants.

Because each crash is a unique sequence of events, generalized conclusions cannot be made concerning the crashworthiness performance of the involved vehicles(s) or their safety systems.

# TECHNICAL REPORT STANDARD TITLE PAGE

<b>1. Report No.</b> 92-12	<b>2. Government Accession No.</b>	<b>3. Recipient's Catalog No.</b>	
<b>4. Title and Subtitle</b> Calspan On-Site Air Bag Deployment Investigation Vehicle - Police 1991 Ford LTD Crown Victoria Location - [REDACTED] CA		<b>5. Report Date:</b> [REDACTED] 1993	
		<b>6. Performing Organization Code</b>	
<b>7. Author(s)</b> Accident Research Group		<b>8. Performing Organization Report No.</b>	
<b>9. Performing Organization Name and Address</b> Transportation Sciences Center Accident Research Group Division of Arvin/Calspan P.O. Box 400 [REDACTED]		<b>10. Work Unit No.</b> [REDACTED]	
		<b>11. Contract or Grant No.</b> DTNH22-87-C-27169	
<b>12. Sponsoring Agency Name and Address</b> U.S. Department of Transportation National Highway Traffic Safety Administration Washington, D.C. 20590		<b>13. Type of Report and Period Covered</b> Technical Report Accident Date [REDACTED]/92	
		<b>14. Sponsoring Agency Code</b>	
<b>15. Supplementary Notes</b>  On-site investigation of a single vehicle roadside departure crash that involved a police 1991 Ford LTD Crown Victoria. The driver sustained a minor (AIS-1) burn of the left fingers from contact with the inflation module.			
<b>16. Abstract</b>  <p>This on-site investigation focused on a single vehicle roadside departure crash that occurred on [REDACTED], 1992. The Accident Research Group was notified of the crash on [REDACTED] and initiated an on-site investigation on [REDACTED]. A marked police 1991 Ford LTD Crown Victoria was in pursuit of a speeding vehicle and was traveling on a rural two lane mountainous road at a police reconstructed speed of 119.1 KPH (74 mph). The vehicle drifted onto the right shoulder and broke traction as it exited a moderate left curve. The right rear quarter panel area of the vehicle impacted a delineator post located at the outboard edge of the shoulder. The Crown Victoria subsequently rotated approximately 80° in counterclockwise direction across the travel lanes before departing the left side of the roadway.</p> <p>The vehicle became airborne as it exited the shoulder area of the roadway as it traveled down a 45° earth embankment. The right side passenger compartment area impacted several trees which resulted in severe vehicle damage. As a result of the impacts, the vehicle's supplemental driver air bag system deployed.</p> <p>The driver of the vehicle was a 54 year old male, 179.1 cm (70.5") and 99 kg (220 lbs.). He was properly restrained by the active 3-point lap and shoulder belt system. In response to the lateral impact forces, the driver's upper torso slid out of the manual shoulder belt and impacted the intruding right upper B-pillar, roof, and roof side rail. As a result, he sustained multiple right rib fractures with flail chest and hemothorax (AIS-4), multiple fractures of the right upper extremity (AIS-3), and a closed head injury with brief loss of consciousness (AIS-2). He rebounded across the interior of the vehicle and came to rest with his left hand pressed against the deflated air bag and the inflation module. The heat retained in the inflator assembly melted the air bag and produced full thickness burns (AIS-1) of the driver's dorsal left middle, ring, and fifth fingers.</p>			
<b>17. Key Words</b> Roadside departure crash Right side impacts Air bag deployment Inflator temperatures of 300°C (578°F) Thermal burns of driver's left hand, AIS-1		<b>18. Distribution Statement</b>  General Public	
<b>19. Security Classif. (of this report)</b> Unclassified	<b>20. Security Classif. (of this page)</b> Unclassified	<b>21. No. of Pages</b> 117	<b>22. Price</b>

## TABLE OF CONTENTS

	<u>Page No.</u>
Summary	1
Accident Schematic	5
Accident Data	7
Ambience	7
Highway	7
Traffic Controls	8
Vehicle	8
Vehicle Damage	9
Supplemental Restraint System	14
Collision Sequence	15
Human Factors/Occupant Data	19
Driver Injuries	20
Driver Kinematics	21
Selected Prints	24
Slide Index	56
Appendix A: Police Accident Report	58
Appendix B: Air Bag Supplement	75
Appendix C: NASS Vehicle Forms	82
Appendix D: NASS Occupant Forms	108

**CALSPAN ON-SITE AIR BAG DEPLOYMENT INVESTIGATION**  
**CALSPAN CASE NO. 92-12**  
**VEHICLE - POLICE 1991 FORD CROWN VICTORIA 4 DR. SEDAN**  
**LOCATION - [REDACTED] CA**

**SUMMARY**

The single vehicle roadside departure crash occurred on a rural two-lane mountainous road on [REDACTED], 1992 during daylight hours. The involved vehicle was a marked police 1991 Ford Crown Victoria, 4 door sedan (V.I.N.: [REDACTED]), that was equipped with a supplemental driver's air bag system. The crash occurred as the vehicle was exiting a moderate left curve with a downgrade of 5.2%. The dry asphalt road surface was 6.6m (21'9") wide and was bordered by narrow paved and loose cinder shoulders. A steep downhill embankment of 45° paralleled the left (south) edge of the roadway. The posted speed limit was 88 kph (55 mph).

The driver of the Ford Crown Victoria was on routine patrol and was traveling in an easterly direction on the state highway. He entered the parking lot of a local service station and noted a westbound vehicle traveling at a high rate of speed. The officer initiated a U-turn and activated the vehicle's emergency equipment (flashing lights and siren) and pursued the speeding westbound vehicle. During the pursuit, the driver of the Crown Victoria entered a moderate left curve at a high rate of speed. The vehicle drifted wide onto the right (north) shoulder and broke traction as the driver exited the curve. The right rear quarter panel impacted a delineator post as the vehicle initiated a counterclockwise yaw. The Crown Victoria subsequently deposited four-wheel centrifugal tire marks on the road surface as it crossed both travel lanes. The [REDACTED] Highway Patrol computed an initial speed of 119.1 kph (74 mph) for the vehicle as it exited the curve using the critical curve formula.

As the vehicle crossed the eastbound travel lane and departed the left edge of the roadway, it had rotated approximately 80° in a counterclockwise direction. The police documented 82.3m (270') of centrifugal tire marks prior to road departure. During Calspan's on-site investigation that occurred nearly three months later, 42.7m (140') of tire marks were still visible on the asphalt road surface. As the vehicle departed the left (south) edge of the roadway, the right front fender area impacted and dislodged a steel delineator post from the cinder and earth shoulder. The vehicle exited the shoulder area in a near broadside orientation and became airborne as it traveled over the earth embankment. The frontal area of the Crown Victoria contacted branches of a large tree that was located on the embankment 7.62m (25') outboard of the road edge. The vehicle continued in a near broadside orientation and pitched

slightly to its right. The upper surface of the right front fender area of the vehicle impacted a 20.3cm (8") cedar tree that was located 9.1m (30') outboard of the roadedge. The 3 o'clock direction of force impact fractured the tree 81.3cm (32") above the ground and deflected the stump along the vehicle's path of travel. The right passenger compartment and roof side rail area of the vehicle subsequently impacted a 25.4cm (10") diameter cedar tree that was located 2.4m (8") east of the 20.3cm (8") diameter tree and 8.7m (28'6") south of the roadedge. At impact the vehicle was pitched approximately 15-20° to its right which resulted in a non-horizontal impact force. The impact crushed the side structure of the vehicle 69.1cm (27.2") at the beltline and 83.8cm (33") at the right roof side rail. Again, the larger diameter tree fractured 1.9m (6'3") above the ground and the remaining stump was deflected to the ground as the vehicle overrode the struck tree.

The Ford Crown Victoria rotated approximately 30-40° in a clockwise direction following the latter impact sequence with the 25.4cm (10") tree. The vehicle came to rest facing in a downhill orientation approximately 6.1m (20') west of the 25.4cm (10") 6.1m (20') diameter tree. During the crash sequence, the supplemental driver's air bag system deployed.

The driver of the vehicle was a 54-year-old male with a stated height of 179.1cm (70.5") and weight of 99 kg (220 lbs.). He was properly wearing the active 3-point lap and shoulder belt system. Belt usage was supported by driver statements, blood stains on the upper shoulder belt webbing and by load induced abrasions to the inner plastic surface of the system's latchplate. There was no loading evidence on the belt webbing or damage to the active restraint system. The driver stated that he routinely drove the Crown Victoria with the seat adjusted to a mid-track position and the seatback set to the most upright position. He stated that the tilt steering column was probably adjusted to the center position.

At impact with the trees, the driver was probably out of position to his right due to the pre-crash rotation of the vehicle and was further displaced at each tree impact. As the vehicle impacted the 25.4cm (10") diameter tree, the driver moved laterally to his right as his upper torso slid out of the manual shoulder belt webbing, while his pelvic area loaded the lap belt portion of the 3-point belt system. His head impacted the intruding headliner and roof 36.8-50.8cm (14.5-20") rearward of the right A-pillar and 27.9cm (11") above the side rail. The 11.4cm (4.5") diameter head contact cracked the backer to the headliner and bowed the roof panel approximately 0.6cm (0.25") outward. As a result of the contact, the driver sustained a laceration to the top of the scalp (AIS-1), a closed head injury with brief loss of consciousness and residual cognitive deficits (AIS-2), a non-displaced fracture of the right zygoma (AIS-2), a nasal laceration (AIS-1), a displaced nasal fracture (AIS-2), and four dislocated

immediately forward of the right B-pillar. The contact resulted in a fracture of his right clavicle (AIS-2). His right forearm impacted the right roof side rail 20.3-29.2cm (8-11.5") rearward of the right upper A-pillar. The contact was evidenced by tissue transfers on the headliner fabric that covered the side rail area. As a result of the side rail contact, the driver sustained a comminuted fracture of the right radial head (AIS-3) and a fracture of the right proximal ulna (AIS-2).

During the driver's lateral trajectory, his right chest area probably contacted the right upper B-pillar as the vehicle crushed to maximum engagement. Although no contact evidence was visible to the plastic jacket covering the B-pillar, the driver sustained fractures of the right ribs 2-9 with flail chest and right hemothorax (AIS-4) and a right pulmonary contusion (AIS-3).

The driver subsequently rebounded across the interior of the vehicle into the left front seatback and/or the left front door panel. He sustained a fracture of the spinous process of T<sub>12</sub> from the probable rebound contact. The supplemental driver's air bag system deployed during the crash sequence; however, due to the driver's lateral trajectories, he had minimal involvement with the bag. He came to rest with his left hand under the upper module cover flap, pressing against the deployed air bag and the inflation module. The hot inflation module melted the face of the air bag and an internal tether strap of the bag at the 10 o'clock position. The heat was transmitted through the bag which resulted in full thickness thermal burns of the dorsal aspects of the driver's left middle, ring, and fifth fingers (AIS-1). The thermal burns destroyed the tendons of the fingers and required extensive skin grafts. The driver came to rest slumped forward over the steering assembly and bled profusely from the nasal injuries onto the deflated air bag. He was transported by helicopter to a trauma center where he was admitted for 24 days for treatment of his injuries. Currently he has no ability to move the left ring and fifth fingers due to the extensive burn injury.

During our on-site investigation of this crash, a representative from TRW (manufacturer of the air bag module) was present to inspect and dismantle the module assembly. During his discussion of the deployment process, he stated that the air bag material, which consists of woven nylon with a neoprene liner, will not support a flame; however, it does have a melting point of 154-177° C. (310-350° F.). The inflation module, which is primarily stainless steel, reaches deployment temperatures of 300° C. (578° F.) and cools slowly due to its isolated, non-vented location.


The melted area of the air bag was located 19.1-26cm (7.5-10.25") left of center and 8.3-9.5cm (3.25-3.75") above the horizontal centerline. The 1.3 x 7.0cm (0.5 x 2.75") melted area of the air bag was located 4.4-10.2cm (1.75-4.0") inboard of the

horizontal centerline. The 1.3 x 7.0cm (0.5 x 2.75") melted area of the air bag was located 4.4-10.2cm (1.75-4.0") inboard of the peripheral seam. Tissue and blood were visible within the melted area. The face of the inflator contained melted fragments of the bag and an internal tether strap that were pressed against the inflator by the driver's hand.

An external inspection of the inflator assembly did not yield evidence of filtering screen burnthrough or separation of the initiator assembly. The assembly was intact and appeared to have performed as designed. Due to the nature of the driver's burn injury and the melting of the bag, it was decided that disassembly of the inflator was not necessary. The module assembly was identified by the following alpha/numerical sequences: [REDACTED] AND [REDACTED].


Accident Schematic  
Calspan Case No.92-12

Fractured Tree

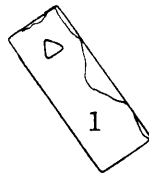


10" Diameter  
Struck Tree

8" Diameter  
Struck Tree

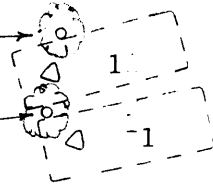


Struck Tree  
Branches

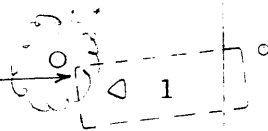

-45°  
Embankment




 Area of Struck Delineator



Paved Shoulder

 Cinder Shoulder




Vehicle  
#1 - 1991 Ford LTD Crown  
Victoria Police Vehicle


Paved Shoulder

Cinder Shoulder

-5.2%

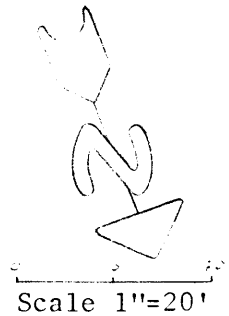



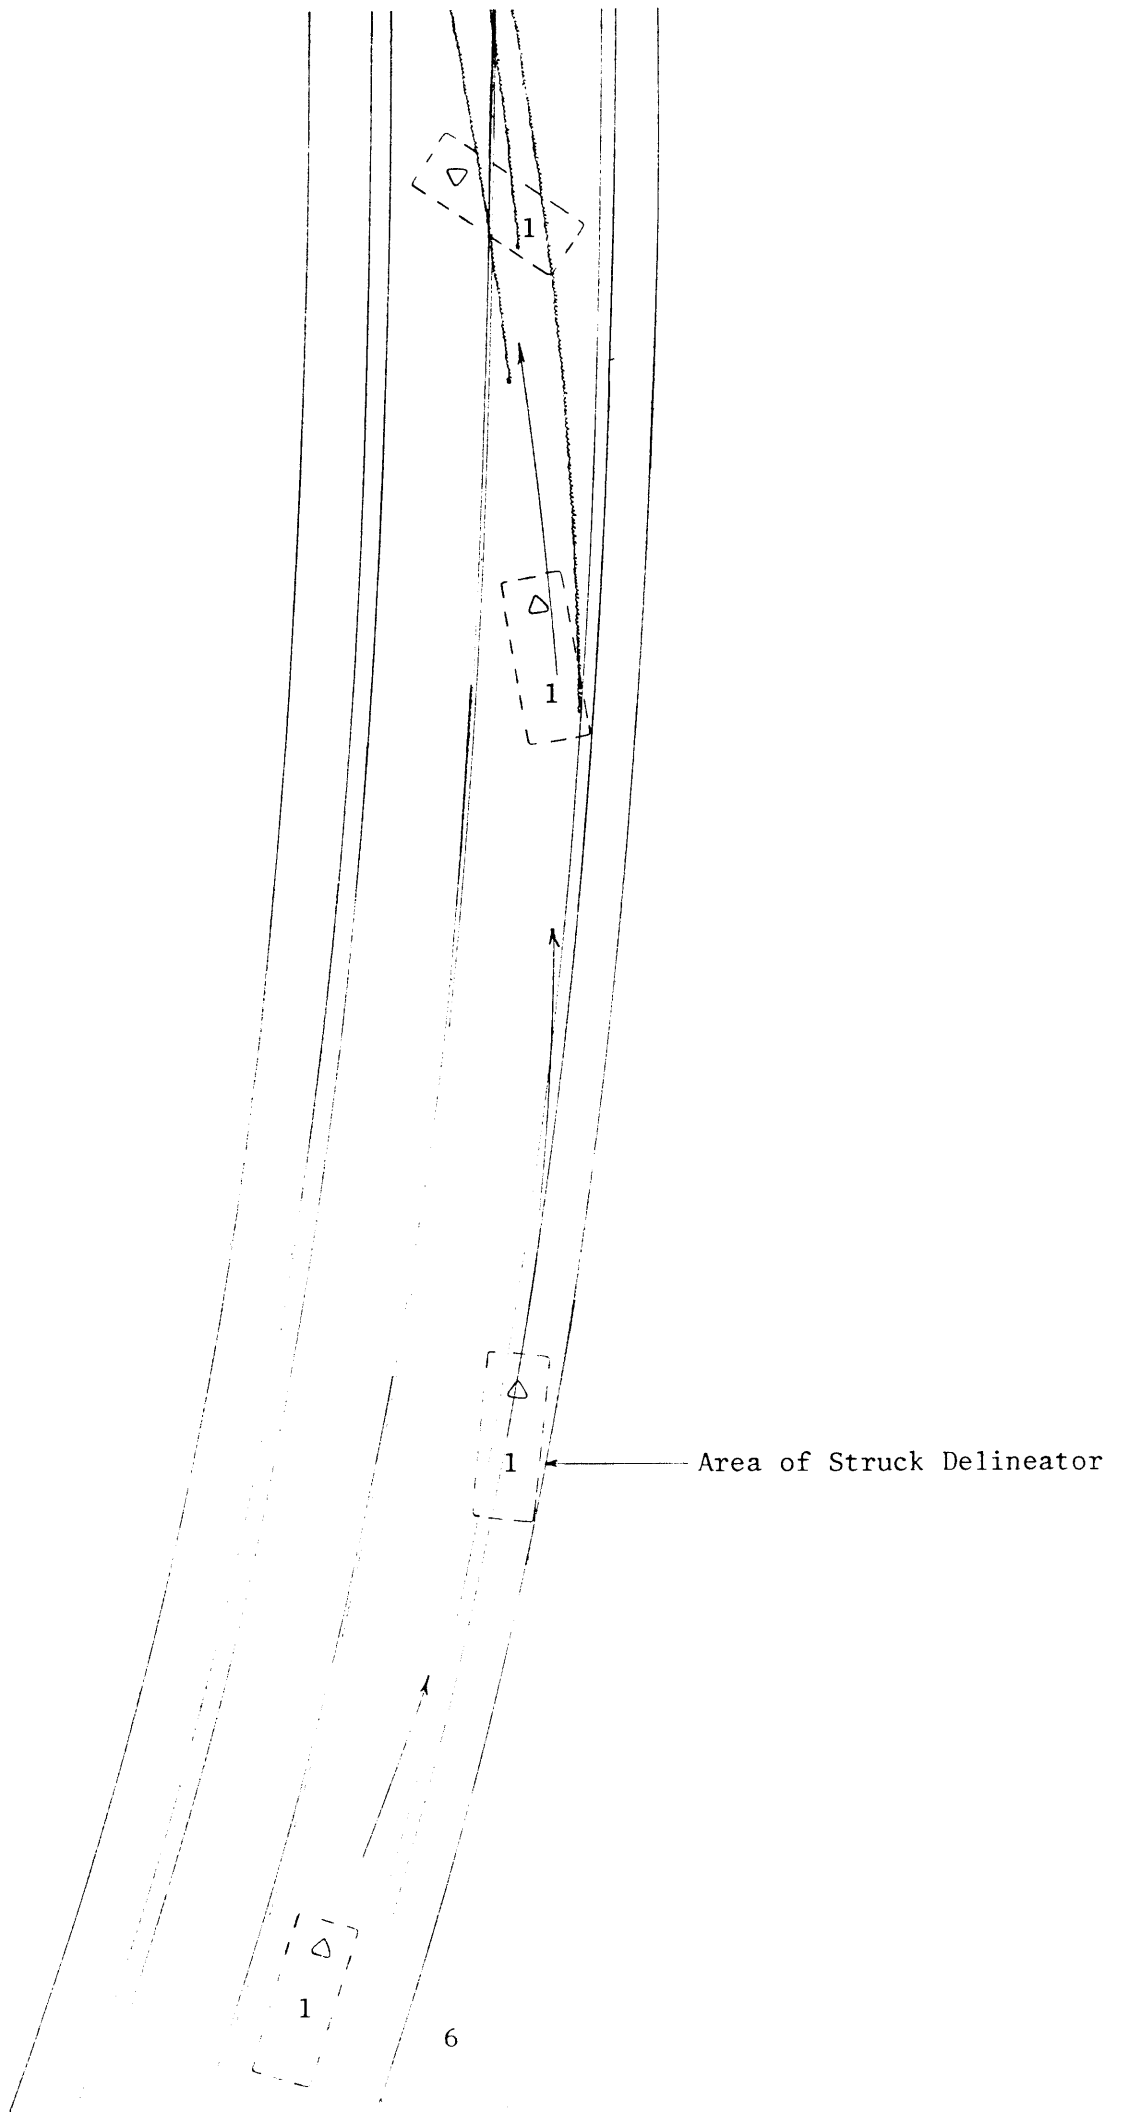

CALSPAN ON-SITE AIR BAG DEPLOYMENT INVESTIGATION  
CALSPAN CASE NO. 92-12  
VEHICLE - POLICE 1991 FORD CROWN VICTORIA  
LOCATION - [REDACTED] CA

**ACCIDENT DATA**

Location: Rural, two lane state route  
City/Township: [REDACTED], CA  
Area/Type: Rural/Mountainous  
Accident Date/Time: [REDACTED] [REDACTED] [REDACTED], 1992,  
daylight hours  
Investigating Police Agency: [REDACTED] Highway Patrol  
Accident Type: Single vehicle roadside  
departure, multiple tree  
impacts  
Air Bag Vehicle Driver  
Injury Severity: Severe (AIS-4)

**AMBIENCE**

Viewing Conditions: Daylight  
Weather: Clear  
Precipitation: None  
Road Surface: Dry

**HIGHWAY**

Type: State route  
Number of Lanes: 2  
Width: 21' 9"  
Surface: Asphalt  
Median: None

Edge:	North edge - 1.8cm (6') paved and loose cinder shoulder South edge - 2.5m (8'4") paved and loose cinder shoulder
Vertical Alignment:	5.2% grade, negative to the west
Horizontal Alignment:	Left curve
Traffic Density:	Light

#### **TRAFFIC CONTROLS**

Signals:	None
Signs:	No pertinent signs
Markings:	Yellow full barrier centerlines, solid white edgelines
Speed Limit:	88 KPH (55 mph)

#### **VEHICLE**

Description:	1991 Ford Crown Victoria, 4 dr. sedan, marked police vehicle
V.I.N.:	2FACP72G5MX (production number deleted)
Color:	Black and white
Odometer:	26,919 miles
Engine:	8 cylinder, 5.8 L
Transmission:	4-speed automatic overdrive, column mounted transmission selector lever
Steering:	Power
Brakes:	Power front disc

Padding:	Upper, mid, and lower instrument panel, knee bolster, soft edged steering wheel rim and air bag module cover, sunvisors, adjustable head restraints, fold-down center armrest, door panels, door armrests, headliner
Active Restraints:	3-point lap and shoulder belts in the four outboard seated positions, center front and center rear lap belts
Automatic Restraints:	Supplemental driver's air bag system that deployed during the crash sequence
Defects:	None
Tow Status:	Towed due to damage

#### **VEHICLE DAMAGE**

##### **Exterior:**

The exterior of the 1991 Ford Crown Victoria sustained severe damage from multiple impacts with roadside and off-road objects. As the vehicle exited a left curve, it drifted onto the right shoulder and impacted a delineator with the right rear quarter panel area. The impact produced 12.7cm (5") of crush to the panel that was located 86.4cm (34") rearward of the right rear axle. The deformation to the quarter panel began 15.3cm (6") rearward of the referenced axle and extended 111.8cm (44") to the rear bumper. The vehicle rotated across the travel lanes in a counterclockwise direction and departed the left roadedge in a near broadside orientation. As the vehicle departed the roadway, the right front fender area impacted and dislodged a steel delineator post from the cinder and earth shoulder. Paint abrasions were noted to the fender 20-48cm (8-19") rearward of the right front axle position and were vertically orientated on the fender above the wheel opening. Crush damage to the area was masked by subsequent impacts.

Exterior  
(Cont'd):

The vehicle exited the left shoulder of the roadway and traveled down an earth embankment, becoming airborne in a broadside yaw. The frontal area of the vehicle contacted overhanging branches of a large tree that was located 7.6m (25') outboard of the roadedge. The branches probably fractured the header panel and scratched the top surface of the vehicle's hood.

As the vehicle continued on its trajectory down the embankment, the front undercarriage area of the Crown Victoria impacted the ground which displaced the frontal structure upward. Push bars were mounted to the front bumper and frame area of the vehicle. As a result of the undercarriage impact and subsequent contact with small diameter trees on the embankment, the right side of the front bumper face was dented 40-52cm (16-20.5") right of center, to a depth of 1.9cm (.75"). The lower right push bar bracket was deformed and displaced 12.7cm (5") laterally to the left. The bumper energy absorbing devices were compressed 3.2cm (1.25") on the right side and 1.6cm (.6") on the left side.

Due to the slope of the embankment, the broadside trajectory of the vehicle, and vehicle contact with the ground, the Crown Victoria began to pitch to its right. The upper surface of the right front fender impacted a 20.3cm (8") diameter cedar tree that was located 9.1m (30') outboard of the roadedge. The tree impact damage began on the fender at bumper level and extended vertically onto the top of the fender and hood, indicating a non-horizontal (00-LFMN-3)) impact force. Direct contact damage began 40.6cm (16") forward of the axle position and extended 20.3cm (8") forward to the leading edge of the fender. The vehicle subsequently impacted a small diameter tree with the right front fender area. The damage was located 16.5-30.5cm (6.5-12") forward of the referenced axle position and involved 7.6cm (3") of crush on the lip of the wheel opening. The

Exterior  
(Cont'd):

impacts fractured the 20.3cm (8") diameter tree 81.3cm (32") above ground level and displaced the stump to the east as the vehicle overrode the remaining trunk of the tree. The small diameter tree was completely uprooted and displaced from its location on the embankment.

The Crown Victoria continued to pitch to its right and subsequently impacted a 25.4cm (10") diameter cedar tree that was located 2.4m (8') east of the previously struck 8" diameter tree. The impact damage extended vertically from the sill of the vehicle onto the side rail and roof. Due to the slope of the embankment and the vehicle's attitude at impact, the damage was diagonally orientated on the right passenger compartment area. Direct contact damage on the right front door and sill area began 111.8cm (44") rearward of the right front axle and extended 35.6cm (14") rearward. The direct contact damage on the right roof side rail began 162.6cm (64") rearward of the axle position and extended 33cm (13") rearward. Maximum crush was 83.8cm (33") located on the right roof side rail at the B-pillar. Crush values at the side rail level were as follows:

$C_1 = 39.4\text{cm (15.5")}$ ,  $C_2 = 78.1\text{cm (30.75")}$ ,  $C_3 = 83.8\text{cm (33")}$ , and  $C_4 = 33.3\text{cm (13.1")}$  at the right A-pillar.

A second set of crush values were documented at the beltline area of the vehicle which extended from the A- to the C-pillars and were as follows:

$C_1 = 20.3\text{cm (8")}$ ,  $C_2 = 48.5\text{cm (19.1")}$ ,  $C_3 = 76.7\text{cm (30.2")}$ ,  $C_4 = 50.8\text{cm (20")}$ ,  $C_5 = 20.5\text{cm (8.1")}$ ,  $C_6 = 10.2\text{cm (4")}$ . Maximum crush at the beltline was 76.7cm (30.2") located at the B-pillar. The crush profile of the right sill area was also documented and was as follows:

$C_1 = 0\text{cm}$ ,  $C_2 = 26.9\text{cm (10.6")}$ ,  $C_3 = 38.1\text{cm (15")}$ ,  $C_4 = 50.8\text{cm (20")}$ ,  $C_5 = 54\text{cm (21.25")}$ ,  $C_6 = 19.1\text{cm (7.5")}$ .

As a result of the multiple impacts, all exterior sheetmetal components were

Exterior  
(Cont'd):

damaged from either direct contact or induced buckling. The left front door was jammed closed due to the deformation to the vehicle. Rescue personnel used emergency equipment to pry open the door and subsequently cut the hinges to remove the door from the vehicle. The left rear door was jammed closed and again, rescue workers pried the door open to treat the injured driver. The right side doors were jammed due to the severe deformation to the passenger compartment area. All glazing was damaged by the impacts with the exception of the left rear door glazing and its quarter window. The windshield was removed by rescue personnel during extrication of the driver.

CDC:	<u>Event Number</u>	<u>Object Contacted</u>	
	1	12-RBEW-1	Delineator post
	2	02-RFEN-1	Delineator post
	3	00-FDMW-3	Tree branches
	4	03-FZLS-1	Small diameter tree
	5	00-RFEN-3	20.3cm (8") diameter tree
	6	00-RFEN-2	Small diameter tree
	7	00-RPAN-5	50.8cm (10") diameter tree

Repair	
Cost:	Total loss

Interior:

The interior of the Ford Crown Victoria was severely damaged as a result of exterior deformation and driver contact. The right passenger side impact with the 50.8cm (10") diameter tree produced severe intrusion of the right side components. Maximum intrusion involved 83.8cm (33") of lateral displacement of the right roof side rail, the roof and the upper B-pillar at the side rail juncture. Due to the severe lateral displacement of the side rail, the roof was crushed to a near vertical surface on the interior of the vehicle. The mid right B-pillar and right front door panel intruded into the center front occupant space, resulting in a lateral displacement of 76.7cm (30.2").

The driver of the vehicle moved laterally to the right in response to the right side tree impacts. His knees and lower legs initially contacted the fuse box cover and the knee bolster. The fuse box cover was scuffed 53-61cm (21-24") left of center and 41-46cm (16-18") below the top surface of the instrument panel. A lower leg scuff was noted to the bolster 39-46cm (15.5-18.3") left of center and 38-43cm (15-17") below the upper panel. The driver's right knee contacted the protrusion of the bolster at the base of the steering column. A scuff mark and disruption of the vinyl covering was noted 38-46cm (15-18") left of center. The lateral aspect of the driver's right knee contacted the center mid instrument panel (scuff) and the center mounted police radio equipment. Although the radios were removed prior to our inspection of the vehicle, a deformed bracket was found in the vehicle, indicating contact to the components.

The driver's head and facial areas impacted the intruding vertical surface of the roof. The 11.4cm (4.5") diameter contact cracked the backer panel to the headliner and bowed the roof panel outward .6cm (.25"). The contact point was located 38-51cm (15-20") rearward of the A-pillar and 22-34cm (8.8-13.3") above the roof side rail. His right forearm impacted the right siderail 20-29cm (8-11.5") rearward of the A-pillar, depositing tissue transfers on the fabric covering. The driver's thoracic area contacted the B-pillar; however, no



Interior (Cont'd): evidence of contact was visible on the vinyl covering.

As the driver responded to the lateral impact forces, his upper torso slid out of the manual shoulder belt webbing. His pelvic area subsequently loaded the lap belt webbing which pulled the webbing against the crossbar on the latchplate. The webbing abraded the plastic coating on the crossbar on the back side of the component.

#### SUPPLEMENTAL RESTRAINT SYSTEM

The 1991 Ford LTD Crown Victoria was equipped with a supplemental driver's air bag system that deployed during the multiple impact, off-road crash sequence. The module cover opened in the conventional H-configuration at the designated tear points. The large upper flap measured 20.3cm (8") in width x 12.4cm (4.875"), while the lower flap had respective measurements of 20.3cm (8") x 3.8cm (1.5"). The air bag was constructed of a woven nylon fabric with a neoprene liner and measured approximately 61cm (24") in diameter (seam-to-seam) in its deflated state. Two 2.5cm (1") diameter venting ports were located on the back side of the air bag (side away from driver) at the 2 and 8 o'clock positions. The bag was tethered by four internal tether straps that were sewn to the center face of the bag in a 17.8cm (7") diameter pattern with three rows of orange stitching. Members of the [REDACTED] Highway Patrol's Multi-Disciplinary Accident Investigation Team (M.A.I.T.) properly removed the deployed air bag module from the involved patrol vehicle.

The upper center portion of the air bag was heavily stained by blood from the driver as he came to rest slumped against the deflated air bag. His left hand came to rest under the upper module flap and was pressed against the air bag and the inflator housing. As a result of contact with the hot inflator housing, the heat was transmitted through the bag which subsequently burned the dorsal surface of his left middle, ring, and fifth fingers. The contact also melted the face of the bag at the 9:30 o'clock position. The melted area measured 1.3 x 7.0cm (0.5 x 2.75") and was horizontally located 8.3-9.5cm (3.25-3.75") above the mid point of the bag and 19.1-26cm (7.5-10.25") left of the vertical centerline. The melted area was also located 4.4-10.2cm (1.75-4.0") inboard and toward the driver from the peripheral seam. Upon magnification of the melted area, tissue fragments and blood were found fused to the nylon fabric.

During Calspan's on-site investigation, a representative from TRW (the company that manufactured the air bag module assembly) was present to inspect and dismantle the deployed module assembly for

possible defects. Numerous members of the [REDACTED] Highway Patrol were also present. The TRW representative thoroughly discussed the deployment process of the module and used several models to identify the internal components. During his discussion, he stated that the air bag fabric had a melting point of 154-177° C (310-350° F) and that the nylon/neoprene material would not support a flame. The inflator housing and its internal filtering screens were manufactured from stainless steel. The TRW representative stated that the inflator module reaches deployment temperatures of 300° C (578° F) and cools slowly due to its isolated, non-vented location within the steering assembly.

The module assembly was transported to a state operated laboratory where a machinist drilled and removed the twelve (12) retaining rivets that attached the air bag and inflator module to the stamped mounting bracket. The air bag and the exterior of the inflator module were thoroughly inspected. The internal surface of the air bag and a tether strap were melted from contact with the hot inflator module. The face of the inflator module above the radial inflation ports contained deposits of melted neoprene and woven nylon air bag material. These melted transfers, in combination with the melted air bag which contained tissue and blood deposits, confirmed the source of the burns to the driver's left hand. Additional exterior inspection of the inflator assembly did not yield evidence of component failure. There was no damage or burn-through of the module or filtering screens; therefore, it was agreed upon that further dismantling of the inflator assembly was not necessary. The involved air bag module was identified by the following bar-coded numbers that were affixed to the back side of the mounting bracket:

[REDACTED] and [REDACTED]

**COLLISION**  
**SEQUENCE**

Pre-Crash:

The driver of the marked police 1991 Ford LTD Crown Victoria was on routine patrol and was exiting a parking lot of a local service station to proceed in an easterly direction on the mountainous two-lane state route. As he was about to exit the parking lot, he observed a westbound vehicle traveling at a high rate of speed. The driver activated the vehicle's emergency equipment (flashing lights and siren) and initiated a U-turn to pursue the westbound vehicle.

During the pursuit, the driver of the Crown Victoria had negotiated a moderate left curve; however, as the vehicle exited the curve, it drifted wide onto

the right (north) shoulder. Based on the physical evidence at the crash scene, the driver initiated a counterclockwise steering input and braked in an attempt to maintain control of the vehicle. The right side tires of the vehicle departed the paved right shoulder onto the loose cinder material that bordered the shoulder. As a result the vehicle broke traction and initiated a counterclockwise yaw. The right rear quarter panel impacted a delineator post that was located at the edge of the shoulder. The minor severity impact did not alter the trajectory of the vehicle as it crossed the travel lanes. The vehicle deposited four wheel centrifugal tire marks on the asphalt road surface. The investigating officer documented approximately 76.2m (250') of centrifugal tire marks prior to the vehicle crossing the left (south) white edgeline. At the time of our inspection of the crash scene, which occurred nearly 3 months after the crash, 42.7m (140') of tire marks were still visible on the asphalt road surface. As the vehicle crossed the south (left) edgeline of the roadway, it had rotated approximately 80° in a CCW direction.

The ~~Vehicle~~ Highway Patrol computed an initial speed of 119.1 KPH (74 mph) for the vehicle as it exited the curve, using the critical curve formula.

Crash:

The right front fender of the Crown Victoria impacted and dislodged a steel delineator post from the cinder and earth south shoulder. The impact resulted in minor damage to the vehicle and produced an impact force of 2 o'clock. Again, the minor severity impact with the delineator did not alter the trajectory of the vehicle.

The Crown Victoria exited the shoulder area in a near-broadside orientation and became airborne as it traversed an earth embankment that paralleled the roadway. The embankment had a negative slope of approximately 45°. As the vehicle

traveled down the embankment, the frontal and hood areas contacted overhanging tree branches from a tree that was located 7.6m (25') outboard of the roadedge. The impact produced minor damage to the vehicle as it continued on a broadside trajectory. The front bumper and right push bumper bar impacted several small diameter trees as the undercarriage subsequently contacted the ground, which displaced the front structure upward.

The vehicle began to pitch to its right as its center of gravity continued in a southwesterly direction. The upper surface of the right front fender and hood impacted a 20.3cm (8") diameter tree that was located 9.1m (30') outboard of the roadedge. At impact with the tree, the vehicle had traveled approximately 23m (75') along the embankment. Due to the lateral pitching of the vehicle, the resultant direction of force was non-horizontal (00 o'clock). The vehicle fractured the tree 81.3cm (32") above ground level and overrode the remaining trunk, displacing the roots of the tree.

The right passenger compartment area of the vehicle subsequently impacted a 25.4cm (10") diameter cedar tree that was located 2.4m (8') east of the struck 20.3cm (8") diameter tree. At impact with the tree, the vehicle was pitched slightly to its right and struck the tree with its right roof, siderail, door and sill areas. Maximum crush was 83.8cm (33") located on the siderail at the B-pillar area. Again, the vehicle fractured the 25.4cm (10") diameter tree 1.9m (6'3") above the ground and deflected the remaining stump to the east as it overrode the tree trunk. The force of the impact hurled the upper portion of the tree into a wooded area where it came to rest 6.1m (20') to the east of its struck location.

The supplemental driver's air bag system deployed during the multiple impact crash sequence. Although unconfirmed, the SRS probably deployed early in the sequence

as the front bumper and undercarriage impacted the ground and several small diameter trees. All impacts involved force directions that were primarily lateral (within the 2-3 o'clock sector) and estimated velocity changes that were equivalent to the required threshold of 13-19 KPH (8-12 mph) necessary for deployment.

Post-Crash:

Final  
Rest -

The Ford Crown Victoria came to rest on its wheels at the base of the embankment, facing in a southerly direction. At rest the vehicle was approximately 6.1m (20') east of the struck 25.4cm (10") diameter tree. Due to the slope of the embankment, the vehicle was barely visible from the roadway.

Driver  
Activities -

The driver lost consciousness as a result of a head impact with the intruding roof. He slumped forward over the steering assembly and came to rest with his left hand against the air bag inflation module. Passing motorists noted the dust in the area of the crash and observed the vehicle at rest. They rushed down the embankment and pushed the driver into the seatback as he was bleeding profusely from the nose. Another motorist, who stopped at the scene, drove to a local store and telephoned for police and rescue assistance.

Police  
Activities -

Several police units from the County Sheriff's Department and the Highway Patrol responded to the call and arrived on-scene. The investigating officer received notification of the crash and arrived 47 minutes following the crash.

Rescue  
Activities -

The local fire department and emergency medical personnel responded to the scene. They initially treated and evaluated the driver in the vehicle. He had regained consciousness, but was unaware of what had occurred. The [REDACTED] requested the service of a helicopter transport to a trauma center in [REDACTED] CA.

The driver was removed from the vehicle and carried up the embankment to an awaiting ambulance. He was transported to a remote helicopter landing site and flown to the trauma center where he was admitted for treatment of his injuries.

Scene  
Clearance -

Following the removal and subsequent transport of the driver and the on-scene police investigation, the vehicle was winched up an embankment and towed from the scene.

**HUMAN FACTORS/OCCUPANT DATA**

Driver:	54 year old male
Height:	179.1cm (70.5")
Weight:	99kg (220 lbs.)
Occupation:	Police officer
Active Restraint System Usage:	3-point lap and shoulder belt system
Usage Source:	Vehicle inspection, police report
Eyeglasses:	None
Vehicle Familiarity:	Not assigned patrol vehicle, has driven similar vehicles daily over the past year
Route Familiarity:	Daily, routine patrol area
Trip Plan:	In pursuit of a speeding vehicle
Manner of Transport From Scene:	Ambulanced from the scene to an emergency heliport then flown by helicopter to a trauma center in ██████████, CA
Type of Medical Treatment:	Admitted to the hospital for 24 days for treatment of his injuries, readmitted for follow-up surgeries

## DRIVER INJURIES

<u>Injury</u>	<u>Severity (OIC/AIS)</u>	<u>Source</u>
Fractured right ribs 2-9 with flail chest and right hemothorax	Severe (CRFS-4)	Intruding right B-pillar
Right pulmonary contusion	Serious (CRCP-3)	Intruding right B-pillar
Full thickness thermal burns of the dorsal aspect of the left middle, ring, and 5th fingers with loss of the extensor tendons and devascularization of part of the bones within the digits	Minor (WLBI-1)	Contact against the air bag inflator module
Comminuted fracture of the right radial head	Serious (RRFS-3)	Intruding right roof side rail
Fracture of the right proximal ulna	Moderate (RRFS-2)	Intruding right roof side rail
Closed head injury with loss of consciousness and residual cognitive deficits (amnesia), negative head CT	Moderate (HWKB-2)	Intruding roof panel
Non-displaced fracture of the right zygoma	Moderate (FRFS-2)	Intruding roof panel
T <sub>12</sub> spinous process fracture	Moderate (BSFS-2)	Probable rebound contact into left front door panel or seatback
Right clavicle fracture	Moderate (SRFS-2)	Intruding right roof side rail

<u>Injury</u>	<u>Severity (OIC/AIS)</u>	<u>Source</u>
Displaced     nasal fracture	Moderate (FCFS-2)	Intruding roof
Nasal laceration	Minor (FCLI-1)	Intruding roof and headliner
Right     earlobe laceration	Minor (HRLE-1)	Intruding roof and headliner
Superior     scalp laceration	Minor (HSLI-1)	Intruding roof and headliner
D i s l o c a t e d (loosened)     teeth nos. 5-8	Minor (FIDS-1)	Intruding     roof panel

#### DRIVER KINEMATICS

The driver of the Ford Crown Victoria was in a normal seated position pre-crash with both hands on the steering wheel while in pursuit of the speeding vehicle. He was properly wearing the manual 3-point lap and shoulder belt system. Rstraint usage was supported by driver interview data, blood stains on the upper shoulder belt webbing, and from load induced abrasions on the inner plastic surface of the latchplate. The driver stated that he routinely drove the Crown Victoria with the seat adjusted to a mid-track position and the seatback set to the most vertical position. He added that the tilt steering wheel was adjusted to the center position.

At impact with the trees, the supplemental driver's air bag system deployed. The driver was probably slightly out of position to his right due to the pre-crash counterclockwise rotation of the vehicle. He was further displaced to his right by each tree impact as he responded to the lateral impact forces. The driver's upper torso slid out of the manual shoulder belt webbing while his pelvic area loaded the lap belt portion of the 3-point system. His loading force against the lap belt pulled the webbing through the latchplate which abraded the inner plastic surface of the latchplate's fixed crossbar. The driver's knees contacted the fuse box cover and the knee bolster which scuffed the contacted components. His right knee contacted the bolster at the protrusion for the steering column and disrupted the vinyl covering of the bolster. These contacts did not result in injury to the driver's lower extremities. The lateral aspect of the driver's right knee impacted the left edge of the lower mid instrument panel (scuff mark) and the center mounted police radio equipment. The radio equipment was removed from the vehicle prior to our inspection; however, a bracket for the equipment was deformed to the right,



indicating driver contact. Again, no injury resulted from the lower extremity contact.

The driver's right forearm flailed upward with respect to his seated position and impacted the intruding right roof siderail 20.3-29.2cm (8-11.5") rearward of the upper A-pillar. Tissue transfers evidenced the contact which resulted in a comminuted fracture of the right radial head and a fracture of the right proximal ulna. The driver's right shoulder subsequently impacted and scuffed the intruding right roof side rail immediately forward of the B-pillar. The contact fractured the mid-portion of the driver's right clavicle. His right lateral chest area impacted the intruding right upper B-pillar and possibly the struck tree as the vehicle crushed to maximum engagement. Although no contact evidence was visible on the vinyl jacket covering the B-pillar, the driver sustained fractured right ribs 2-9 with flail chest, right pneumothorax, and a right pulmonary contusion.

The driver's head impacted the intruding headliner and roof panel on the right side of the vehicle. Due to the non-horizontal impact with the tree, the roof was displaced to a vertical orientation over the right front seated position. The head contact was located 36.8-50.8cm (14.5-20") rearward of the upper right A-pillar and 27.9cm (11") above the side rail. The driver's head cracked the backer to the headliner and bowed the roof panel approximately 0.6cm (.25") outward. Faint tissue transfers were visible on the headliner material that surrounded the 11.4cm (4.5") diameter contact. As a result of the impact, the driver sustained a laceration of the superior scalp, a right earlobe laceration, a nasal laceration with a displaced fracture of the nasal bone, a fracture of the right zygoma, and a closed head injury with loss of consciousness and residual cognitive deficits (amnesia). In addition to the head and facial injuries that were identified on the medical reports, the driver stated that he sustained minor dislocations (loosened) of the right upper teeth, nos. 5-8. The dislocated teeth were attributed to the head and facial contact with the intruding roof.

The driver subsequently rebounded across the interior of the vehicle into the left front seatback and/or left front door panel. He sustained a fracture of the spinous process of T<sub>12</sub> from the probable rebound contact. There was no contact evidence to the components from his rebound trajectory. Prior to coming to rest within the vehicle, the driver's left hand moved under the upper air bag module cover flap as the driver slumped forward in an unconscious state against the steering wheel and the air bag module assembly. The dorsal aspect of his left middle, ring, and fifth fingers were pressed against the deflated air bag and the hot inflation module. The heat from the stainless steel inflation module melted the face of the bag and an internal tether strap at the 10 o'clock position and was transmitted into the driver's

fingers, which resulted in full thickness thermal burns with loss of the extensor tendons and devascularization of part of the bones within the digits.

Several passing motorists noted the dust from the crash and observed the vehicle at final rest. They rushed to the vehicle and found the driver slumped against the steering wheel, bleeding profusely from the nasal injuries onto the deflated air bag. The motorists pulled the driver back into the seatback which disengaged his hand from the air bag module assembly.

SELECTED PRINTS



Pre-crash Trajectory Of The Ford Crown Victoria.





Vehicle's Rotational Trajectory Across The Travel Lanes,  
Beginning Of The Right Side Centrifugal Tire Marks.





Beginning Of The Left Side Centrifugal Tire Marks.





Vehicle Departs Left Roadedge In A Near Broadside Orientation.



Vehicle Travels Down Earth Embankment.





Struck Tree Branches  
And 20.3cm (8") and 25.4cm (10") Diameter Cedar Trees.



Remainder of Struck Trees.





Final Impact Sequence Against The 25.4cm (10") Diameter Tree.



Struck And Displaced Delineator Post.





Mid Section Of The Struck  
And Fractured 25.4cm (10") Diameter Tree.



Lookback View Of The Crash Scene.





Lookback View Up The Earth Embankment.



Lookback View Of The Vehicle's Roadway Departure.





Frontal View Of The Ford Crown Victoria.



Tree Impact Damage To The Right Bumper Push Bar.





Left Front Three-Quarter View.



Left Side View.





Left Rear Three-Quarter View.



Rear View.





Right Rear Three-Quarter View.



Right Side View.





Primary Impact Damage To The Right Passenger Compartment Area.



Overhead View Showing The Extent Of Crush.





Tree Impact Damage To The Right Front Fender Area.



Right Front Three-Quarter View.





Overall View Of The Deployed Air Bag.



Melted Area Of The Deployed Air Bag.





Additional Views Of The Melted Area Of The Air Bag.





Upper Air Bag Module Flap.



Perpendicular View Of The Module Flaps.






Interior View With The Air Bag Module Assembly Removed.



Driver's Trajectory And Contact Points.



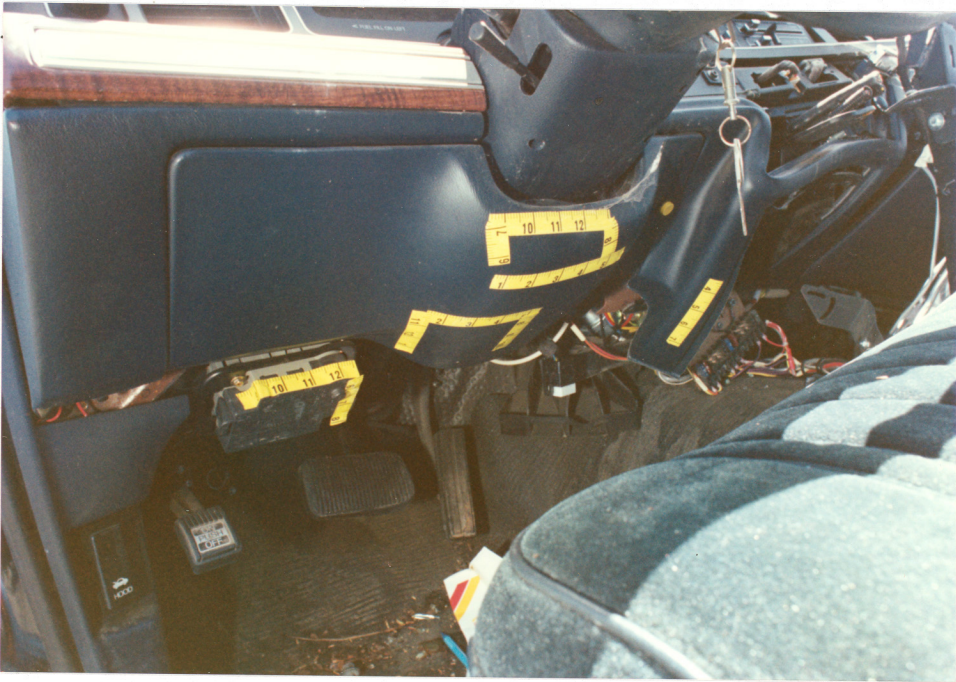

Knee And Lower Leg Contact Points  
To The Knee Bolster And The Lower Panel





Driver's Active 3-Point Belt System.



Belt Loading Abrasions To The Plastic Coating On The Latchplate.






Probable Right Leg Contact To The  
Center Mounted Radio Equipment (Removed).



Head, Arm, And Shoulder Contact Points  
To The Intruding Roof And Side Rail.



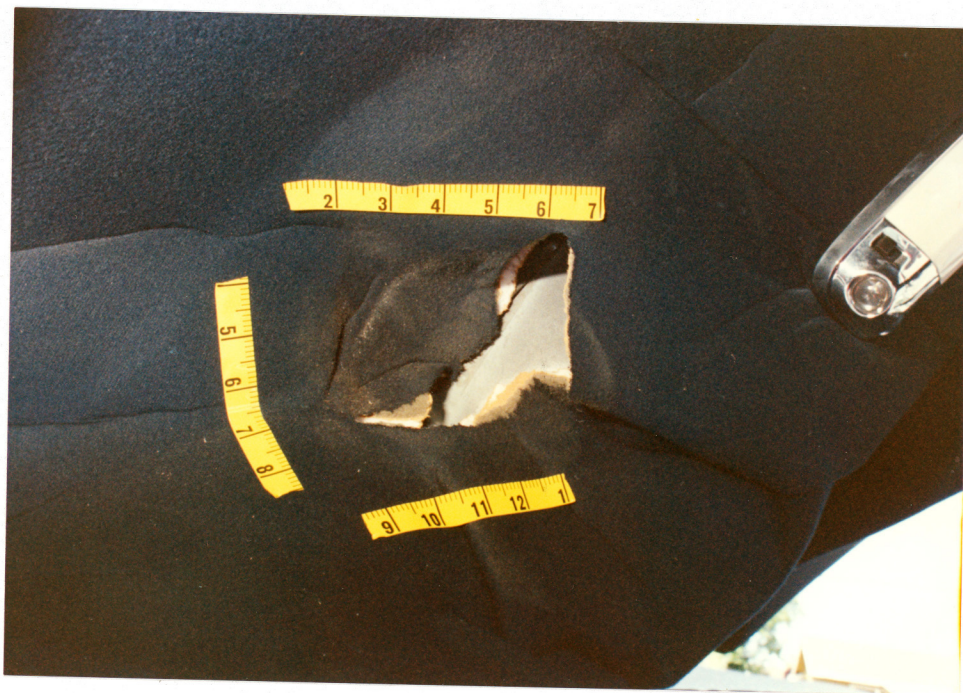

Head Contact To Headliner And Roof.



Right Shoulder And Arm Contacts To The Roof Side Rail.





Apparent Tissue Transfer From Right Forearm Contact  
To Roof Side Rail.



Location Of Burn With Respect To The Center Of The Air Bag.






Closeup Views Of The Burned Area.







Location Of Burn With Respect To The Peripheral Seam.

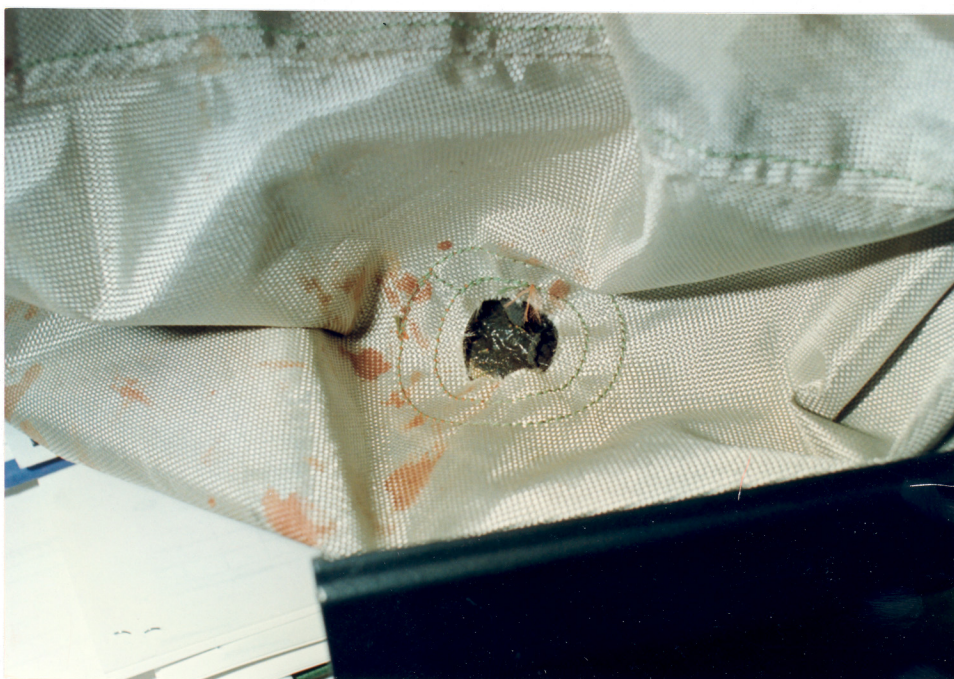


View Of A Melted Internal Tether Strap  
Through The Left Venting Port.



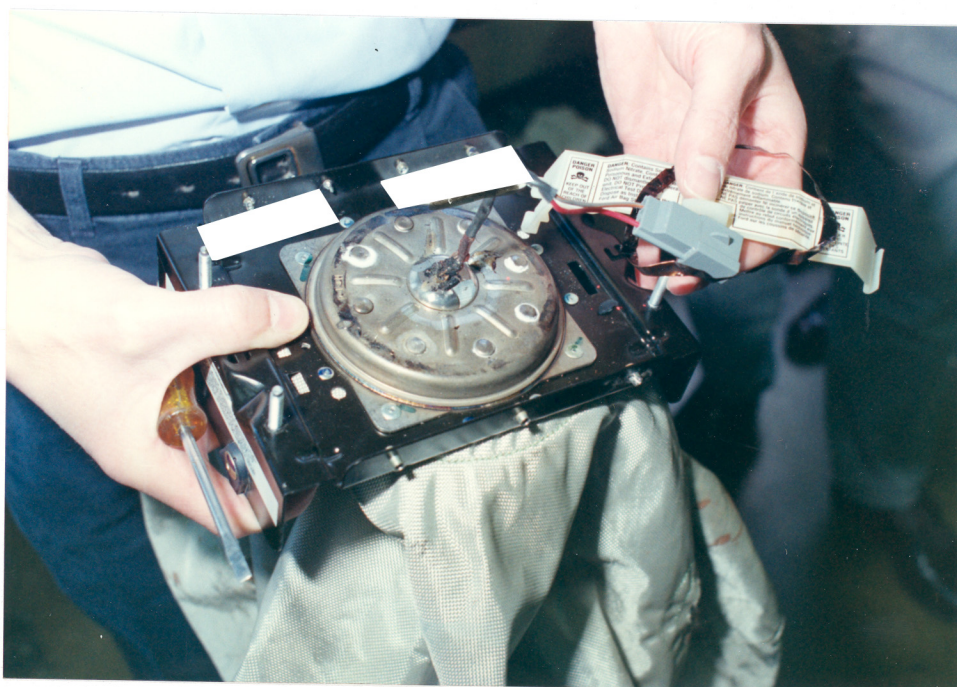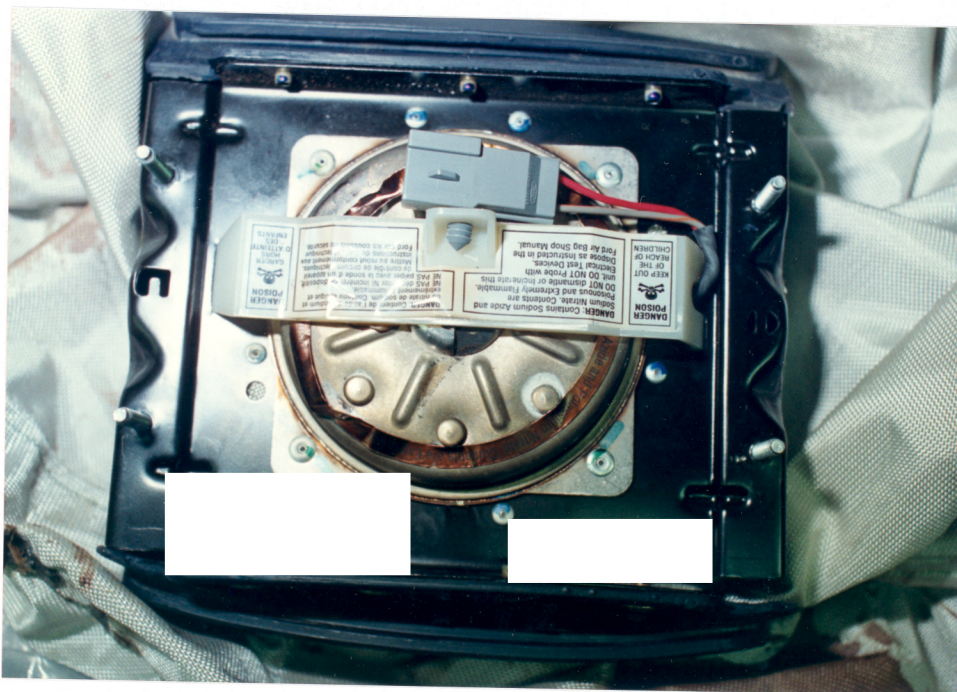


Backside Of The Removed Module Assembly.



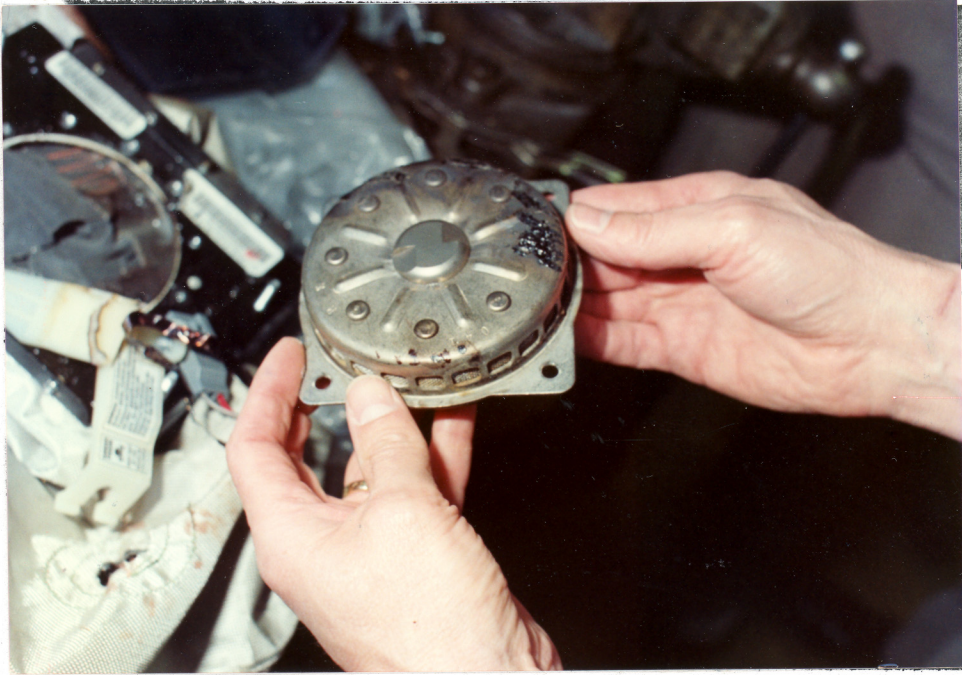

Removed Inflator Assembly From The Retaining Plate.

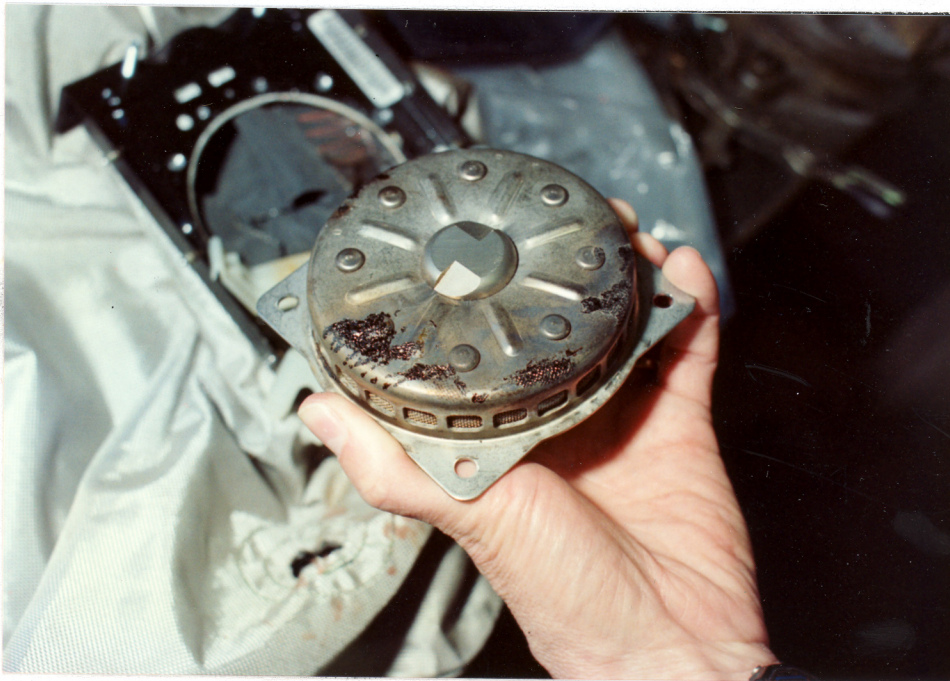

Melted Bag Material On The Face Of The Inflator.






Views Of The Radial Inflation Ports  
Of The Inflator Assembly.



Additional Views Of The Radial Inflation Ports.



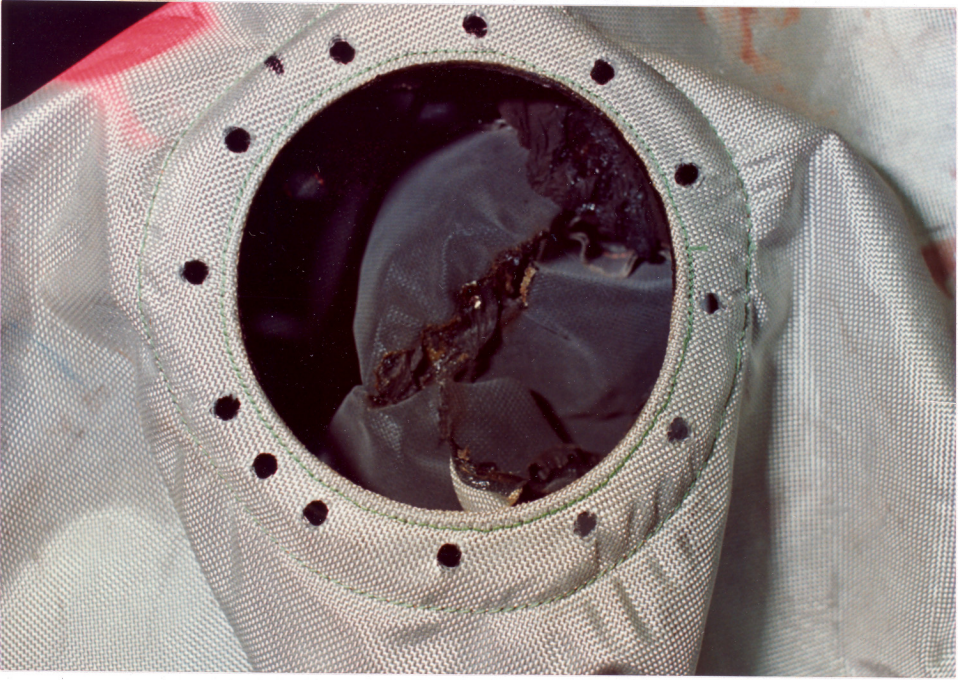

Internal Views Of The Melted Areas Of The Air Bag.



# **“GRAPHIC” PHOTOGRAPHS AND IMAGES**


The following “GRAPHIC” Photographs and Images have been removed from this case.

page 59

If you would like a copy of these photographs and/or images please write to:

MARJORIE SACCOCCIO  
VOLPE NATIONAL TRANSPORTATION SYSTEMS CENTER  
55 BROADWAY  
CAMBRIDGE, MA 02142

In the body of your request please include the case, photograph and image number(s).

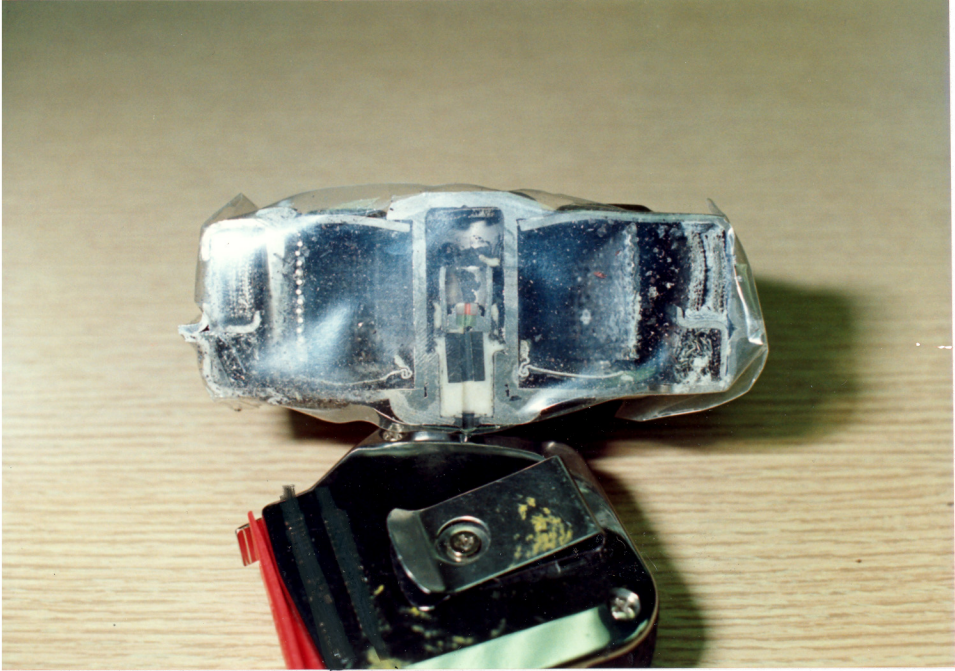

Sectional View Of A Similar TRW Inflator.

## SLIDE INDEX

<u>Slide No(s).</u>	<u>Description</u>
1	Accident schematic
2	Driver injury mannequin
3,4	Pre-crash trajectory of the police vehicle
5	Right rear tire begins to mark
6	Right front and left rear tires begin to mark
7	Left front tire begins to mark
8	Vehicle departs left roadedge in a near broadside orientation
9	Vehicle traverses embankment and contacts tree branches
10	Struck trees
11	Struck tree that resulted in severe right side damage to vehicle
12	Final rest position of vehicle
13	Section of struck tree, impacted tree in foreground
14	Lookback view of vehicle's trajectory
15	Frontal view of the Ford Crown Victoria
16	Left front three-quarter view
17	Left side view, LF door removed by rescue personnel
18	Left rear three-quarter view
19	Rear view
20	Right rear three-quarter view
21	Right side view
22	Primary impact damage to right side area
23	Longitudinal view showing the extent of crush

SLIDE INDEX (CONT'D.)

<u>Slide No(s).</u>	<u>Description</u>
24	Right front three-quarter view
25	Overall interior view of the driver's trajectory and contact points
26	Deployed driver's air bag
27	Steering wheel assembly with module removed
28	Burned (melted) area of air bag with tissue from driver's hand contact
29	Location of burn mark with respect to peripheral seam and vent port
30	Perpendicular view of the module flaps
31,32	Driver's knee/lower leg contacts to the knee bolster
33,34	Driver's head, right shoulder and forearm contacts to the intruding side rail and headliner
35	Tissue transfer from right forearm contact
36	Right shoulder fabric transfer/impression on headliner
37	Driver's head contact to headliner
38	Slight deformation to upper steering wheel rim
39	Blood stain on shoulder belt webbing
40	Belt abrasions to the latchplate

CASE NUMBER CA 9212

# MISSING SLIDES

THE FOLLOWING SLIDES ARE NOT INCLUDED IN THIS CASE:

SLIDE NUMBER(S)

#1

#2

---

---

---

---

---

---

---

---

---

---



CA 9212 #3





CA 9212 #4



CA9212 #5



CA 9212 #6



CA9212 #7



CA9212 #8



CA9212 #9



CA9212 #10





CA9212 #11



CA9212 #12



CA9212 #13





CA9212 #14



CA9212 #15



CA9212 #16





CA9212 #17



CA9212 #18



CA9212 #19





CA 9212 #20



CA 9212 #21



CA9212 #22



CA9212 #23





CA9212 #24



CA 9212 #25  
Best Available



CA9212 #26



CA0212 #27  
Best Availabel





CA 9212 #28  
Best Available



CA 9212 #29  
Best Available



CA 9212 #30  
Best Available



CA9212 #31  
Best Available






CA 9212 #32  
Best Available



CA9212 #33  
Best Available

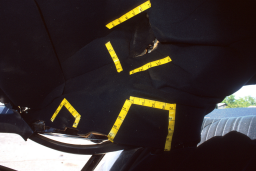


CA 9212 #34  
Best Available




CA 9212 #35  
Best Available



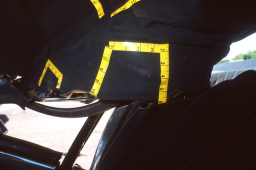

CA9212 #36  
Best Available

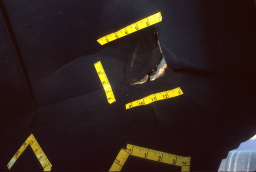

CA9212 #37  
Best Available



CA9212 #38



CA 9212 #39  
Best Available





CA9212 #40

**APPENDIX A**


**Police Accident Report**

PAGE 1 OF 14

59 BEST AVAILABLE COPY

**PAGE**

NOTIFIED  
☐ YES ☐ NO

[illegible]

<input checked="" type="checkbox"/>	A DRY
<input type="checkbox"/>	B WET
<input type="checkbox"/>	C SNOWY - ICY
<input type="checkbox"/>	D SLIPPERY (MUDDY, ONLY, ETC.)

INDICATE NORTH

TREES

LARGE OPEN SPACE



TEL:

04

3

INJURED / WITNESSES / PASSENGERS

PLATE NO. 92		TIME (H:M)		DATE (MM/DD/YY)		STREET		NUMBER									
WITNESS ONLY	PASSENGER ONLY	AGE	SEX	EXTENT OF INJURY ("X" ONE)				INJURED WAS ("X" ONE)					PARTY NUMBER	SEAT POS.	SAFETY EQUIP.	EJECTOR	
				FATAL INJURY	SEVERE INJURY	OTHER VEHICLE INJURY	COMPLAINT OF PAIN	DRIVER	PASSENGER	PEDESTRIAN	BIKES	OTHER					
<input type="checkbox"/>	<input type="checkbox"/>			<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>

NAME / DOB / ADDRESS: PARTY #1

IS ONLY TRANSPORTED BY: AMBULANCE AND CHP HELICOPTER

DESCRIBE INJURY: COMPOUND FRACTURE TO HIS LEFT ELBOW, PNEUMOTHORAX WITH PUNCTURES TO BOTH LUNGS AND A FACIAL FRACTURE TO HIS RIGHT EYE.

IS VICTIM OF VIOLENT CRIME NOTIFIED? ☐

NAME / DOB / ADDRESS: [REDACTED]

IS ONLY TRANSPORTED BY: [REDACTED]

TAKEN TO: [REDACTED]

NAME / DOB / ADDRESS: [REDACTED]

IS ONLY TRANSPORTED BY: [REDACTED]

TAKEN TO: [REDACTED]

DESCRIBE INJURY: [REDACTED]

IS VICTIM OF VIOLENT CRIME NOTIFIED? ☐

NAME / DOB / ADDRESS: [REDACTED]

IS ONLY TRANSPORTED BY: [REDACTED]

TAKEN TO: [REDACTED]

NAME / DOB / ADDRESS: [REDACTED]

IS ONLY TRANSPORTED BY: [REDACTED]

TAKEN TO: [REDACTED]

DESCRIBE INJURY: [REDACTED]

IS VICTIM OF VIOLENT CRIME NOTIFIED? ☐

NAME / DOB / ADDRESS: [REDACTED]

IS ONLY TRANSPORTED BY: [REDACTED]

TAKEN TO: [REDACTED]

NAME / DOB / ADDRESS: [REDACTED]

IS ONLY TRANSPORTED BY: [REDACTED]

TAKEN TO: [REDACTED]

DESCRIBE INJURY: [REDACTED]

IS VICTIM OF VIOLENT CRIME NOTIFIED? ☐

NAME / DOB / ADDRESS: [REDACTED]

IS ONLY TRANSPORTED BY: [REDACTED]

TAKEN TO: [REDACTED]

NAME / DOB / ADDRESS: [REDACTED]

IS ONLY TRANSPORTED BY: [REDACTED]

TAKEN TO: [REDACTED]

DESCRIBE INJURY: [REDACTED]

IS VICTIM OF VIOLENT CRIME NOTIFIED? ☐

NAME / DOB / ADDRESS: [REDACTED]

IS ONLY TRANSPORTED BY: [REDACTED]

TAKEN TO: [REDACTED]

NAME / DOB / ADDRESS: [REDACTED]

IS ONLY TRANSPORTED BY: [REDACTED]

TAKEN TO: [REDACTED]

DESCRIBE INJURY: [REDACTED]

IS VICTIM OF VIOLENT CRIME NOTIFIED? ☐

NAME / DOB / ADDRESS: [REDACTED]

IS ONLY TRANSPORTED BY: [REDACTED]

TAKEN TO: [REDACTED]

TEL:

10.02

RELATIVE/SUPPLEMENTAL

(Rev 7-80) OPI 042

Page 5

DATE OF OCCURRENCE -92-	TIME (2400) 1900	NCIC NUMBER	OFFICER I.D. NUMBER	NUMBER
TYPE OF CASE * Relative Supplemental	* ONE <input checked="" type="checkbox"/> Collision report <input type="checkbox"/> Other:	TYPE SUPPLEMENTAL (IF APPLICABLE) <input type="checkbox"/> BA update <input type="checkbox"/> Fatal <input type="checkbox"/> Hazardous materials <input type="checkbox"/> School bus <input type="checkbox"/> Hit and run update <input type="checkbox"/> Other:		
COUNTY/JUDICIAL DISTRICT			REPORTING DISTRICT/LEAD	CITATION NUMBER
AT SUBJECT SR E. OF			STATE HIGHWAY RELATED <input type="checkbox"/> Yes <input type="checkbox"/> No	

## LEGEND

## STATION LINE:

A station line was established by laying a 100 ft. tape parallel to the center of SR- . Station 0+00 was established at a point approximately 380 feet East of Mile Post AMA 44.00

## STATION LOG:

## STATION:

## LOCATION:

## DESCRIPTION:

0+00	R-8FT. 3IN.	START OF SKID #1 (A THIN LINE CENTRIFUGAL SKID)
0+10	R-8FT. 6IN.	SKID CONTINUES
0+20	R-9FT. 3IN.	SKID CONTINUES
0+30	R-9FT. 8IN.	SKID CONTINUES
0+40	R-9FT. 10IN.	SKID CONTINUES
0+50	R-10FT. 0IN.	SKID CONTINUES
0+60	R-10FT. 3IN.	SKID CONTINUES
0+70	R-10FT. 4IN.	SKID CONTINUES
0+80	R-10FT. 8IN.	SKID CONTINUES
0+90	R-10FT. 7IN.	SKID CONTINUES
1+10	R-10FT. 6IN.	SKID CONTINUES
1+20	R-10FT. 5IN.	SKID CONTINUES
1+30	R-10FT. 4IN.	SKID CONTINUES
1+40	R-10FT. 2IN.	SKID CONTINUES
1+50	R-10FT. 0IN.	SKID CONTINUES
1+60	R-9FT. 8IN.	SKID CONTINUES
1+70	R-9FT. 4IN.	SKID CONTINUES
1+80	R-8FT. 10IN.	SKID CONTINUES
1+90	R-8FT. 2 IN.	SKID CONTINUES
2+00	R-7FT. 4IN.	SKID CONTINUES
2+10	R-6FT. 7IN.	SKID CONTINUES
2+20	R-5FT. 7IN.	SKID CONTINUES
2+30	R-4FT. 6IN.	SKID CONTINUES
2+40	R-3FT. 3 IN.	SKID CONTINUES
2+50	R-2FT. 2IN.	SKID CONTINUES

REPORTER'S NAME AND I.D. NUMBER

DATE

REVIEWER'S NAME

DATE

Use previous editions until depleted.

CALIFORNIA  
 RELATIVE/SUPPLEMENTAL

556 (Rev 7-90) OPI 042

Page 6

INCIDENT/OCCURRENCE # 92	TIME (2400) [REDACTED]	NCIO NUMBER [REDACTED]	OFFICER ID. NUMBER [REDACTED]	NUMBER [REDACTED]
TYPE Relative Supplemental	<input type="checkbox"/> Collision report <input type="checkbox"/> Other:	TYPE SUPPLEMENTAL (IF APPLICABLE) <input type="checkbox"/> BA update <input type="checkbox"/> Fatal <input type="checkbox"/> Hit and run update <input type="checkbox"/> Hazardous materials <input type="checkbox"/> School bus <input type="checkbox"/> Other:		
COUNTY/JUDICIAL DISTRICT [REDACTED]				REPORTING DISTRICT/BEAT [REDACTED]
SUBJECT SC [REDACTED] E. of [REDACTED]				CITATION NUMBER [REDACTED]  STATE HIGHWAY RELATED <input type="checkbox"/> Yes <input type="checkbox"/> No

 2+60  
 2+70  
 STATION:

 R-0FT 6IN.  
 L-1 FT 0IN.  
 LOCATION:

 SKID CONTINUES  
 SKID CONTINUES  
 DESCRIPTION:

 2+80  
 3+10  
 3+24  
 3+48

 L-4FT 8IN.  
 L-9FT. 0IN.  
 L 13 FT.  
 L 18FT 2IN...

 SKID #1 CONTINUES  
 SKID CONTINUES  
 SKID LEAVES ASPHALT  
 SKID GOES OVER EMBANK-  
 MENT.

 0+60  
 0+70  
 0+80

 R-11FT. 4IN.  
 R-11FT. 6IN.  
 R-11FT. 8IN.

 START OF SKID #2  
 SKID CONTINUES  
 SKID CONTINUES (EDGE OF  
 ASPHALT, WHICH IS  
 COVERED WITH DIRT)  
 SKID CONTINUES.  
 SKID CONTINUES IN DIRT.  
 SKID CONTINUES  
 SKID CONTINUES  
 SKID CONTINUES  
 SKID CONTINUES  
 SKID CONTINUES  
 SKID CONTINUES  
 SKID CONTINUES (WIDE  
 SKID AND AT THE RT.  
 EDGE LINE).

 0+90  
 1+00  
 1+20  
 1+40  
 1+60  
 1+80  
 2+00  
 2+20

 R-11FT. 10IN.  
 R-12FT. 4IN.  
 R-12FT 8IN.  
 R-12FT. 9IN.  
 R-12FT. 8IN.  
 R-12FT. 5IN.  
 R-11FT. 10IN.  
 R-10FT. 9IN.

 SKID CONTINUES  
 SKID CONTINUES  
 SKID CONTINUES  
 SKID CONTINUES  
 SKID CONTINUES  
 SKID CONTINUES  
 SKID CONTINUES  
 SKID CONTINUES, A THICK  
 SIDE SKID.  
 SKID ON EDGE LINE  
 SKID ENDS OVER THE  
 EMBANKMENT.

 2+40  
 2+60  
 2+80  
 3+00  
 3+10  
 3+30

 R-9FT. 4 IN.  
 R-7FT. 1 IN.  
 R-4FT. 6 IN.  
 R-1FT. 0IN.  
 L-1FT. 1IN.  
 L-5FT. 8IN.

 3+50  
 3+75

 L-10FT. 5IN.  
 L-16FT. 4IN.

 2+10  
 2+30

 R-1FT 10 IN.  
 CENTER LINE

 START OF SKID #3.  
 SKID CONTINUES ACROSS  
 CENTER LINE.  
 SKID CONTINUES  
 SKID CONTINUES

 2+40  
 2+60

 L-1FT. 0IN.  
 L-3FT. 8IN.

NAME AND ID. NUMBER

REVIEWER'S NAME

DATE

Use previous editions until depleted.

20 87941

TEL:

STATE OF CALIFORNIA  
RELATIVE/SUPPLEMENTAL

556 (Rev 7-90) OPI 042

INCIDENT/OCCURRENCE 1-7-92		TIME (2400) [REDACTED]	NCIC NUMBER [REDACTED]	OFFICER ID NUMBER [REDACTED]	NUMBER [REDACTED]
TYPE 1. Relative 2. Supplemental	<input type="checkbox"/> Collision report <input type="checkbox"/> Other:	TYPE SUPPLEMENTAL (IF APPLICABLE) <input type="checkbox"/> BA update <input type="checkbox"/> Fatal <input type="checkbox"/> Hit and run update <input type="checkbox"/> Hazardous materials <input type="checkbox"/> School bus <input type="checkbox"/> Other:			
COUNTY/JUDICIAL DISTRICT				REPORTING DISTRICT/BEAT	CITATION NUMBER
AT SUBJECT SP [REDACTED] E. of [REDACTED]				STATE HIGHWAY RELATED <input type="checkbox"/> Yes <input type="checkbox"/> No	

2+90	L-6FT. 10IN.	SKID CONTINUES
3+00	L-10FT 3IN.	SKID CONTINUES
STATION:	LOCATION:	DESCRIPTION:
3+20	L-14FT. 5IN.	SKID #3 CONTINUES
3+40	L-18FT. 0IN.	END OF SKID, OVER THE EMBANKMENT.
2+17	R-6FT 5 IN.	START OF SKID #4
2+30	R-5FT. 8IN.	SKID CONTINUES
2+50	R-4FT. 0IN.	SKID CONTINUES
2+60	R-3FT. 2IN.	SKID CONTINUES
2+70	R-2FT. 1IN.	SKID CONTINUES
2+80	R-0FT. 8IN.	SKID CONTINUES
2+90	L-1FT. 0IN.	SKID CONTINUES
3+00	L-2FT. 1IN.	SKID CONTINUES
3+10	L-4FT 7IN.	SKID CONTINUES
3+20	L-6FT 5IN.	SKID CONTINUES
3+30	L-8FT 10IN.	SKID CONTINUES
3+40	L-11FT 7 IN.	END OF SKID THAT WAS VISIBLE.
3+85	L-39FT	LOWER LIMBS OF PINE TREE DAMAGED TO A HEIGHT OF 8FT 2INCHES ABOVE GROUND LEVEL.
3+95	L-41FT.	MARKS IN THE DIRT & BRUSH LEFT BY V-1.
4+10	L-43FT.	STUMP OF PINE TREE, DOWNED TREE S. OF STUMP.
4-17	L-45FT.	STUMP OF PINE TREE, DOWNED TREE IN THE SAME AREA.
4-60	L-50FT.	POINT OF REST OF V-1 AT REST IN AN UP RIGHT POSITION.

NAME AND ID NUMBER [REDACTED]	DATE [REDACTED]	REVIEWER'S NAME [REDACTED]	DATE [REDACTED]
----------------------------------	--------------------	-------------------------------	--------------------

Use previous editions until depleted.



STATE OF CALIFORNIA  
NARRATIVE/SUPPLEMENTAL

856 (Rev 7-90) OPI 042

Page 8

DATE OF INCIDENT/OCCURRENCE [REDACTED] 92		TIME (2400) [REDACTED]	NCIC NUMBER [REDACTED]	OFFICER ID NUMBER [REDACTED]	NUMBER [REDACTED]
TYPE OF INCIDENT <input checked="" type="checkbox"/> Narrative <input type="checkbox"/> Supplemental		TYPE SUPPLEMENTAL (IF APPLICABLE) <input type="checkbox"/> BA update <input type="checkbox"/> Hazardous materials		<input type="checkbox"/> Fatal <input type="checkbox"/> School bus <input type="checkbox"/> Hit and run update <input type="checkbox"/> Other	
CITY/COUNTY/JUDICIAL DISTRICT				REPORTING DISTRICT/BEAT	CITATION NUMBER
ATTENTION/SUBJECT				STATE HIGHWAY RELATED <input type="checkbox"/> Yes <input type="checkbox"/> No	

FACTS

1. NOTIFICATION RECEIVED CALL AT APPROX. [REDACTED] HRS. AT  
 2. SCENE AT APPROX [REDACTED] HRS. PRIOR UNITS ON SCENE.  
 3. C.F. ENGINE [REDACTED] S.O. SGT [REDACTED], DEPUTY [REDACTED]  
 4. AND CHP OFF. [REDACTED] ALONG WITH E.M.S. PERSONNEL.

5. SCENE IS AN EAST-WEST, TWO WAY,  
 6. TWO LANED RURAL MOUNTAINOUS HIGHWAY WITH  
 7. NUMEROUS TURNS AND GRADES. AT SCENE THE ROAD  
 8. FOR WEST BOUND TRAFFIC, HAS A SWEEPING LEFT  
 9. CURVE ON A 4% DOWN GRADE. THE ROAD CONSISTS  
 10. OF ASPHALT AND APPROX. 2' NORTH OF THE NORTH  
 11. EDGE LINE IS A DRAINAGE DITCH APPROX 1 1/2' DEEP  
 12. FOLLOWED BY A STEEP UPHILL EMBANKMENT.  
 13. OFF THE SOUTH ROAD EDGE IS A CINDER SHOULDER  
 14. AREA VARYING IN WIDTH BY 6 TO 7'. FOLLOWED BY  
 15. A STEEP DOWNHILL EMBANKMENT. THE EAST AND  
 16. WEST BOUND LANES ARE SEPARATED BY A PAINTED  
 17. DOUBLE YELLOW LINE. — HEAVILY FORESTED  
 18. AREA WITH NUMEROUS PINES AND CEDARS VARYING  
 19. IN SIZE FROM FULL GROWN TREES TO SAPLINGS. SEE  
 20. FACTUAL DIAGRAM FOR ROAD ALIGNMENT AND  
 21. MEASUREMENTS.

22. CITATION — AS LISTED ON PG # 3

23. DAMAGE — V-1 WAS FOUND ON IT'S WHEELS FACING  
 24. A SOUTH-WEST DIRECTION APPROX. 40' DOWN  
 25. EMBANKMENT OFF SOUTH ROAD EDGE. — V-1 SUSTAINING  
 26. TOTAL DAMAGE TO TOP FRONT, REAR AND RIGHT SIDE.

REPORTER'S NAME (OLD NUMBER)

DATE

REVIEWER'S NAME

DATE

TEL:

STATE OF CALIFORNIA  
NARRATIVE/SUPPLEMENTAL

Page 9

856 (Rev 7-90) OPI 042

DATE OF INCIDENT/OCCURRENCE

TIME (2400)

NCIC NUMBER

OFFICER I.D. NUMBER

NUMBER

92

TYPE

TYPE

Narrative

☒ Collision report☐ Supplemental☐ Other:

TYPE SUPPLEMENTAL (IF APPLICABLE)

☐ RA update☐ Fatal☐ Hit and run update☐ Hazardous materials☐ School bus☐ Other:

CITY/COUNTY/JUDICIAL DISTRICT

REPORTING DISTRICT/BEAT

CITATION NUMBER

TITLE/SUBJECT

STATE HIGHWAY RELATED

☐ Yes☐ NoFACTS CONTINUED

6. MECHANICAL - TIRE PRESSURE WAS CHECKED ON V-1 L-F 37 LBS - R-F 38 LBS - L-R 37 LBS AND R-R WITH RIM DAMAGE AT 13 LBS. THE FRONT TIRES HAD 12/32 TREAD DEPTH, R-R 12/32, L-R 5/32. APPROX 1600 MILES ON FRONT BRAKES.

7. SKIDS - V-1 LEFT SEVERAL CENTRIFUGAL TO BROADSIDE SKIDS. LENGTH AND LOCATION SHOWN ON DIAGRAM. - SPEED SKID ANALYSIS BY CPL [REDACTED] REVEALED A SPEED OF APPROX 73 MPH.

8. FIXED OBJECTS - TWO CEDAR TREES APPROX 15 INCHES IN DIAMETER AND SEVERAL SAPLINGS. A CEDAR SNAG ALSO APPROX 15" IN DIAMETER.

9. LOCATION OF DRIVER - P-1 WAS PINNED BEHIND THE WHEEL OF THE PATROL UNIT AND HAD TO BE EXTRICATED BY FIRE AND E.M.S. PERSONNEL. - P-1 TAKEN VIA [REDACTED] AMBULANCE TO THE [REDACTED] AND THEN FLOWN VIA CHP H-20 TO [REDACTED].

REPORTER'S NAME AND I.D. NUMBER

DATE

REVIEWER'S NAME

DATE

Use previous editions until depleted.

80 8741

STATE OF CALIFORNIA  
NARRATIVE/SUPPLEMENTAL

HP 856 (Rev 7-90) OPI 042

Page 10

DATE OF INCIDENT/OCCURRENCE 9-2		TIME (2400) [REDACTED]	NOIC NUMBER [REDACTED]	OFFICER I.D. NUMBER [REDACTED]	NUMBER [REDACTED]
<input type="checkbox"/> ONE <input type="checkbox"/> Narrative <input type="checkbox"/> Supplemental		<input checked="" type="checkbox"/> ONE <input checked="" type="checkbox"/> Collision report <input type="checkbox"/> Other:		TYPE SUPPLEMENTAL (IF APPLICABLE) <input type="checkbox"/> EA update <input type="checkbox"/> Fatal <input type="checkbox"/> Hazardous materials <input type="checkbox"/> School bus <input type="checkbox"/> Hit and run update <input type="checkbox"/> Other:	
CITY/COUNTY/JUDICIAL DISTRICT				REPORTING DISTRICT/BEAT	CITATION NUMBER
TIONS/SUBJECT				STATE HIGHWAY RELATED <input type="checkbox"/> Yes <input type="checkbox"/> No	

## STATEMENTS - WITNESSES

MRS. [REDACTED] CONTACTED [REDACTED] PHONE ON [REDACTED] 92  
 AT APPROX 200 HRS. MRS. [REDACTED] RELATED, WE WERE  
 IN MR [REDACTED] CAR - MY HUSBAND [REDACTED] WAS IN THE  
 REAR AND I WAS IN THE RIGHT FRONT AND MR  
 [REDACTED] WAS DRIVING. AS WE WERE GOING  
 E/B SR [REDACTED] THIS LIGHT COLORED FULL SIZE CAR  
 POSSIBLY A CHRYSLER OR CAD CAME W/B AROUND  
 THIS CURVE TO THE LEFT OF THE CENTER LINE.  
 [REDACTED] MOVED TO HIS RIGHT AS THE LT. COLORED  
 CAR GOT BACK INTO THE W/B LANE AND WENT PAST  
 US VERY FAST. WHEN HE PASSES I SAW A MALE  
 DRIVER WITH BROWN HAIR. I CANNOT SAY FOR SURE  
 IF THERE WAS A PASSENGER. MRS. [REDACTED] CONTINUED  
 WE PROCEEDED E/B COMING AROUND THIS CURVE WHEN I  
 SAW THE POLICE CAR SIDEWAYS IN THE MIDDLE OF THE RD.  
 GO OVER THE SIDE.

MR. [REDACTED] SAID DRIVER OF WITNESS VEHICLE RELATED  
 I WAS E/B SR [REDACTED] WHEN THIS LT COLORED FULL SIZED  
 CAR CAME W/B AROUND THIS CURVE APPROX 1 1/2' INTO  
 MY LANE. I SLOWED AND MOVED TO MY RIGHT  
 AS FAR AS I COULD GO. THE OTHER CAR WENT  
 BACK INTO THE W/B LANE AS HE PASSED. THERE WAS  
 A MALE DRIVER AND A FEMALE PASSENGER. AS  
 I CONTINUED E/B AND CAME AROUND THIS CURVE  
 I SAW THE POLICE CAR W/B ON THE RIGHT SHOULDER  
 WITH A LOT OF DUST. AS IT CAME OFF THE SHOULDER

AREA'S NAME AND NUMBER

DATE

REVIEWER'S NAME

DATE

IT... OF CALIFORNIA

## NARRATIVE/SUPPLEMENTAL

536 (Rev 7-80) OPI 042

Page 11

DATE OF INCIDENT/OCCURRENCE [REDACTED] - 92	TIME (2400) [REDACTED]	NCIC NUMBER [REDACTED]	OFFICER I.D. NUMBER [REDACTED]	NUMBER [REDACTED]
<input checked="" type="checkbox"/> Narrative <input type="checkbox"/> Supplemental		<input checked="" type="checkbox"/> Collision report <input type="checkbox"/> Other:		<input type="checkbox"/> BA update <input type="checkbox"/> Hazardous materials
<input type="checkbox"/> Fatal <input type="checkbox"/> School bus		<input type="checkbox"/> Hit and run update <input type="checkbox"/> Other:		
CITY/COUNTY/JUDICIAL DISTRICT				REPORTING DISTRICT/BEAT
CITATION NUMBER				
STATE HIGHWAY RELATED				
<input type="checkbox"/> Yes <input type="checkbox"/> No				

## STATEMENTS (WITNESSES)

IT WENT SIDEWAYS ACROSS THE ROAD AND OVER THE EMBANKMENT. I SAW THE TREES SHAKE AND PARTS FLEW ALL OVER. AFTER THAT WE WENT FOR HELP AND RETURNED.

Q. HOW FAR AHEAD OF YOU DID THE PATROL UNIT CROSS AS IT WAS GOING OVER THIS SIDE?

A ABOUT 50'.

UNABLE TO OBTAIN STATEMENT FROM P-1 AT THIS TIME DUE TO SEVERE INJURY SUSTAINED.

PREPARED BY NAME AND I.D. NUMBER [REDACTED]	REVIEWER'S NAME [REDACTED]	DATE [REDACTED]
--	-------------------------------	--------------------

Use previous editions until depleted.

STATE OF CALIFORNIA

## NARRATIVE/SUPPLEMENTAL

Page 12

556 (Rev 7-90) OPI 042

DATE OF INCIDENT/OCCURRENCE [REDACTED]-92	TIME (2400) [REDACTED]	NOIO NUMBER [REDACTED]	OFFICER I.D. NUMBER [REDACTED]	NUMBER [REDACTED]
TYPE <input type="checkbox"/> Narrative <input checked="" type="checkbox"/> Supplemental		TYPE SUPPLEMENTAL (X APPLICABLE) <input type="checkbox"/> BA update <input type="checkbox"/> Fatal <input type="checkbox"/> Hazardous materials <input type="checkbox"/> School bus		<input type="checkbox"/> Hit and run update <input type="checkbox"/> Other:
CITY/COUNTY/JUDICIAL DISTRICT [REDACTED]			REPORTING DISTRICT/BEAT [REDACTED]	CITATION NUMBER [REDACTED]
ATTORNEY/SUBJECT SR [REDACTED] 2 MI. E. [REDACTED]			STATE HIGHWAY RELATED <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No	

## STATEMENTS

2. STATEMENT OF WITNESSES [REDACTED] (41) OF [REDACTED], PH# [REDACTED] AND [REDACTED] OF [REDACTED], PH# [REDACTED].

WITNESSES STATED THEY WERE W/R SR [REDACTED] EAST OF [REDACTED] STATION ABOUT [REDACTED] PM ON [REDACTED]-92 WHEN THEY SAW A WHITE VEH CLOSING FAST ON THEM FROM BEHIND. AS THEY MADE A LEFT TURN INTO [REDACTED] STATION, THEY SAW A HIGHWAY PATROL UNIT DRIVING SLOW THROUGH THE PARKING AREA IN FRONT OF [REDACTED] STATION. JUST ABOUT THIS TIME THE WHITE CAR WENT BY W/R AT A HIGH SPEED, APPROX 25 MPH. THE HIGHWAY PATROL UNIT THEN MADE A U-TURN AND TURNED ON EMERGENCY LIGHTS AND CHASED AFTER THE WHITE CAR W/R ON HWY [REDACTED]. WITNESSES WERE NOT ABLE TO ID. THE SPEEDING VEH. OTHER THAN A WHITE CAR.

THESE WITNESSES WERE CONTACTED BY WRITER DURING A.I. FOLLOW-UP [REDACTED]-92 AT [REDACTED] STATION.

PREPARED BY NAME AND I.D. NUMBER

REVIEWER'S NAME

DATE

Use previous editions until depleted.



51 OF CALIFORNIA  
 NARRATIVE/SUPPLEMENTAL

C 558 (Rev 7-80) OPI 042

Page 13

DATE OF INCIDENT/OCCURRENCE 9-2		TIME (2400) [REDACTED]	REPORT NUMBER [REDACTED]	OFFICER ID NUMBER [REDACTED]	NUMBER [REDACTED]
<input type="checkbox"/> Narrative <input type="checkbox"/> Supplemental		<input checked="" type="checkbox"/> Collision report <input type="checkbox"/> Other:		TYPE SUPPLEMENTAL (IF APPLICABLE) <input type="checkbox"/> BA update <input type="checkbox"/> Hazardous materials <input type="checkbox"/> Fatal <input type="checkbox"/> School bus	
CITY/COUNTY/JUDICIAL DISTRICT				REPORTING DISTRICT/BEAT	CITATION NUMBER
LOCATION/SUBJECT				STATE HIGHWAY RELATED <input type="checkbox"/> Yes <input type="checkbox"/> No	

## OPINIONS AND CONCLUSIONS

IT IS APPARENT THROUGH PHYSICAL EVIDENCE AND INDEPENDENT WITNESS STATEMENTS THAT P-1 WAS E/B SR LEAVING THE PARKING LOT OF [REDACTED] STATION WHEN HE OBSERVED A SPEEDING W/B VEHICLE DESCRIBED AS A LIGHT COLORED FULL SIZED VEHICLE. SEEING THIS P-1 MADE A U-TURN, ACTIVATED HIS EMERGENCY LIGHTS AND PROCEEDED W/B SR IN AN ATTEMPT TO APPREHEND ERRANT DRIVER. — P-1 CONTINUING W/B SR AT A HIGH RATE OF SPEED ENTERED A SWEEPING LEFT CURVE ON A DOWN GRADE. P-1 DRIFTED UPON THE RIGHT SHOULDER, OVERCORRECTED AND LOST CONTROL. — P-1 CROSSED THE E/B LANE IN FRONT OF WITNESSES [REDACTED] AND CONTINUED ACROSS SOUTH SHOULDER AREA AND DOWN SAID EMBANKMENT. IN GOING DOWN EMBANKMENT V-1 STRUCK A CEDAR SNAG AND SEVERAL CEDAR TREES CAUSING TOTAL DAMAGE TO V-1.

POINT OF IMPACT. — APPROX. 0.75 MILES EAST OF [REDACTED] AND APPROX 30' SOUTH OF THE SOUTH ROAD EDGE OF SR — ESTABLISHED BY PHYSICAL EVIDENCE

THE ONLY DESCRIPTION OF THE VEHICLE P-1 WAS TRYING TO OVERTAKE IS A LIGHT COLORED FULL SIZED VEHICLE WITH A MALE DRIVER AND POSSIBLY A FEMALE PASSENGER.

PREPARED BY NAME AND ID NUMBER [REDACTED]	DATE 9-2	REVIEWER'S NAME [REDACTED]	DATE [REDACTED]
--	-------------	-------------------------------	--------------------

Use previous editions until depleted.

TEL :

NCSA

015

TA OF CALIFORNIA  
NARRATIVE/SUPPLEMENTAL

H- 856 (Rev 7-90) OPI 042

Page 14

OF INCIDENT/OCCURRENCE [REDACTED] 92	TIME (MOO) [REDACTED]	NCIC NUMBER [REDACTED]	OFFICER ID. NUMBER [REDACTED]	NUMBER [REDACTED]
*X ONE <input checked="" type="checkbox"/> Narrative <input type="checkbox"/> Supplemental	*X ONE <input checked="" type="checkbox"/> Collision report <input type="checkbox"/> Other:	TYPE SUPPLEMENTAL (X APPLICABLE) <input type="checkbox"/> BA update <input type="checkbox"/> Hazardous materials <input type="checkbox"/> Fatal <input type="checkbox"/> School bus <input type="checkbox"/> Hit and run update <input type="checkbox"/> Other:		
CITY/COUNTY/JUDICIAL DISTRICT				REPORTING DISTRICT/STATE [REDACTED]
CITATION NUMBER				STATE HIGHWAY RELATED <input type="checkbox"/> Yes <input type="checkbox"/> No
TION/SUBJECT				

OPINIONS AND CONCLUSIONS CONTRECOMMENDATIONS

NONE

PREPARED BY NAME AND OLD NUMBER

DATE

REVIEWER'S NAME

DATE

Use previous editions until depleted.

90 57541

TEL:

73

DEPARTMENT OF CALIFORNIA HIGHWAY PATROL  
KID-SPEED INFORMATION

ACCIDENT NUMBER <b>92-92</b>		ACCIDENT LOCATION <b>SR</b>		ACCIDENT DATE <b>92</b>		TEST DATE <b>92</b>	
ROAD CONDITIONS <b>ASPHALT</b> <b>GOOD</b> <b>GRADE W/B</b>		ACCIDENT SKID DATA				CENTRIFUGAL SKID	
		SPENDING		LOCKED WHEEL		TOTAL	
		L.F.				LENGTH <b>50+</b>	
		R.F.				CHORD <b>50</b>	
		L.R.				MID-ORDINATE <b>6 1/2 IN. = .54F</b>	
		R.R.					
		ACCIDENT VEHICLE (year, make, model)				AVERAGE THIS	

TEST SKID INFORMATION								OTHER DATA		
MPH	L.F.	R.F.	L.R.	R.R.	LONGEST	DETECTOR DISTANCE	DRIVER	I.D. NUMBER		
							VEHICLE LIC. OR EQUIP. NO.	MAKE	YEAR/MODEL	
							ACTUAL SPEED	DATE CALIBRATED	BARAN SPEED	
METHOD SKIDMARKS MEASURED							WEATHER (temp.)		TIME	
<input checked="" type="checkbox"/> TAPES <input type="checkbox"/> SOLATAPE <input type="checkbox"/> OTHER <input checked="" type="checkbox"/> TAPES <input type="checkbox"/> SOLATAPE <input type="checkbox"/> OTHER							ACCIDENT TEST		ACCIDENT TEST	
INVESTIGATING OFFICER-ACCIDENT							I.D. NUMBER			
FIELD OFFICER							I.D. NUMBER		COEF. OF FRICTION	

DRAG SLED DATA					
WEIGHT <b>38 LBS</b>	FULL WEIGHT <b>27 LBS</b>	FORMULA <b>1 - FULL WT. SLED WT.</b>	CALCULATED COEF. <b>.71</b>	ADJUSTMENT VALUE <b>LESS 10%</b>	ADJUSTED COEFFICIENT <b>.63</b>

CALCULATIONS/DIAGRAM

$$R = \frac{C^2}{8m} + \frac{m}{2}$$

$$\frac{2500}{8(.54)} + \frac{54}{2}$$

$$\frac{2500}{4.32} + .07$$

$$578.70 + .27$$

$$R = 578.97$$

$$V = \sqrt{15 R f}$$

$$\sqrt{15(578.97) .63}$$

$$\sqrt{5471.26}$$

$$V = 73.96$$

INVOLVED MAJOR INJURY SOLO T.C., SR EAST STATION.

SYMBOLS	FORMULAS	EXAMPLE: CENTRIFUGAL SKIDMARK
f - COEFFICIENT OF FRICTION V - SPEED (MPH) d - SKID LENGTH (FT)	$C = \frac{V^2}{20d}$ $m = \frac{C^2}{8f}$ $R = \frac{m}{2}$	

TEL:

DATE OF COLLISION

TIME

NCIC  
NUMBEROFFICER  
I.D.

NUMBER (Pg 4)

DAY

YR. 92


PAGE # 4

PINE / CEDAR TREES  
AND BRUSH.

HILL SIDE


73 STEEP EMBANKMENT

TEL:

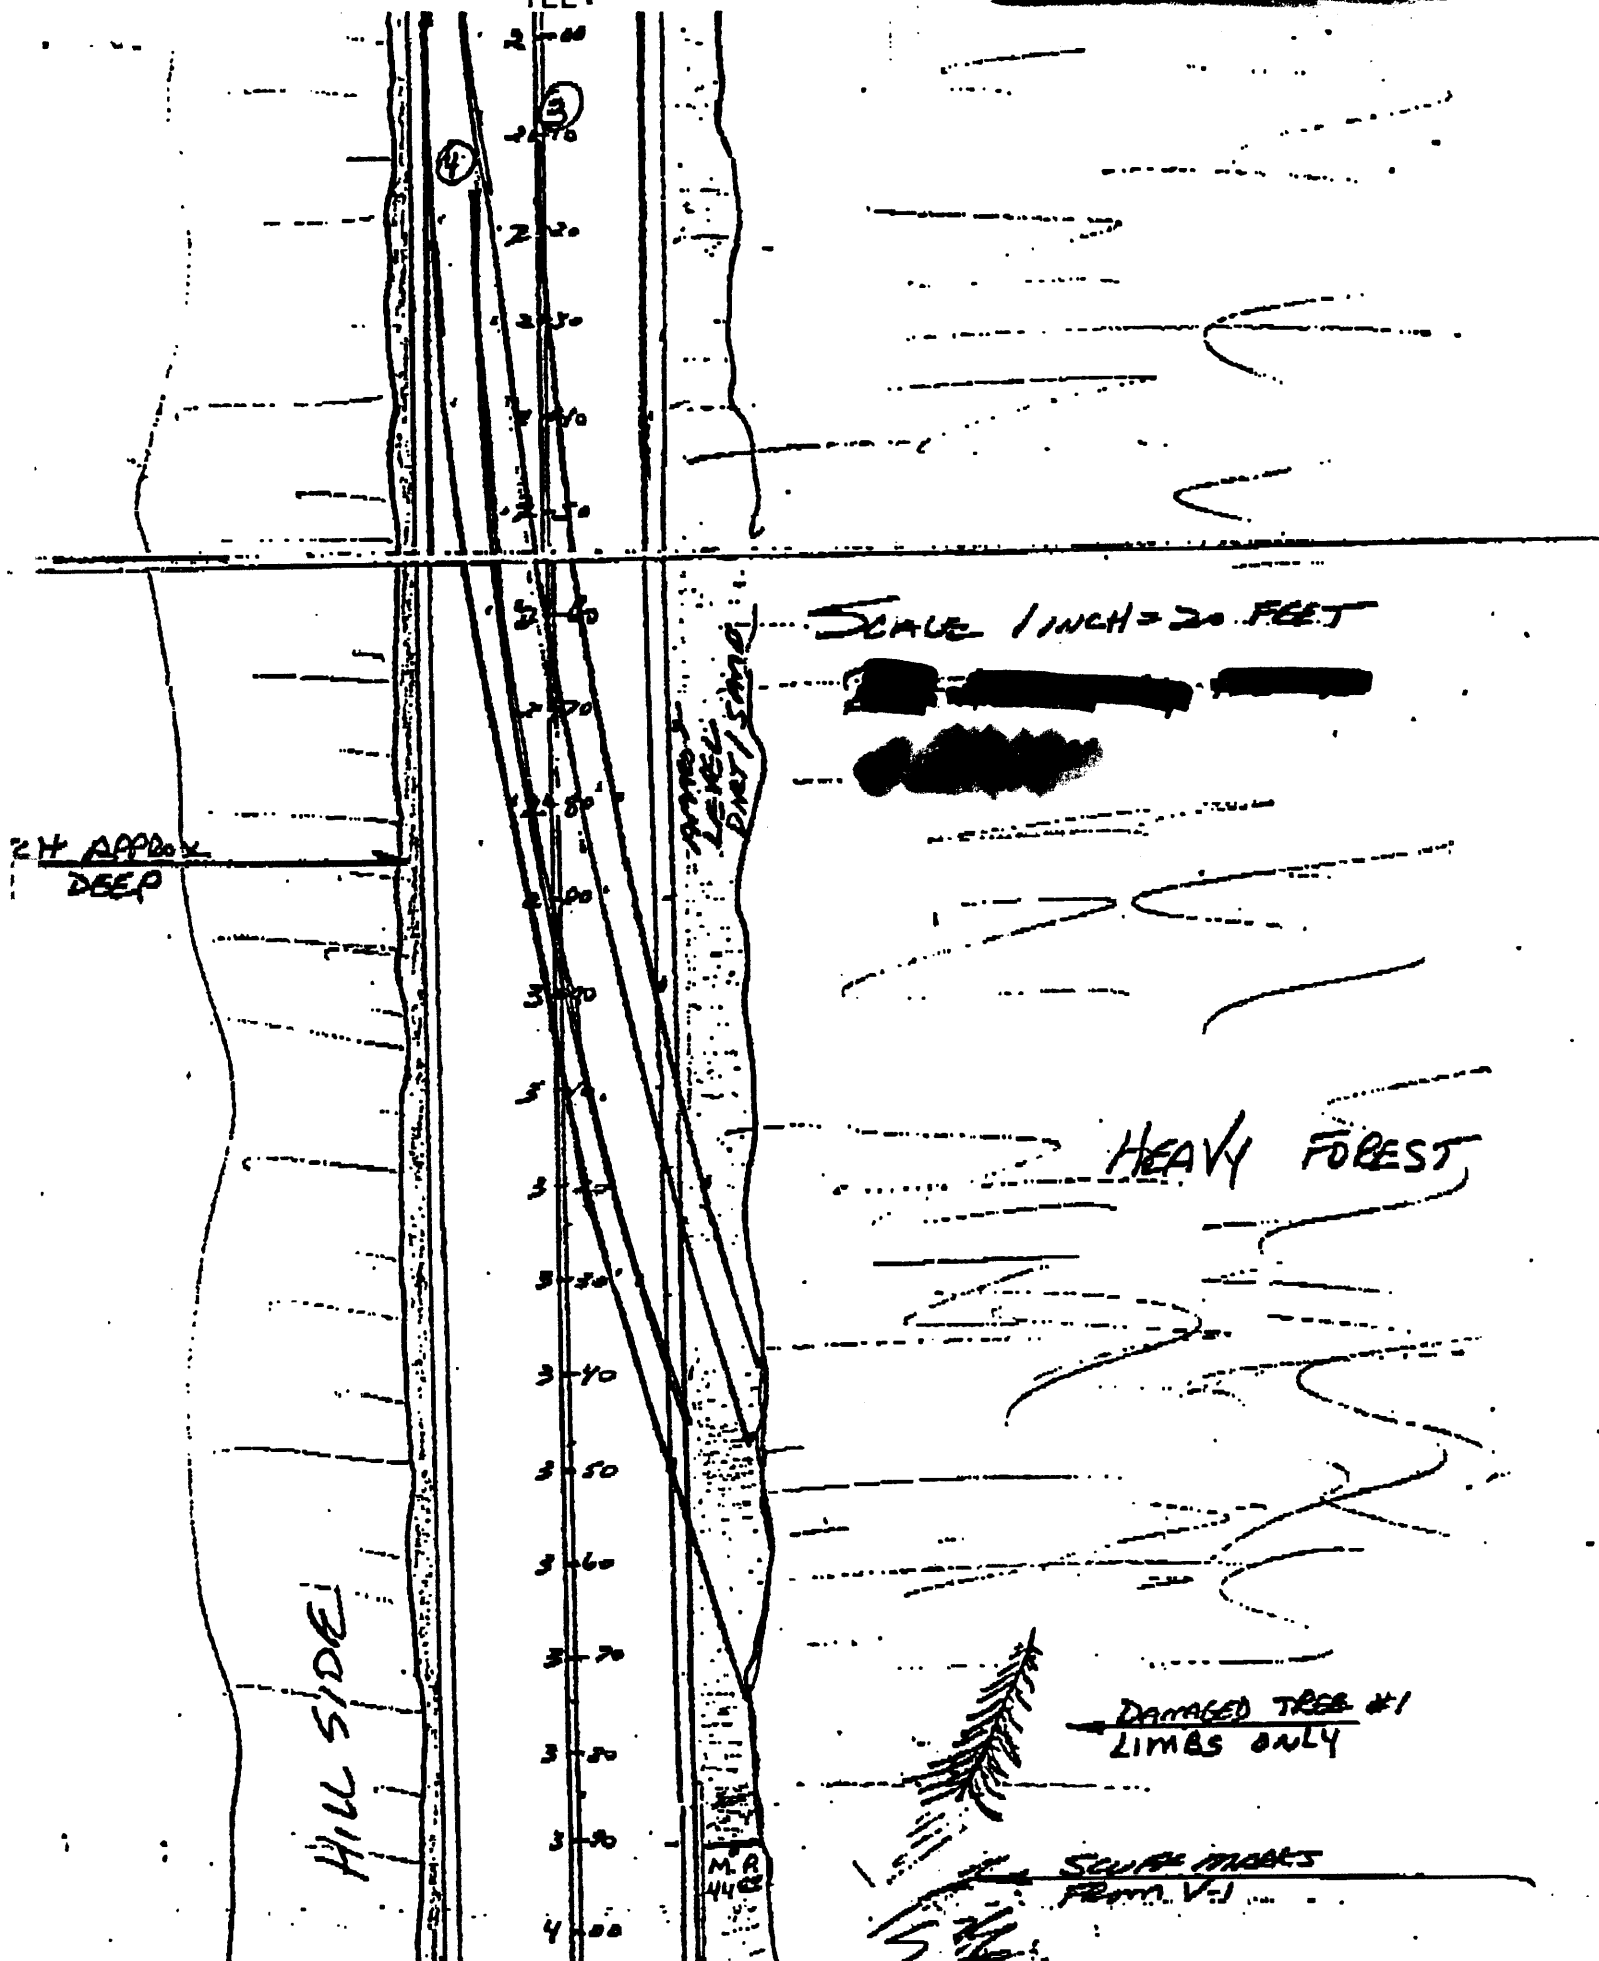



TEL:

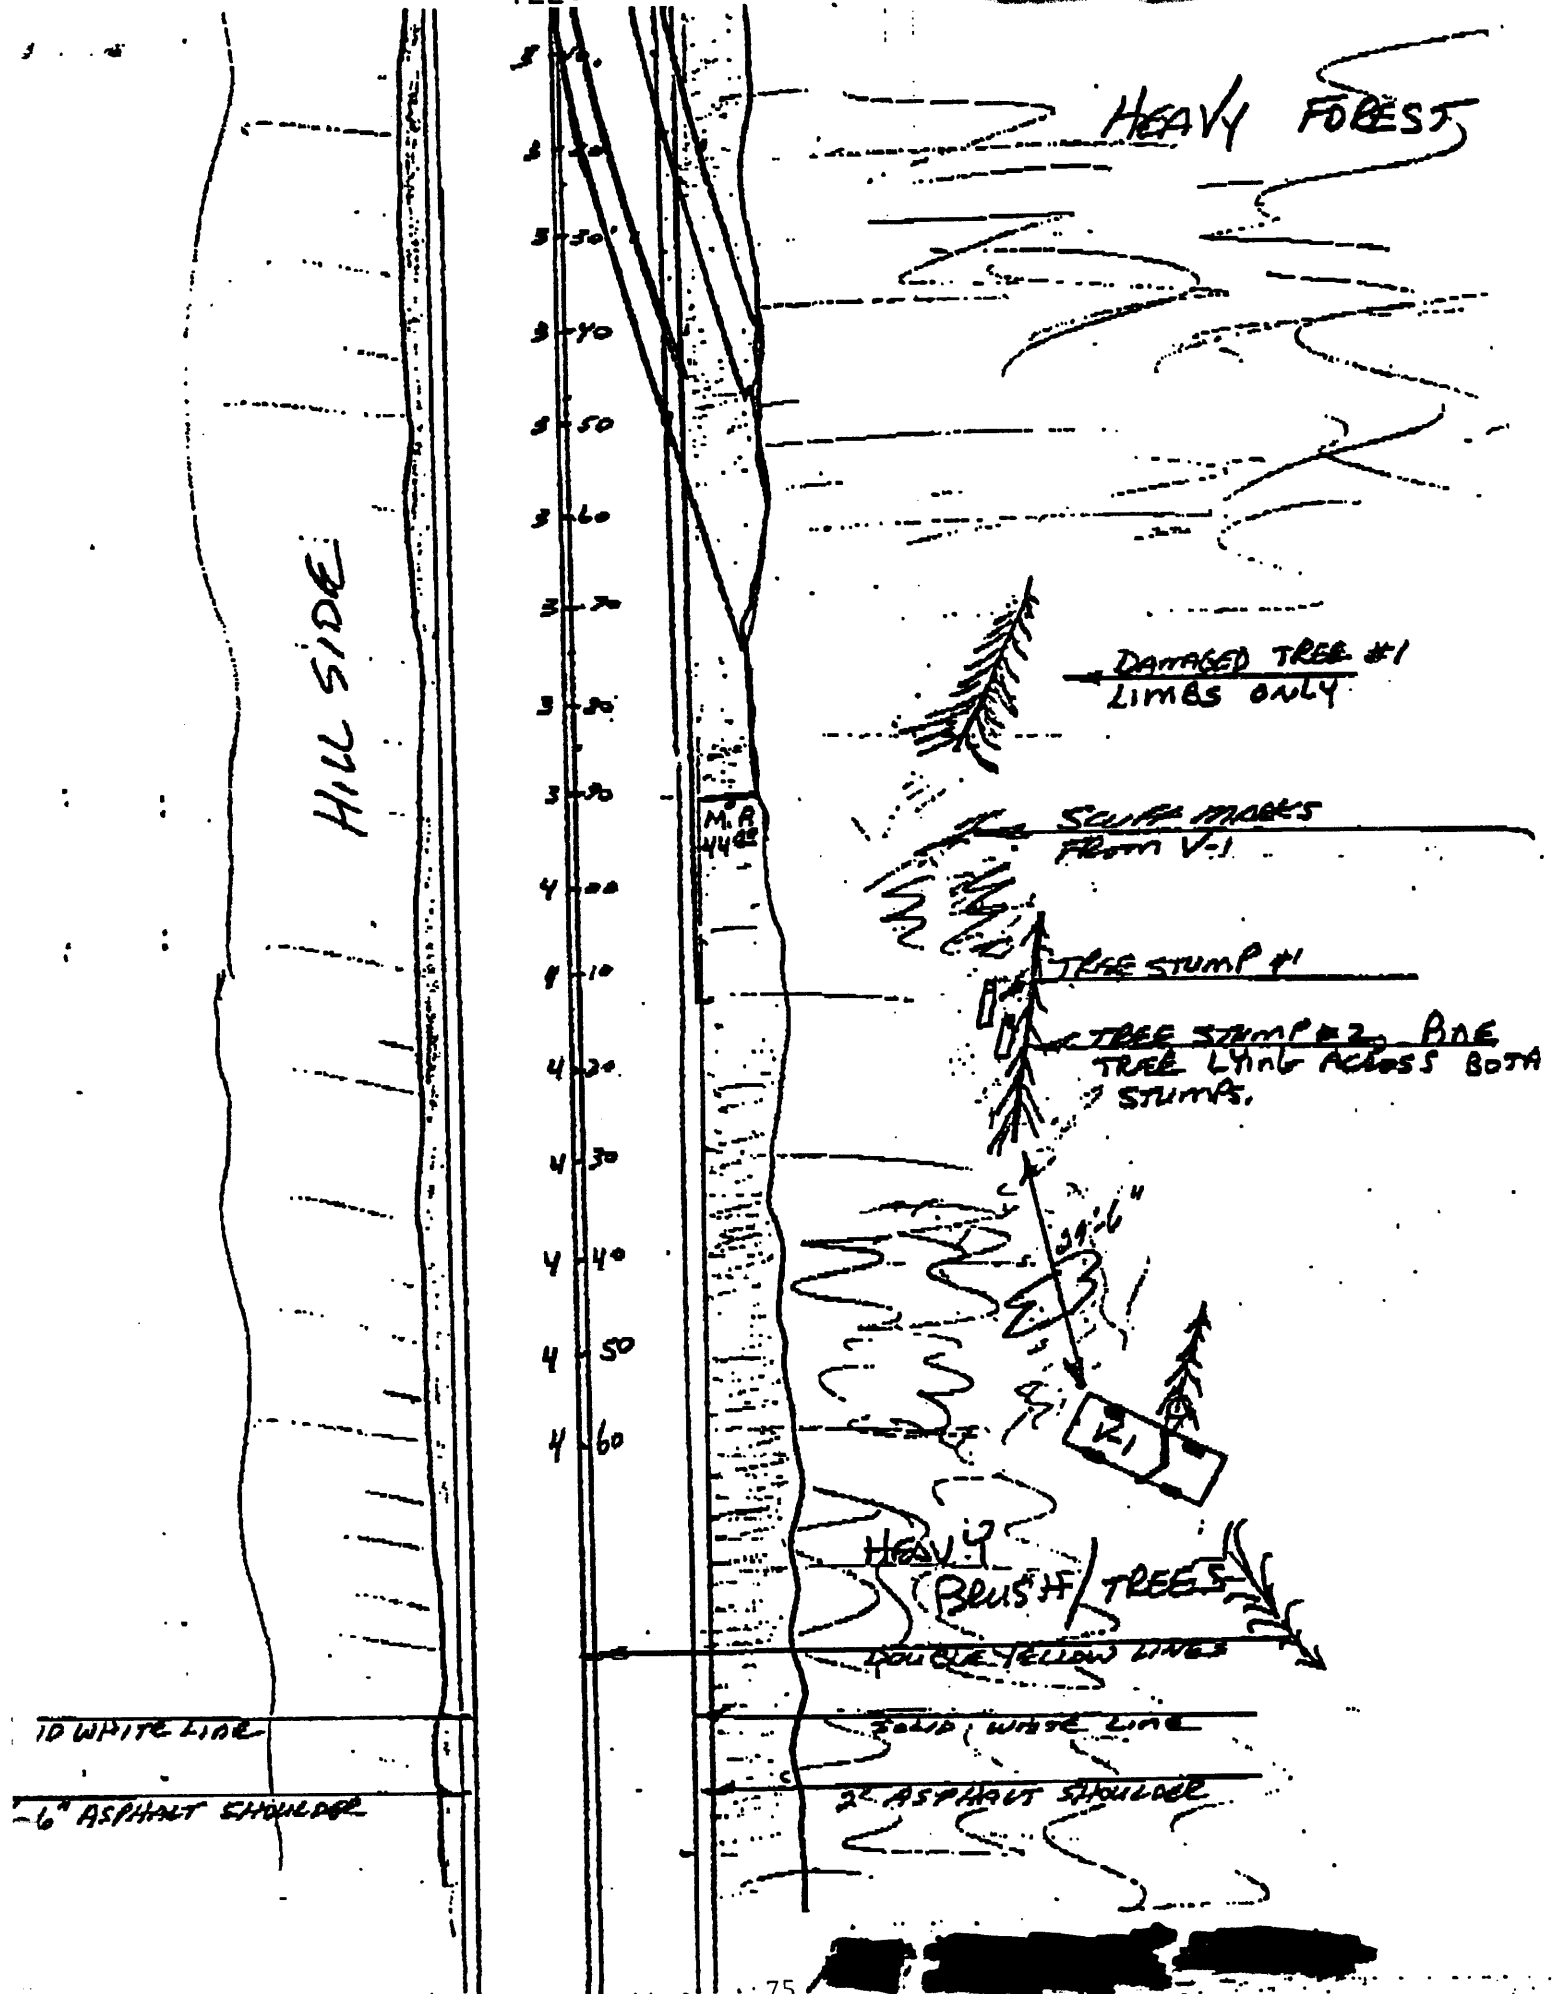

**APPENDIX B**

**Air Bag Supplement**

## ACCIDENT SUMMARY

ACCIDENT DATE ~~1/92~~ / 92

POLICE INVESTIGATED (1,2,9)\*

~~\_\_\_\_\_~~ HIGHWAY PATROLCity ~~\_\_\_\_\_~~ County ~~\_\_\_\_\_~~

## GENERAL LOCALITY

- (1) Freeway, Limited Access  
(2) Urban (City)  
(3) Urban-Rural (mixed)  
(4) Rural, Fields

## CONFIGURATION (First Harm)

- (0) Struck Object or Pedestrian  
(1) Rear-End *Delinquent*  
(2) Head-On  
(3) Rear-to-Rear  
(4) Angle  
(5) Sideswipe-Same Direction  
(6) Sideswipe-Opposite Direct.  
(7) NonColl:eg Fell from Veh  
(8) NonImpact Deployment  
(9) Unknown

## FIRE INVOLVED (0) None

- (1) AirBag Vehicle  
(2) Other Vehicle  
(3) Both Vehicles  
(9) Unknown

NUMBER: VEHICLES INVOLVED

(8)=8 or more

PERSONS INVOLVED

INJURED PERSONS

MAXIMUM AIS IN ACCIDENT

OTHER VEHICLE: MAXIMUM AIS

PRIME/DEPLOY IMPACT w AB VEH:  
EVENT NUMBERCDC ~~\_\_\_\_\_~~ *N/A*

TOTAL DELTA-V

Model Year, Make, Model, Body Type:

## AIRBAG VEHICLE INSPECTION

DATE VEH. INSPECTED ~~\_\_\_\_\_~~ / 92

REASON VEHICLE NOT INSPECTED

- (0) Not Required  
(1) Inspection Completed  
(2) Cannot be Located\*\*  
(3) Repaired or Destroyed\*\*  
(5) Refual or Impounded\*\*  
(7) Other\*

\*\*Specify: \_\_\_\_\_

## IMPACT DATA OBTAINED

- (0) No Data Obtained  
(1) CDC Only  
(2) Crush Profile Only  
(3) Trajectory Data Only  
(4) CDC and Crush Profile  
(5) CDC and Trajectory  
(6) Crush and Trajectory  
(7) CDC, Crush & Trajectory

## BASIS OF DELTA-V

- (0) Not Computed (Unknown Why)  
(1) CRASH - Damage Only  
(2) CRASH - Damage+Trajectory  
(3) Missing Vehicle Algorithm  
(4) Yielding Object Algorithm  
(5) Unknown Basis  
(6) One Vehicle Beyond Scope  
(7) Collision Beyond Scope  
(8) Insufficient Data

## VEHICLE HISTORY

HAS AIRBAG VEHICLE BEEN IN  
ANY PRIOR IMPACTS (1,2,9)\*HAS ANY PRIOR MAINTENANCE/SERVICE  
BEEN PERFORMED ON SYSTEM(1,2,9)\*

\*Describe: \_\_\_\_\_

AIRBAG VEHICLE: FLEET *Pouce*VIN *2EAC P 2 2 G 5 M X*MILEAGE *26,919*

\* (1)=Yes, (2)=No, (9)=Unknown

DRAFT - ~~\_\_\_\_\_~~

SYSTEM READINESS LAMP (In Instrument Cluster)		AIRBAG VEHICLE FIRST HARMFUL EVENT	<u>33</u>
<p>PRE-IMPACT LAMP CONDITION</p> <p>(1) Functioning/ProvedOut</p> <p>(2) Inoperative</p> <p>(9) Unknown</p>	<u>1</u>	<p>(01) Fire or explosion</p> <p>(02) Immersion</p> <p>(03) Gas Inhalation</p> <p>(04) Fell from vehicle</p> <p>(05) Injured in vehicle</p> <p>(06) Other noncollision (specify):</p> <p>(07) Overturn</p> <p>(08) Jackknife with intraunit damage</p>	
<p>DRIVER'S REPORT OF PRE-IMPACT FLASHING</p> <p>(00) No Flashing Reported</p> <p>(01) Continuous Flashing</p> <p>(02)</p> <p>-- &gt;Number of Flashes</p> <p>(11)</p> <p>(12) Constant Light</p> <p>(19) Flashing, Unkn Number</p> <p>(88) Not App (system removed)</p> <p>(99) Unknown</p>	<u>00</u>	<p>Collision With:</p> <p>(09) Pedestrian</p> <p>(10) Pedalcyclist</p> <p>(11) Railway train</p> <p>(12) Animal</p> <p>(13) Motor vehicle in transport (same roadway)</p> <p>(14) Motor vehicle in transport (other roadway)</p> <p>(15) Parked motor vehicle</p> <p>(16) Other type nonmotorist (specify):</p> <p>(17) Thrown or falling object</p> <p>(18) Boulder</p>	
<p>PERIOD OF PRE-IMPACT FLASHING</p> <p>(0) No Flashing</p> <p>(1) Same Day as Impact</p> <p>(2) Prior Day</p> <p>(3) Prior Two Days</p> <p>(4) Prior Week</p> <p>(5) Prior Month</p> <p>(6) Over One Month</p> <p>(9) Unknown</p>	<u>0</u>	<p>Collision with Fixed Object:</p> <p>(20) Building</p> <p>(21) Impact attenuator/Crash Cushion</p> <p>(22) Bridge pier or abutment</p> <p>(23) Bridge parapet end</p> <p>(24) Bridge rail</p> <p>(25) Guardrail</p> <p>(26) Concrete traffic barrier</p> <p>(27) Median barrier</p> <p>(28) Other longitudinal barrier (specify):</p> <p>(29) Highway/Traffic sign post</p> <p>(30) Overhead sign support</p> <p>(31) Luminaire/Light support</p> <p>(32) Utility pole</p>	
<p>POST-IMPACT LAMP CONDITION</p> <p>(1) Functioning/ProvedOut</p> <p>(2) Inoperative</p> <p>(9) Unknown</p>	<u>2</u>	<p>(33) Other post, pole, or support (specify): <u>DELINEATOR</u></p> <p>(34) Culvert</p> <p>(35) Curb</p> <p>(36) Ditch</p> <p>(37) Embankment-earth</p>	
<p>POST-IMPACT FLASHING</p> <p>(00) No Flashing</p> <p>(01) Continuous Flashing</p> <p>(02)</p> <p>-- &gt;Number of Flashes</p> <p>(11)</p> <p>(12) Constant Light</p> <p>(19) Flashing, Unkn Number</p> <p>(88) Not Appl (removed)</p> <p>(99) Unknown <u>INOPERATIVE</u></p>	<u>88</u>	<p>(38) Embankment-rock, stone or concrete</p> <p>(39) Fence (wooden, wire, chain link, etc.)</p> <p>(40) Wall (stone, rock, metal, etc.)</p> <p>(41) Fire hydrant</p> <p>(42) Shrubbery</p> <p>(43) Tree</p> <p>(44) Other fixed object (specify):</p> <p>(45) Pavement surface irregularity (pothole, grooved, grates)</p> <p>(99) Unknown</p>	

## AIRBAG VEHICLE IMPACT SUMMARY

## VEHICLE ROLE

- (0) Non-collision  
 (1) Striking Unit  
 (2) Struck Unit  
 (3) Both Striking and Struck  
 (9) Unknown

## MANNER OF LEAVING SCENE

- (1) Driven  
 (2) Towed-due to damage  
 (3) Towed - not for damage  
 (4) Towed - details unknown  
 (5) Abandoned  
 (9) Unknown

## NUMBER OF IMPACT EVENTS

- (8) 8 or more, (9) Unknown

- ROLLOVER (0) No Rollover  
 (1) First Event  
 (2) Subsequent Event  
 (3) Yes, Unknown Event  
 (9) Unknown

## OVERRIDE/UNDERRIDE

- (1) No over/underride  
 (1) Override - 1st CDC  
 (3) - Other CDC  
 (4) Underride - 1st CDC  
 (6) - Other CDC  
 (9) Unknown

## AIRBAG VEHICLE DAMAGE

- CODES: (1) Yes, DAMAGED  
 (2) No Damage  
 (9) Unknown

## LEFT FRONT FENDER DAMAGE

## RIGHT FRONT FENDER DAMAGE

## CENTER TOP OF GRILLE DAMAGE

## FRONT BUMPER E.A. STATUS: Left

- (1) Normal Right  
 (2) Extended  
 (3) Partial Compression  
 (4) Complete Compression  
 (5) Not Applicable  
 (9) Unknown

## FIRST AIRBAG VEHICLE IMPACT:

## CONFIGURATION

- (0) Struck Object or Pedestrian  
 (1) Rear-End  
 (2) Head-On  
 (3) Rear-to-Rear  
 (4) Angle  
 (5) Sideswipe - Same Direction  
 (6) Sideswipe-Opposite Direct.  
 (7) NonCollision Fell from Veh  
 (8) NonImpact Deployment  
 (9) Unknown

CDC 02 - R F E N - 1

OBJECT CONTACTED: DELMATEOR

## PRIMARY/DEPLOYMENT IMPACT:

## EVENT NUMBER

## TOTAL DELTA-V

## LONGITUDINAL DELTA-V

## CONFIGURATION

- (0) Struck Object or Pedestrian  
 (1) Rear-End  
 (2) Head-On  
 (3) Rear-to-Rear  
 (4) Angle  
 (5) Sideswipe - Same Direction  
 (6) Sideswipe-Opposite Direct.  
 (7) NonCollision Fell from Veh  
 (8) NonImpact Deployment  
 (9) Unknown

CDC ---

OBJECT CONTACTED: TREE

## NOTES:

AIR BAG DEPLOYED DURING CRASH,  
 SPECIFIC EVENT WAS UNKNOWN



# SYSTEM DAMAGE

AIRBAG SUPPLEMENT AB-4

## AIRBAG SYSTEM DAMAGE

CODES: (1) Yes, Damaged\*  
(2) No, Intact  
(8) Not App.(Removed)  
(9) Unknown

### AIRBAG MODULE

SENSORS: Left Front

Center Front

Right Front

Rear, Cowl

### DIAGNOSTIC MODULE

### WIRING

### KNEE DIVERter

INDICATION OF DISCONNECTED  
OR LOOSE ELECTRICAL  
CONNECTORS

2

2

2

2

8

2

2

1

2

## CONDITION OF DEPLOYED BAG

5

- (1) Bag Intact
- (2) Split or Torn\*
- (3) Cut by Object in Impact\*
- (4) Cut after Accident\*
- (5) Other (e.g., burned)\*
- (8) N/A (not deployed)
- (9) Unknown

### \*DESCRIBE System and Bag Damage:

\_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_


\_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_


NOTE DAMAGE AND CONTACT MARKS ON AIRBAG DIAGRAMS BELOW:

BURN ON FACE OF BAG  
1.75-4.0" INBOARD OF  
PERIPHERAL SEAM

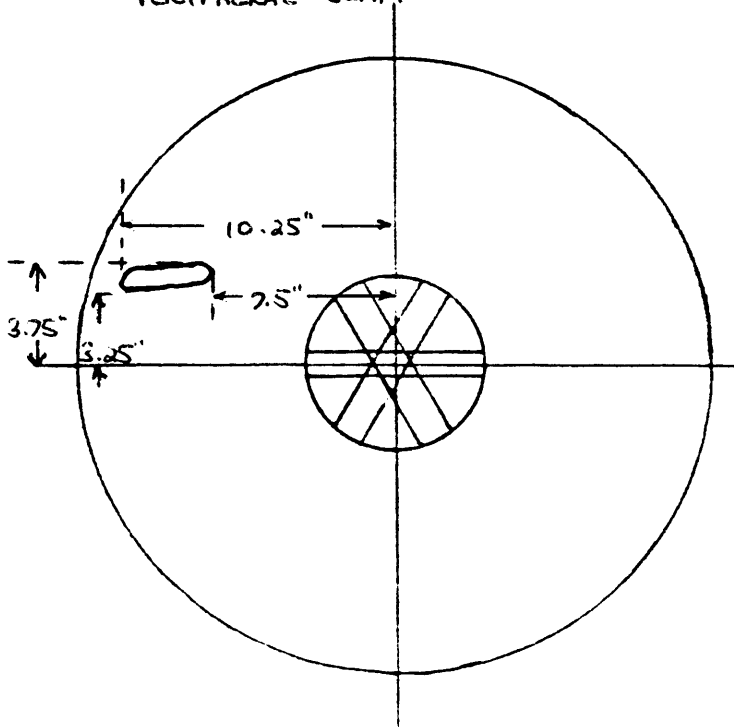

FRONT

TOP

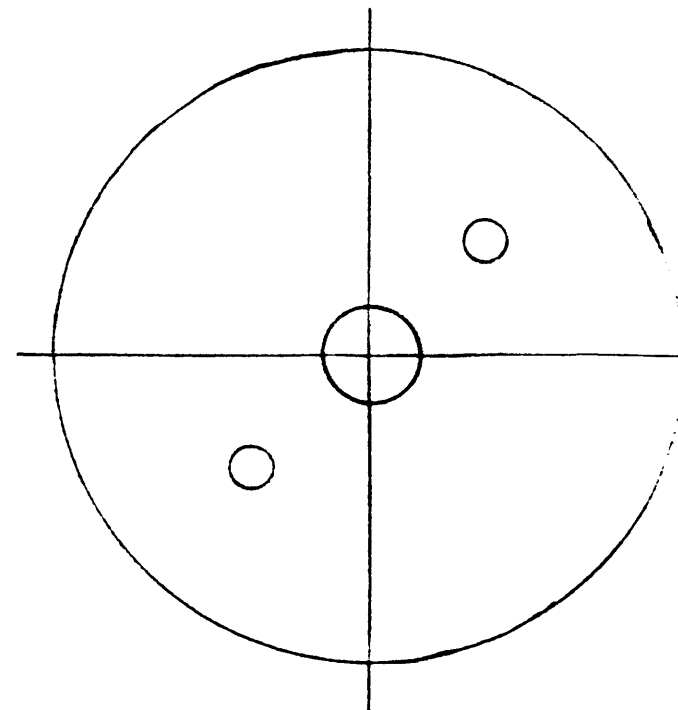

BOTTOM

## OCCUPANTS/DRIVER

## AIRBAG SUPPLEMENT AB-5

## OCCUPANTS of AIRBAG CAR

NUMBER OF OCCUPANTS IN VEHICLE 1  
 (8) 8 or more  
 NUMBER OF INJURED PERSONS 1  
 MAXIMUM AIS IN AIRBAG VEHICLE 4  
 (0) No Injury  
 (1-6) AIS Severity  
 (7) Injured, Unknown Severity  
 (9) Unknown

## NOTES:

DRIVER AGE 54 SEX MALE

NUMBER OF DRIVER INJURIES 14

SOURCE OF BEST INJURY DATA 2

- (0) Not Injured  
 (1) Autopsy w/wo med. records  
 (2) Hospital Medical Records  
 (3) Emergency Room only  
 (4) Private physician, Clinic  
 (5) Lay Coroner Report  
 (6) EMS Personnel  
 (7) Interviewee  
 (8) Police  
 (9) Unknown
- 

## MAXIMUM AIS BY BODY REGION

REGION	MAX AIS	CONTACT
Head/Neck/Face	<u>3</u>	<u>53</u>
Chest	<u>4</u>	<u>33</u>
Abdomen	---	---
Leg/Hips	---	---
Other (Arms)	<u>3</u>	<u>45</u>
DRIVER MAXIMUM	<u>4</u>	<u>33</u>

-----

EJECTION: Extent NONE

Portal N/A

**DRIVER BELT USAGE:** (1) Used (2) Not Used (9) Unknown 1

Evidence: POLICE REPORT / WITNESS STATEMENTS, ABRASIONS ON INSIDE  
PLASTIC SURFACE OF LATCHPLATE FROM BELT LOADING, BLOOD STAINS ON  
UPPER BELT

**DRIVER POSTURE:** Any Comments Recorded (1) Yes, (2) No 1

Describe driver's posture and position on seat including specific comments on head, torso, buttocks, legs and feet. Also note hand and arm position. Did driver brace before crash? Describe:

NORMAL SEATED POSITION PRE-CRASH, PROBABLY OUT OF POSITION  
DUE TO CCW ROTATION AND INITIAL TREE IMPACTS

**DRIVER FOREIGN OBJECTS:** Comments Recorded (1) Yes, (2) No 2

Was driver wearing contact lenses or eyeglasses? Or holding any foreign object at the time of the impact (packages on lap, pipe, food, bottle, cigarette, etc.)? Did any lenses, objects, or jewelry play any role?:

**DRIVER COMMENTS:** Comments Recorded (1) Yes, (2) No 2

Was the driver aware that the vehicle was equipped with a supplemental restraint system? Did driver offer any comments on smoke, noise, etc.? Did the driver comment on the airbag as a restraint system? Describe:

UNCONSCIOUS FOLLOWING IMPACT WITH AMNESIA, DRIVER DOESN'T  
REMEMBER THE DAY OF THE CRASH

**PASSENGER-AIRBAG CONTACT** (1) Yes, (2) No, (9) Unknown 2

Describe: NO PASSENGER

**APPENDIX C**

**NASS Vehicle Forms**



# GENERAL VEHICLE FORM

1. Primary Sampling Unit Number

2. Case Number - Stratum

9 2-1 2

3. Vehicle Number

0 1

## VEHICLE IDENTIFICATION

4. Vehicle Model Year

Code the last two digits of the model year  
(99) Unknown

9 1

5. Vehicle Make (specify):

FORD  
Applicable codes are found in your  
NASS Data Collection, Coding and  
Editing Manual.  
(99) Unknown

1 2

6. Vehicle Model (specify):

LTD CROWN VICTORIA POLICE VEHICLE  
Applicable codes are found in your  
NASS Data Collection, Coding and  
Editing Manual.  
(999) Unknown

0 1 6

7. Body Type

Note: Applicable codes may be found on  
the back of this page.

0 4

8. Vehicle Identification Number

2 F A C D 7 2 G 5 M X

Left justify; Slash zeros and letter Z (0 and Z)  
No VIN—Code all zeros  
Unknown—Code all nine's

## OFFICIAL RECORDS

9. Police Reported Vehicle Disposition

(0) Not towed due to vehicle damage  
(1) Towed due to vehicle damage  
(9) Unknown

1

10. Police Reported Travel Speed

Code to the nearest mph (NOTE: 00 means  
less than 0.5 mph)  
(97) 96.5 mph and above  
(99) Unknown

7 4

11. Police Reported Alcohol Presence

(0) No alcohol present  
(1) Yes (alcohol present)  
(7) Not reported  
(8) No driver present  
(9) Unknown

0

Note: See variables 37 through 55  
(Page 4) for information on Other Drugs

12. Alcohol Test Result For Driver

Code actual value (decimal implied  
before first digit—0.xx)  
(95) Test refused  
(96) None given  
(97) AC test performed, results unknown  
(98) No driver present  
(99) Unknown

9 6

Source: \_\_\_\_\_

## ACCIDENT RELATED

13. Speed Limit

(00) No statutory limit  
Code posted or statutory speed limit  
(99) Unknown

5 5

14. Attempted Avoidance Maneuver

(00) No impact  
(01) No avoidance actions  
(02) Braking (no lockup)  
(03) Braking (lockup)  
(04) Braking (lockup unknown)  
(05) Releasing brakes  
(06) Steering left  
(07) Steering right  
(08) Braking and steering left  
(09) Braking and steering right  
(10) Accelerating  
(11) Accelerating and steering left  
(12) Accelerating and steering right  
(97) No driver present  
(98) Other action (specify):

0 3

(99) Unknown

15. Accident Type

Applicable codes may be found on the  
back of page two of this field form  
(00) No impact  
Code the number of the diagram that  
best describes the accident circumstance  
(98) Other accident type (specify):

0 7

(99) Unknown

\*\*\*\* SKIP TO VARIABLE GV37 IF GV07 DOES NOT EQUAL 01-49 \*\*\*\*



# CODES FOR BODY TYPE

## CDS APPLICABLE VEHICLES

### Automobiles

- (01) Convertible (excludes sun-roof, t-bar)
- (02) 2-door sedan, hardtop, coupe
- (03) 3-door/2-door hatchback
- (04) 4-door sedan, hardtop
- (05) 5-door/4-door hatchback
- (06) Station wagon (excluding van and truck based)
- (07) Hatchback, number of doors unknown
- (08) Other automobile type (specify):

(09) Unknown automobile type

### Automobile Derivatives

- (10) Auto based pickup (includes El Camino, Caballero, Ranchero, Brat, and Rabbit pickup)
- (11) Auto based panel (cargo station wagon, auto based ambulance/hearse)
- (12) Large limousine - more than four side doors or stretched chassis
- (13) Three-wheel automobile or automobile derivative

### Utility Vehicles ( $\leq 10,000$ lbs GVWR)

- (14) Compact utility (Jeep CJ-2 - CJ-7, Scrambler, Golden Eagle, Renegade, Laredo, Wrangler, Cherokee [84 and after], Dispatcher, Raider, Bronco II, Bronco [76 and before], Explorer, S-10 Blazer, Geo Tracker, Bravado, S-15 Jimmy, Thing, Pathfinder, Trooper, Trooper II, Rodeo, Amigo, Navajo, 4-Runner, Montero, Samurai, Sidekick, Rocky)
- (15) Large utility (includes Jeep Cherokee [83 and before], Ramcharger, Trailduster, Bronco-fullsize [78 and after], fullsize Blazer, fullsize Jimmy, Landcruiser, Rover, Scout)
- (16) Utility station wagon (Chevy Suburban, GMC Suburban, Travelall, Grand Wagoneer, includes suburban limousine)
- (19) Utility, unknown body type

### Van Based Light Trucks ( $\leq 10,000$ lbs GVWR)

- (20) Minivan (Chrysler Town and Country, Caravan, Grand Caravan, Voyager, Grand Voyager, Mini-Ram, Dodge/Plymouth Vista, Aerostar, Lumina APV, Trans Sport, Silhouette, Astro, Safari, Toyota Van, Toyota Minivan, Previa, Nissan Minivan, Mitsubishi Minivan, Vanagon/Camper.)
- (21) Large van (B150-B350, Sportsman, Royal, Maxiwagon, Ram, Tradesman, Voyager [83 and before], E150-E350, Econoline, Clubwagon, Chateau, G10-G30, Chevy Van, Beauville, Sport Van, G15-G35, Rally Van, Vandura.)
- (22) Step van or walk-in van ( $\leq 10,000$  lbs GVWR)
- (23) Van based motorhome ( $\leq 10,000$  lbs GVWR)
- (28) Other van type (Hi-Cube Van, Kary) (specify):

(29) Unknown van type

### Light Conventional Trucks (Pickup style cab, $\leq 10,000$ lbs GVWR)

- (30) Compact pickup (D50, Colt P/U, Ram 50, Dakota, Arrow Pickup [foreign], Ranger, Courier, S-10, T-10, LUV, S-15, T-15, Sonoma, Datsun/Nissan Pickup, P'up, Mazda Pickup, Toyota Pickup, Mitsubishi Pickup)
- (31) Large Pickup (Jeep Pickup, Comanche, Ram Pickup, D100-D350, W100-W350, F100-F350, C10-C35, K10-K35, R10-R35, V10-V35, Silverado, Sierra, R100-R500,)
- (32) Pickup with slide-in camper
- (33) Convertible pickup
- (39) Unknown pickup style light conventional truck type

### Other Light Trucks ( $\leq 10,000$ lbs GVWR)

- (40) Cab chassis based (includes rescue vehicles, light stake, dump, and tow truck)
- (41) Truck based panel
- (42) Light truck based motorhome (chassis mounted)
- (45) Other light conventional truck type
- (48) Unknown light truck type
- (49) Unknown light vehicle type (automobile, utility, van, or light truck)

## OTHER VEHICLES

### Buses (Excludes Van Based)

- (50) School bus (designed to carry students, not cross country or transit)
- (58) Other bus type (e.g., transit, intercity, bus based motorhome) (specify):
- (59) Unknown bus type

### Medium/Heavy Trucks ( $> 10,000$ lbs GVWR)

- (60) Step van ( $> 10,000$  lbs GVWR)
- (61) Single unit straight truck ( $10,000$  lbs  $<$  GVWR  $\leq 19,500$  lbs)
- (62) Single unit straight truck ( $19,500$  lbs  $<$  GVWR  $\leq 26,000$  lbs)
- (63) Single unit straight truck ( $> 26,000$  lbs GVWR)
- (64) Single unit straight truck, GVWR unknown
- (65) Medium/heavy truck based motorhome
- (67) Truck-tractor with no cargo trailer
- (68) Truck-tractor pulling one trailer
- (69) Truck-tractor pulling two or more trailers
- (70) Truck-tractor (unknown if pulling trailer)
- (78) Unknown medium/heavy truck type
- (79) Unknown truck type (light/medium/heavy)

### Motored Cycles (Does Not Include All-Terrain Vehicles/Cycles)

- (80) Motorcycle
- (81) Moped (motorized bicycle)
- (82) Three-wheel motorcycle or moped
- (88) Other motored cycle (minibike, motorscooter) (specify):
- (89) Unknown motored cycle type

### Other Vehicles

- (90) ATV (All-Terrain Vehicle) and ATC (All-Terrain Cycle)
- (91) Snowmobile
- (92) Farm equipment other than trucks
- (93) Construction equipment other than trucks
- (97) Other vehicle type
- (99) Unknown body type

**OCCUPANT RELATED**16. Driver Presence in Vehicle 1

- (0) Driver not present  
(1) Driver present  
(9) Unknown

17. Number of Occupants This Vehicle 01  
(00-96) Code actual number of occupants for this vehicle  
(97) 97 or more  
(99) Unknown

18. Number of Occupant Forms Submitted 01**VEHICLE WEIGHT ITEMS**

19. Vehicle Curb Weight 03800  
3822 Code weight to nearest 100 pounds.  
(010) Less than 1050 pounds  
(135) 13,500 pounds or more  
(999) Unknown

Source: \_\_\_\_\_

20. Vehicle Cargo Weight 0100  
100 Code weight to nearest 100 pounds. *Police package/equipment*  
(00) Less than 50 pounds  
(97) 9,650 pounds or more  
(99) Unknown

**RECONSTRUCTION DATA**

21. Towed Trailing Unit 0  
(0) No towed unit  
(1) Yes—towed trailing unit  
(9) Unknown

22. Documentation of Trajectory Data for This Vehicle 1  
(0) No  
(1) Yes

23. Post Collision Condition of Tree or Pole (For Highest Delta V) 2  
(0) Not collision (for highest delta V) with tree or pole  
(1) Not damaged  
(2) Cracked/sheared  
(3) Tilted <45 degrees  
(4) Tilted ≥45 degrees  
(5) Uprooted tree  
(6) Separated pole from base  
(7) Pole replaced  
(8) Other (specify):  
(9) Unknown

24. Rollover 0

(0) No rollover (no overturning)

*Rollover (primarily about the longitudinal axis)*

- (1) Rollover, 1 quarter turn only  
(2) Rollover, 2 quarter turns  
(3) Rollover, 3 quarter turns  
(4) Rollover, 4 or more quarter turns (specify):

(5) Rollover--end-over-end (i.e., primarily about the lateral axis)

(9) Rollover (overturn), details unknown

**OVERRIDE/UNDERRIDE (THIS VEHICLE)**25. Front Override/Underride (this Vehicle) 026. Rear Override/Underride (this Vehicle) 0

(0) No override/underride, or not an end-to-end impact

*Override (see specific CDC)*

- (1) 1st CDC  
(2) 2nd CDC  
(3) Other not automated CDC (specify):

*Underride (see specific CDC)*



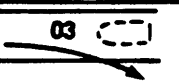
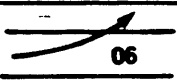
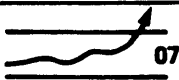
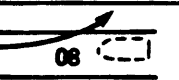
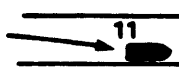
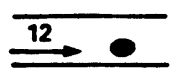
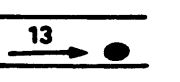
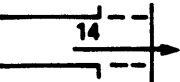
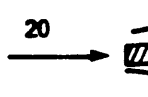
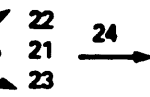
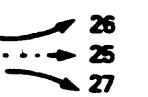
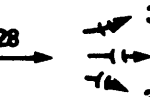

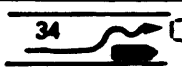













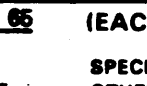



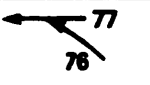
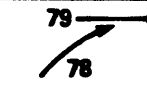

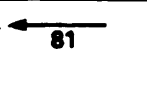
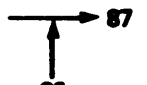

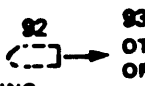

- (4) 1st CDC  
(5) 2nd CDC  
(6) Other not automated CDC (specify):

(7) Medium/heavy truck or bus override  
(9) Unknown

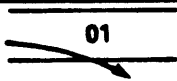**HEADING ANGLE AT IMPACT FOR HIGHEST DELTA V**

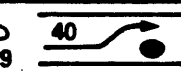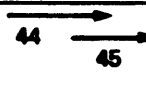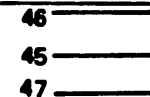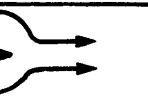Values: (000)-(359) Code actual value  
(997) Noncollision  
(998) Impact with object  
(999) Unknown

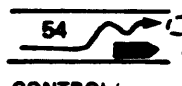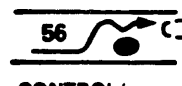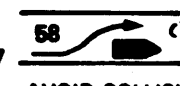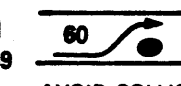27. Heading Angle For This Vehicle 99828. Heading Angle For Other Vehicle 998

Category	Configuration	ACCIDENT TYPES (Includes Intent)				
I. Single Driver	A. Right Roadside Departure	 01 DRIVE OFF ROAD	 02 CONTROL/ TRACTION LOSS	 03 AVOID COLLISION WITH VEH., PED., ANIM.	04 SPECIFICS OTHER	05 SPECIFICS UNKNOWN
	B. Left Roadside Departure	 06 DRIVE OFF ROAD	 07 CONTROL/ TRACTION LOSS	 08 AVOID COLLISION WITH VEH., PED., ANIM.	09 SPECIFICS OTHER	10 SPECIFICS UNKNOWN
	C. Forward Impact	 11 PARKED VEH.	 12 STA. OBJECT	 13 PEDESTRIAN/ ANIMAL	 14 END DEPARTURE	15 SPECIFICS OTHER 16 SPECIFICS UNKNOWN
II. Same Trafficway Same Direction	D. Rear-End	 20 STOPPED 21, 22, 23	 22 SLOWER 25, 26, 27	 24 DECEL. 28, 29, 30, 31	 26 AVOID COLLISION WITH VEH.	 28 AVOID COLLISION WITH OBJECT (EACH • 32) SPECIFICS OTHER (EACH • 33) SPECIFICS UNKNOWN
	E. Forward Impact	 34 CONTROL/ TRACTION LOSS	 36 CONTROL/ TRACTION LOSS	 38 AVOID COLLISION WITH VEH.	 40 AVOID COLLISION WITH OBJECT	(EACH • 42) SPECIFICS OTHER (EACH • 43) SPECIFICS UNKNOWN
	F. Sideswipe Angle	 44 45 46 47	 46 45 47	 48 45 47	(EACH • 48) SPECIFICS OTHER (EACH • 49) SPECIFICS UNKNOWN	(EACH • 49) SPECIFICS UNKNOWN
III. Same Trafficway Opposite Direction	G. Head-On	 50 LATERAL MOVE	 51 LATERAL MOVE	(EACH • 52) SPECIFICS OTHER (EACH • 53) SPECIFICS UNKNOWN	(EACH • 53) SPECIFICS UNKNOWN	(EACH • 53) SPECIFICS UNKNOWN
	H. Forward Impact	 54 CONTROL/ TRACTION LOSS	 56 CONTROL/ TRACTION LOSS	 58 AVOID COLLISION WITH VEH.	 60 AVOID COLLISION WITH OBJECT	(EACH • 62) SPECIFICS OTHER (EACH • 63) SPECIFICS UNKNOWN
	I. Sideswipe/ Angle	 64 LATERAL MOVE	 65 LATERAL MOVE	(EACH • 66) SPECIFICS OTHER (EACH • 67) SPECIFICS UNKNOWN	(EACH • 67) SPECIFICS UNKNOWN	(EACH • 67) SPECIFICS UNKNOWN
IV. Change Trafficway Vehicle Turning	J. Turn Across Path	 68 INITIAL OPPOSITE DIRECTIONS	 70 INITIAL SAME DIRECTIONS	 72 INITIAL SAME DIRECTIONS	(EACH • 74) SPECIFICS OTHER (EACH • 75) SPECIFICS UNKNOWN	(EACH • 75) SPECIFICS UNKNOWN
	K. Turn Into Path	 76 TURN INTO SAME DIRECTION	 78 TURN INTO SAME DIRECTION	 80 TURN INTO OPPOSITE DIRECTIONS	 82 TURN INTO OPPOSITE DIRECTIONS	(EACH • 84) SPECIFICS OTHER (EACH • 85) SPECIFICS UNKNOWN
V. Intersecting Paths (Vehicle Damage)	L. Straight Paths	 86 STRAIGHT PATHS	 88 STRAIGHT PATHS	(EACH • 90) SPECIFICS OTHER (EACH • 91) SPECIFICS UNKNOWN	(EACH • 91) SPECIFICS UNKNOWN	(EACH • 91) SPECIFICS UNKNOWN
VI. Miscellaneous	M. Backing Etc.	 92 BACKING VEH.	 93 OTHER VEH. OR OBJECT	98 Other Accident Type 99 Unknown Accident Type 00 No Impact		

29. Basis for Total Delta V (highest)

5*Delta V Calculated*

- (1) CRASH program—damage only routine
- (2) CRASH program—damage and trajectory routine
- (3) Missing vehicle algorithm

*Delta V Not Calculated*

- (4) At least one vehicle (which may be this vehicle) is beyond the scope of an acceptable reconstruction program, regardless of collision conditions.
- (5) All vehicles within scope (CDC applicable) of CRASH program but one of the collision conditions is beyond the scope of the CRASH program or other acceptable reconstruction technique, regardless of adequacy of damage data.
- (6) All vehicle and collision conditions are within scope of one of the acceptable reconstruction programs, but there is insufficient data available.

**COMPUTER GENERATED DELTA V**

30. Total Delta V

Secondary Highest

99

\_\_\_\_ Nearest mph

(NOTE: 00 means less than  
0.5 mph)  
(97) 96.5 mph and above  
(99) Unknown

31. Longitudinal Component of  
Delta V+ 99

\_\_\_\_ Nearest mph

(NOTE: \_\_00 means greater than  
-0.5 and less than +0.5 mph)  
(±97) ±96.5 mph and above  
(\_\_99) Unknown

Secondary Highest

32. Lateral Component of Delta V

+ 99

\_\_\_\_ Nearest mph

(NOTE: \_\_00 means greater than  
-0.5 and less than +0.5 mph)  
(±97) ±96.5 mph and above  
(\_\_99) Unknown

33. Energy Absorption

999,900

\_\_\_\_ Nearest 100 foot-lbs

(NOTE: 0000 means less than 50 foot-lbs)  
(9997) 999,650 foot-lbs or more  
(9999) Unknown

34. Confidence In Reconstruction Program  
Results (For Highest Delta V)0

- (0) No reconstruction
- (1) Collision fits model — results appear reasonable
- (2) Collision fits model — results appear high
- (3) Collision fits model — results appear low
- (4) Borderline reconstruction — results appear reasonable

35. Type of Vehicle Inspection

1

- (0) No inspection
- (1) Complete inspection
- (2) Partial inspection (specify):  
\_\_\_\_\_

36. Is this an AOPS Vehicle?

1

- (0) No
- (1) Yes

IS OLDMISS APPLICABLE FOR THIS VEHICLE? [ ] YES [ ] NO

IF YES: IS A COMPLETED OLDMISS PROGRAM SUMMARY INCLUDED? [ ] YES [ ] NO

37. Police Reported Other Drug Presence 1

- (0) No other drugs present
- (1) Yes (other drug present)
- (7) Not reported
- (8) No driver present
- (9) Unknown

38. Police Reported Observation/Perception Test Type For Driver 0

- (0) No observation/perception test given
- (1) Drug recognition technician (DRT) determination using DEC process
- (2) Behavioral
- (3) Other physical observation/perception determination (specify): \_\_\_\_\_

- (4) DEC process available, unknown if determination made
- (5) DEC process not available, unknown if other observation/perception test given
- (7) Other observation/perception test (specify): \_\_\_\_\_
- (8) No driver present

39. Other Drug Specimen Test Type For Driver 0

- (0) No specimen test given
- (1) Blood test
- (2) Urine test
- (3) Other specimen tests (specify): \_\_\_\_\_
- (7) Unspecified specimen test
- (8) No driver present
- (9) Unknown if specimen test given

## DRUG EVALUATION CLASSIFICATION

### OTHER DRUGS TEST RESULTS FOR DRIVER

	DEC Observation/ Perception Test Results	Specimen Test Results
Narcotic Drug	40. <u>0</u>	41. <u>0</u>
Depressant Drug	42. <u>0</u>	43. <u>0</u>
Stimulant Drug	44. <u>0</u>	45. <u>0</u>
Hallucinogen Drug	46. <u>0</u>	47. <u>0</u>
Cannabinoid Drug	48. <u>0</u>	49. <u>0</u>
Phencyclidine (PCP)	50. <u>0</u>	51. <u>0</u>
Inhalant Drug	52. <u>0</u>	53. <u>0</u>
Other Drug (Excluding Nicotine, Aspirin, Alcohol, Drugs Administered Post-Crash)	54. <u>0</u>	55. <u>0</u>

## Codes For Observation/Perception Test Results

- (0) No DEC observation/perception test given
- (1) Passed DEC observation/perception test
- (2) Failed DEC observation/perception test
- (3) DEC observation/perception test given—  
results unknown
- (8) No driver present
- (9) Unknown if DEC observation/perception  
test given

## Codes for Specimen Test Results

- (0) No specimen test given
- (1) Drug not found in specimen
- (2) Drug found in specimen
- (7) Specimen test given, results unknown or  
not obtained
- (8) No driver present
- (9) Unknown if specimen test given



**OTHER DATA****56. Driver's Zip Code**

- (00000) Driver not present  
 (00001) Driver not a resident of U.S. or territories  
 Code actual 5-digit zip code  
 (99999) Unknown

**57. Driver's Race/Ethnic Origin**

- (0) Driver not present  
 (1) White (non-Hispanic)  
 (2) Black (non-Hispanic)  
 (3) White (Hispanic)  
 (4) Black (Hispanic)  
 (5) American Indian, Eskimo or Aleut  
 (6) Asian or Pacific Islander  
 (8) Other (specify):  
 (9) Unknown

**58. Vehicle Special Use (This Trip)**

- (0) No special use  
 (1) Taxi  
 (2) Vehicle used as school bus  
 (3) Vehicle used as other bus  
 (4) Military  
 (5) Police  
 (6) Ambulance  
 (7) Hearse  
 (8) Fire truck or car  
 (9) Unknown

**61. Rollover Initiation Object Contacted**0 0**62. Location on Vehicle Where Initial Principal Tripping Force Is Applied**0

- (0) No rollover  
 (1) Wheels/tires  
 (2) Side plane  
 (3) End plane  
 (4) Undercarriage  
 (5) Other location on vehicle (specify):  
 (8) Non-contact rollover forces (specify):  
 (9) Unknown

**63. Direction of Initial Roll**0

- (0) No rollover  
 (1) Roll right - primarily about the longitudinal axis  
 (2) Roll left - primarily about the longitudinal axis  
 (5) End-over-end (i.e., primarily about the lateral axis)  
 (9) Unknown roll direction

**ROLLOVER DATA**

If GV07 (Body Type)  $\neq$  1-49, leave GV59-GV63 blank.  
 If GV24 (Rollover) = 0, then GV59-GV63 must equal 0.  
 If GV24 = 9, then GV59-GV63 must equal 9.

**59. Rollover Initiation Type**0

- (0) No rollover  
 (1) Trip-over  
 (2) Flip-over  
 (3) Turn-over  
 (4) Climb-over  
 (5) Fall-over  
 (6) Bounce-over  
 (7) Collision with another vehicle  
 (8) Other rollover initiation type specify):  
 (9) Unknown rollover initiation type

**60. Location of Rollover Initiation**0

- (0) No rollover  
 (1) On roadway  
 (2) On shoulder—paved  
 (3) On shoulder—unpaved  
 (4) On roadside or divided trafficway median  
 (9) Unknown

**PRECRASH DATA****64. Pre-Event Movement (Prior to Recognition of Critical Event)**13

- (01) Going straight  
 (02) Slowing or stopping in traffic lane  
 (03) Starting in traffic lane  
 (04) Stopped in traffic lane  
 (05) Passing or overtaking another vehicle  
 (06) Disabled or parked in travel lane  
 (07) Leaving a parking position  
 (08) Entering a parking position  
 (09) Turning right  
 (10) Turning left  
 (11) Making a U-turn  
 (12) Backing up (other than for parking position)  
 (13) Negotiating a curve  
 (14) Changing lanes  
 (15) Merging  
 (16) Successful avoidance maneuver to a previous critical event  
 (97) Other (specify):  
 (98) No driver present  
 (99) Unknown

## CODES FOR ROLLOVER INITIATION OBJECT CONTACTED

- (00) No rollover
- (01-30) — Vehicle Number

### Noncollision

- (31) Turn-over — fall-over
- (33) Jackknife

### Collision With Fixed Object

- (41) Tree ( $\leq$  4 inches in diameter)
- (42) Tree ( $>$  4 inches in diameter)
- (43) Shrubbery or bush
- (44) Embankment

- (45) Breakaway pole or post (any diameter)

### Nonbreakaway Pole or Post

- (50) Pole or post ( $\leq$  4 inches in diameter)
- (51) Pole or post ( $>$  4 inches but  $\leq$  12 inches in diameter)
- (52) Pole or post ( $>$  12 inches in diameter)
- (53) Pole or post (diameter unknown)
- (54) Concrete traffic barrier
- (55) Impact attenuator
- (56) Other traffic barrier (includes guardrail)  
(specify): \_\_\_\_\_

- (57) Fence
- (58) Wall
- (59) Building
- (60) Ditch or culvert
- (61) Ground
- (62) Fire hydrant
- (63) Curb
- (64) Bridge
- (68) Other fixed object (specify): \_\_\_\_\_

- (69) Unknown fixed object

### Collision with Nonfixed Object

- (71) Motor vehicle not in-transport
- (76) Animal
- (77) Train
- (78) Trailer, disconnected in transport
- (88) Other nonfixed object (specify): \_\_\_\_\_

- (89) Unknown nonfixed object

- (98) Other event (specify): \_\_\_\_\_

- (99) Unknown event or object

**PRECRASH DATA (Continued)****65. Critical Precrash Event**06*This Vehicle Loss of Control Due To:*

- (01) Blow out or flat tire
- (02) Stalled engine
- (03) Disabling vehicle failure (e.g., wheel fell off) (specify): \_\_\_\_\_
- (04) Non-disabling vehicle problem (e.g., hood flew up) (specify): \_\_\_\_\_
- (05) Poor road conditions (puddle, pot hole, ice, etc.) (specify): \_\_\_\_\_
- (06) Traveling too fast for conditions
- (08) Other cause of control loss (specify): \_\_\_\_\_
- (09) Unknown cause of control loss

*This Vehicle Traveling*

- (10) Over the lane line on left side of travel lane
- (11) Over the lane line on right side of travel lane
- (12) Off the edge of the road on the left side
- (13) Off the edge of the road on the right side
- (14) End departure
- (15) Turning left at intersection
- (16) Turning right at intersection
- (17) Crossing over (passing through) intersection
- (19) Unknown travel direction

*Other Motor Vehicle In Lane*

- (50) Stopped
- (51) Traveling in same direction with lower speed (i.e., lower steady speed or decelerating)
- (52) Traveling in same direction with higher speed
- (53) Traveling in opposite direction
- (54) In crossover
- (55) Backing
- (59) Unknown travel direction of other motor vehicle in lane

*Other Motor Vehicle Encroaching Into Lane*

- (60) From adjacent lane (same direction)—over left lane line
- (61) From adjacent lane (same direction)—over right lane line
- (62) From opposite direction—over left lane line
- (63) From opposite direction—over right lane line
- (64) From parking lane
- (65) From crossing street, turning into same direction
- (66) From crossing street, across path
- (67) From crossing street, turning into opposite direction
- (68) From crossing street, intended path not known
- (70) From driveway, turning into same direction
- (71) From driveway, across path
- (72) From driveway, turning into opposite direction
- (73) From driveway, intended path not known
- (74) From entrance to limited access highway
- (78) Encroachment by other vehicle—details unknown

*Pedestrian or Pedalcyclist, or Other Nonmotorist*

- (80) Pedestrian in roadway
- (81) Pedestrian approaching roadway
- (82) Pedestrian - unknown location
- (83) Pedalcyclist or other nonmotorist in roadway (specify): \_\_\_\_\_
- (84) Pedalcyclist or other nonmotorist approaching roadway (specify): \_\_\_\_\_
- (85) Pedalcyclist or other nonmotorist—unknown location (specify): \_\_\_\_\_

*Object or Animal*

- (87) Animal in roadway
- (88) Animal approaching roadway
- (89) Animal—unknown location
- (90) Object in roadway
- (91) Object approaching roadway
- (92) Object—unknown location

(98) Other critical precrash event (specify): \_\_\_\_\_

(99) Unknown

For Corrective Actions Attempted see variable GV14  
(Attempted Avoidance Manuever)**66. Precrash Stability After Avoidance Maneuver**4

- (0) No avoidance maneuver
- (1) Tracking
- (2) Skidding longitudinally—rotation less than 30 degrees
- (3) Skidding laterally—clockwise rotation
- (4) Skidding laterally—counterclockwise rotation
- (7) Other vehicle loss-of-control (specify): \_\_\_\_\_

(8) No driver present

(9) Precrash stability unknown

**67. Precrash Directional Consequences of Avoidance Maneuver (Corrective Action)**4

- (0) No avoidance maneuver
- (1) Vehicle stayed in travel lane where avoidance maneuver was initiated
- (2) Vehicle stayed on roadway but left travel lane where avoidance maneuver was initiated
- (3) Vehicle stayed on roadway, not known if left travel lane where avoidance maneuver was initiated
- (4) Vehicle departed roadway
- (5) Avoidance maneuver initiated off roadway
- (8) No driver present
- (9) Directional consequences unknown

\*\*\* IF THE CDS APPLICABLE VEHICLE WAS NOT INSPECTED (I.E., GV35=0), \*\*\*  
DO NOT COMPLETE THE EXTERIOR AND INTERIOR VEHICLE FORMS.

\*\*\* IF GV07 DOES NOT EQUAL 01-49, DO NOT COMPLETE \*\*\*  
THE EXTERIOR VEHICLE, INTERIOR VEHICLE,  
OCCUPANT ASSESSMENT, AND OCCUPANT INJURY FORMS.

## EXTERIOR VEHICLE FORM

**NATIONAL ACCIDENT SAMPLING SYSTEM  
CRASHWORTHINESS DATA SYSTEM**

Administration	Station Number
1. <del>Primary Sampling Unit Number</del> ____	3. Vehicle Number <u>01</u>
2. Case Number - <del>Stratum</del> <u>92-12</u>	

## VEHICLE IDENTIFICATION

VIN 2 F A C P 7 2 G 5 M X [REDACTED] Model Year 9 1  
Vehicle Make (specify): FORD Vehicle Model (specify): LTD CROWN VICTORIA

## LOCATOR

Locate the end of the damage with respect to the vehicle longitudinal center line or bumper corner for end impacts or an undamaged axle for side impacts.

Specific Impact No.	Location of Direct Damage	Location of Field L
7	SEE NARRATIVE	

## CRUSH PROFILE

**NOTES:** Identify the plane at which the C-measurements are taken (e.g., at bumper, above bumper, at sill, above sill, etc.) and label adjustments (e.g., free space).

**Measure and document on the vehicle diagram the location of maximum crush.**

**Measure C1 to C6 from driver to passenger side in front or rear impacts and rear to front in side impacts.**

**Free space value is defined as the distance between the baseline and the original body contour taken at the individual C locations. This may include the following: bumper lead, bumper taper, side protrusion, side taper, etc. Record the value for each C-measurement and maximum crush.**

**Use as many lines/columns as necessary to describe each damage profile.**

[illegible]

## VEHICLE DAMAGE SKETCH

<p><b>TIRE—WHEEL DAMAGE</b></p> <p>a. Rotation physically restricted      b. Tire deflated</p> <table style="width: 100%;"> <tr> <td>RF <u>2</u></td> <td>RF <u>2</u></td> </tr> <tr> <td>LF <u>2</u></td> <td>LF <u>2</u></td> </tr> <tr> <td>RR <u>2</u></td> <td>RR <u>2</u></td> </tr> <tr> <td>LR <u>2</u></td> <td>LR <u>2</u></td> </tr> </table> <p>(1) Yes (2) No (8) NA (9) Unk.</p>	RF <u>2</u>	RF <u>2</u>	LF <u>2</u>	LF <u>2</u>	RR <u>2</u>	RR <u>2</u>	LR <u>2</u>	LR <u>2</u>	<p><b>ORIGINAL SPECIFICATIONS</b></p> <p>Wheelbase <u>114.3"</u></p> <p>Overall Length <u>211.0"</u></p> <p>Maximum Width <u>72.5"</u></p> <p>Curb Weight <u>3822</u></p> <p>Average Track <u>62.75"</u></p> <p>Front Overhang _____</p> <p>Rear Overhang _____</p> <p>Engine Size: cyl./displ. <u>8 cyl. / 5.8 liter</u></p> <p>Undeformed End Width _____</p>	<p><b>WHEEL STEER ANGLES</b> (For locked front wheels or displaced rear axles only)</p> <p>RF ± _____ °</p> <p>LF ± _____ °</p> <p>RR ± _____ °</p> <p>LR ± _____ °</p> <p>Within ± 5 degrees</p>
RF <u>2</u>	RF <u>2</u>									
LF <u>2</u>	LF <u>2</u>									
RR <u>2</u>	RR <u>2</u>									
LR <u>2</u>	LR <u>2</u>									
<p><b>TYPE OF TRANSMISSION</b></p> <p><input type="checkbox"/> Manual      <input checked="" type="checkbox"/> Automatic 4-SPEED</p>	<p><b>DRIVE WHEELS</b></p> <p><input type="checkbox"/> FWD    <input checked="" type="checkbox"/> RWD    <input type="checkbox"/> 4WD</p>									
<p>Approximate Cargo Weight <u>100 lbs.</u> POLICE EQUIPMENT</p>										

FRONT END STROKE

R = 1.25"

L = 0.625"

**NOTES:** Sketch new perimeter and cross hatch direct damage and single hatch induced damage on all views. Annotate observations which might be useful in reconstructing the accident (e.g., grass in tire bead, direction of striations, scuff on sidewalls, etc.). If pulling trailer, sketch type of trailer and damage received on the back of this page.

Annotate any damage caused by extrication such as component removal by torching, prying, or hydraulic shears.



## CDC WORKSHEET

## CODES FOR OBJECT CONTACTED

## (01-30) — Vehicle Number

## Noncollision

- (31) Overtake — rollover  
 (32) Fire or explosion  
 (33) Jackknife  
 (34) Other intraunit damage (specify): \_\_\_\_\_

(35) Noncollision injury

(38) Other noncollision (specify): \_\_\_\_\_

(39) Noncollision — details unknown

## Collision With Fixed Object

- (41) Tree ( $\leq 4$  inches in diameter)  
 (42) Tree ( $> 4$  inches in diameter)  
 (43) Shrubbery or bush  
 (44) Embankment  
 (45) Breakaway pole or post (any diameter)

## Nonbreakaway Pole or Post

- (50) Pole or post ( $\leq 4$  inches in diameter)  
 (51) Pole or post ( $> 4$  inches but  $\leq 12$  inches in diameter)  
 (52) Pole or post ( $> 12$  inches in diameter)  
 (53) Pole or post (diameter unknown)  
 (54) Concrete traffic barrier  
 (55) Impact attenuator  
 (56) Other traffic barrier (includes guardrail) (specify): \_\_\_\_\_

(57) Fence

(58) Wall

(59) Building

(60) Ditch or culvert

(61) Ground

(62) Fire hydrant

(63) Curb

(64) Bridge

(68) Other fixed object (specify): \_\_\_\_\_

(69) Unknown fixed object

## Collision with Nonfixed Object

- (71) Motor vehicle not in-transport  
 (72) Pedestrian  
 (73) Cyclist or cycle  
 (74) Other nonmotorist or conveyance

(75) Vehicle occupant

(76) Animal

(77) Train

(78) Trailer, disconnected in transport

(88) Other nonfixed object (specify): \_\_\_\_\_

(89) Unknown nonfixed object

(98) Other event (specify): \_\_\_\_\_

(99) Unknown event or object

## DEFORMATION CLASSIFICATION BY EVENT NUMBER

Accident Event Sequence Number	Object Contacted	(1) (2) Direction of Force (degrees)	Incremental Value of Shift	(3) Deformation Location	(4) Specific Longitudinal or Lateral Location	(5) Specific Vertical or Lateral Location	(6) Type of Damage Distribution	(7) Deformation Extent
01	50	015	00	R	B	E	W	01
02	50	060	00	R	F	E	N	01
03	43	000	00	F	D	M	W	03
04	41	090	00	F	Z	L	S	01
05	42	000	00	R	F	E	N	03
06	41	000	00	R	F	E	N	02
07	42	000	00	R	P	A	N	05
—	—	—	—	—	—	—	—	—
—	—	—	—	—	—	—	—	—
—	—	—	—	—	—	—	—	—

## COLLISION DEFORMATION CLASSIFICATION

## HIGHEST DELTA "V"

Accident Event Sequence Number	Object Contacted	(1) (2) Direction of Force	(3) Deformation Location	(4) Longitudinal or Lateral Location	(5) Vertical or Lateral Location	(6) Type of Damage Distribution	(7) Deformation Extent
4. <u>07</u>	5. <u>42</u>	6. <u>00</u>	7. <u>R</u>	8. <u>P</u>	9. <u>A</u>	10. <u>N</u>	11. <u>05</u>

## Second Highest Delta "V"

12. <u>05</u>	13. <u>42</u>	14. <u>00</u>	15. <u>R</u>	16. <u>F</u>	17. <u>E</u>	18. <u>N</u>	19. <u>03</u>
---------------	---------------	---------------	--------------	--------------	--------------	--------------	---------------

## CRUSH PROFILE

The crush profile for the damage described in the CDC(s) above should be documented in the appropriate space below. (ALL MEASUREMENTS ARE IN INCHES.)

## HIGHEST DELTA "V"

20. <u>L</u> SIDERAIL	21. <u>C<sub>1</sub></u> CRUSH	<u>C<sub>2</sub></u>	<u>C<sub>3</sub></u>	<u>C<sub>4</sub></u>	<u>C<sub>5</sub></u>	<u>C<sub>6</sub></u>	22. <u>±D</u>
<u>054</u>	<u>16</u>	<u>31</u>	<u>33</u>	<u>13</u>	<u>---</u>	<u>---</u>	<u>+</u> <u>-</u>

~~Second~~ Highest Delta "V"

23. <u>L</u> BELTLINE	24. <u>C<sub>1</sub></u> CRUSH	<u>C<sub>2</sub></u>	<u>C<sub>3</sub></u>	<u>C<sub>4</sub></u>	<u>C<sub>5</sub></u>	<u>C<sub>6</sub></u>	25. <u>±D</u>
<u>060</u>	<u>08</u>	<u>19</u>	<u>30</u>	<u>20</u>	<u>08</u>	<u>04</u>	<u>⊕</u> <u>- 005</u>

26. Are CDCs Documented but Not Coded on The Automated File? 1  
(0) No  
(1) Yes

27. Researcher's Assessment of Vehicle Disposition 1  
(0) Not towed due to vehicle damage  
(1) Towed due to vehicle damage  
(9) Unknown

28. Original Wheelbase 114.3  
114.3 Code to the nearest tenth of an inch  
(9999) Unknown

29. Is This A Multi-Stage Manufactured Vehicle  
And/Or A Certified Altered Vehicle?

0

- (0) No post manufacturer modifications  
(1) Yes - post manufacturer modifications  
(specify): \_\_\_\_\_

\_\_\_\_\_  
(Include photograph of CERTIFICATION  
PLACARD in case report)

(9) Unknown if vehicle is modified

30. Fire Occurrence

0

(0) No fire

Yes, fire occurred

- (1) Minor  
(2) Major  
(9) Unknown

31. Origin of Fire

0

- (0) No fire  
(1) Vehicle exterior (front, side, back, top)  
(2) Exhaust system  
(3) Fuel tank (and other fuel retention  
system parts)  
(4) Engine compartment  
(5) Cargo/trunk compartment  
(6) Instrument panel  
(7) Passenger compartment area  
(8) Other location (specify): \_\_\_\_\_

(9) Unknown

32. Type of Fuel Tank

1

- (0) No fuel tank (electrical vehicle)  
(1) Metallic  
(2) Non-metallic  
(9) Unknown

\*\*\* STOP: IF THE CDS APPLICABLE VEHICLE WAS NOT TOWED AND WAS NOT AN AOPS \*\*\*  
(I.E., GV09 = 0 OR 9 AND GV36 = 0), DO NOT COMPLETE THE INTERIOR VEHICLE FORM.



# INTERIOR VEHICLE FORM

BEST AVAILABLE COPY

NATIONAL ACCIDENT SAMPLING SYSTEM  
CRASHWORTHINESS DATA SYSTEM

1. Primary Sampling Unit Number

2. Case Number—Stratum

3. Vehicle Number

## INTEGRITY

4. Passenger Compartment Integrity

(00) No integrity loss

Yes, Integrity Was Lost Through

(01) Windshield

(02) Door (side)

(03) Door/hatch (back door)

(04) Roof

(05) Roof glass

(06) Side window

(07) Rear window (backlight)

(08) Roof and roof glass

(09) Windshield and door (side)

(10) Windshield and roof

(11) Side and rear window (side window and backlight)

(12) Windshield and side window

(13) Door and side window

(18) Other combination of above (specify):

(99) Unknown

Door, Tailgate or Hatch Opening

5. LF 3 6. RF 3 7. LR 3 8. RR 3 9. TG/H 0

(0) No door/gate/hatch

(1) Door/gate/hatch remained closed and operational

(2) Door/gate/hatch came open during collision

(3) Door/gate/hatch jammed shut

(8) Other (specify):

(9) Unknown

Damage/Failure Associated with Door, Tailgate or Hatch Opening in Collision. If IV05-IV09 ≠ 2, Then code 0

10. LF 0 11. RF 0 12. LR 0 13. RR 0 14. TG/H 0

(0) No door/gate/hatch or door not opened

Door, Tailgate or Hatch Came Open During Collision

(1) Door operational (no damage)

(2) Latch/striker failure due to damage

(3) Hinge failure due to damage

(4) Door structure failure due to damage

(5) Door support (i.e., pillar, sill, roof side rail, etc.) failure due to damage

(6) Latch/striker and hinge failure due to damage

(8) Other failure (specify):

(9) Unknown

## GLAZING

Glazing Damage from Impact Forces

15. WS 2 16. LF 6 17. RF 5 18. LR 0 19. RR 5

20. BL 6 21. Roof 3 22. Other 3

(0) No glazing damage from impact forces

(1) Glazing in place and cracked from impact forces

(2) Glazing in place and holed from impact forces

(3) Glazing out-of-place (cracked or not) from impact forces

(4) Glazing disintegrated from impact forces

(5) Glazing contacted by occupant but no glazing damage

(6) Glazing in place and cracked by occupant contact

(7) Glazing in place and holed by occupant contact

(8) No glazing damage

(9) Unknown if damaged

Glazing Damage from Occupant Contact

23. WS 0 24. LF 0 25. RF 0 26. LR 0 27. RR 0

28. BL 0 29. Roof 0 30. Other 0

(0) No occupant contact to glazing or no glazing

(1) Glazing contacted by occupant but no glazing damage

(2) Glazing in place and cracked by occupant contact

(3) Glazing in place and holed by occupant contact

(4) Glazing out-of-place (cracked or not) by occupant contact and not holed by occupant contact

(5) Glazing out-of-place by occupant contact and holed by occupant contact

(6) Glazing disintegrated by occupant contact

(9) Unknown if contacted by occupant

If No Glazing Damage And No Occupant Contact or No Glazing, Then Code IV31 Through IV46 As 0

Type of Window/Windshield Glazing

31. WS 1 32. LF 2 33. RF 2 34. LR 2 35. RR 2

36. BL 1 37. Roof 0 38. Other 0

(0) No glazing contact and no damage, or no glazing

(1) AS-1 — Laminated

(2) AS-2 — Tempered

(3) AS-3 — Tempered-laminated

(4) AS-14 — Glass/Plastic

(8) Other (specify):

(9) Unknown

Window Precrash Glazing Status

39. WS 1 40. LF 3 41. RF 2 42. LR 2 43. RR 2

44. BL 1 45. Roof 0 46. Other 0

(0) No glazing contact and no damage, or no glazing

(1) Fixed

(2) Closed

(3) Partially opened

(4) Fully opened

(9) Unknown



## National Accident Sampling System-Crashworthiness Data System: Interior Vehicle Form

## OCCUPANT AREA INTRUSION

Note: If no intrusions, leave variables IV47-IV86 blank.

	Location of Intrusion	Intruding Component	Magnitude of Intrusion	Dominant Crush Direction
1st	47. 1 3	48. 1 3	49. 6	50. 3
2nd	51. 1 3	52. 1 3	53. 6	54. 3
3rd	55. 1 3	56. 1 3	57. 6	58. 3
4th	59. 1 3	60. 1 3	61. 6	62. 3
5th	63. 1 3	64. 1 3	65. 6	66. 3
6th	67. _____	68. _____	69. _____	70. _____
7th	71. _____	72. _____	73. _____	74. _____
8th	75. _____	76. _____	77. _____	78. _____
9th	79. _____	80. _____	81. _____	82. _____
10th	83. _____	84. _____	85. _____	86. _____

## LOCATION OF INTRUSION

## Front Seat

- (11) Left  
(12) Middle  
(13) Right

## Second Seat

- (21) Left  
(22) Middle  
(23) Right

## Third Seat

- (31) Left  
(32) Middle  
(33) Right

## Fourth Seat

- (41) Left  
(42) Middle  
(43) Right

- (97) Catastrophic  
(98) Other enclosed area (specify)

- (99) Unknown

## INTRUDING COMPONENT

## Interior Components

- (01) Steering assembly  
(02) Instrument panel left  
(03) Instrument panel center  
(04) Instrument panel right  
(05) Toe pan  
(06) A-pillar  
(07) B-pillar  
(08) C-pillar  
(09) Floor panel (floor)  
(10) Rear seat convertible top  
(11) Rear seat rail  
(12) Windshield  
(13) Windshield header  
(14) Window frame  
(15) Floor pan (includes sill)  
(16) Backlight header  
(17) Front seat back  
(18) Second seat back  
(19) Third seat back  
(20) Fourth seat back  
(21) Fifth seat back  
(22) Seat cushion  
(23) Back door/panel (e.g., tailgate)  
(24) Other interior component (specify):  
(25) Side panel - forward of the A-pillar  
(26) Side panel - rear of the A-pillar

## Exterior Components

- (30) Hood  
(31) Outside surface of this vehicle (specify):  
(32) Other exterior object in the environment (specify):  
(33) Unknown exterior object  
(97) Catastrophic  
(98) Intrusion of unlisted component(s) (specify):  
(99) Unknown

## MAGNITUDE OF INTRUSION

- (1)  $\geq 1$  inch but  $< 3$  inches  
(2)  $\geq 3$  inches but  $< 6$  inches  
(3)  $\geq 6$  inches but  $< 12$  inches  
(4)  $\geq 12$  inches but  $< 18$  inches  
(5)  $\geq 18$  inches but  $< 24$  inches  
(6)  $\geq 24$  inches  
(7) Catastrophic  
(9) Unknown

## DOMINANT CRUSH DIRECTION

- (1) Vertical  
(2) Longitudinal  
(3) Lateral  
(7) Catastrophic  
(9) Unknown



## STEERING COLUMN

## 87. Steering Column Type

- (1) Fixed column  
 (2) Tilt column  
 (3) Telescoping column  
 (4) Tilt and telescoping column  
 (8) Other column type (specify):  
 (9) Unknown

## 88. Blank

(This variable is left blank so that numbering consistency can be maintained with the 1988-91 CDS.)

## 89. Blank

(This variable is left blank so that numbering consistency can be maintained with the 1988-91 CDS.)

## 90. Blank

(This variable is left blank so that numbering consistency can be maintained with the 1988-91 CDS.)

## 91. Blank

(This variable is left blank so that numbering consistency can be maintained with the 1988-91 CDS.)

## 92. Steering Rim/Spoke Deformation

- 15" Code actual measured deformation to the nearest inch.  
 (0) No steering rim deformation  
 (1-5) Actual measured value  
 (6) 6 inches or more  
 (8) Observed deformation cannot be measured  
 (9) Unknown

## 93. Location of Steering Rim/Spoke Deformation

- (00) No steering rim deformation

 
## Quarter Sections

- (01) Section A  
 (02) Section B  
 (03) Section C  
 (04) Section D



## Half Sections

- (05) Upper half of rim/spoke  
 (06) Lower half of rim/spoke  
 (07) Left half of rim/spoke  
 (08) Right half of rim/spoke



- (09) Complete steering wheel collapse  
 (10) Undetermined location  
 (99) Unknown

## INSTRUMENT PANEL

## 94. Odometer Reading

027,000

26,919 miles—Code mileage to the nearest 1,000 miles

- (000) No odometer  
 (001) Less than 1,500 miles  
 (300) 299,500 miles or more  
 (999) Unknown

Source: \_\_\_\_\_

## 95. Instrument Panel Damage from Occupant Contact?

- (0) No  
 (1) Yes  
 (9) Unknown

1

## 96. Knee Bolsters Deformed from Occupant Contact?

- (0) No  
 (1) Yes  
 (8) Not present  
 (9) Unknown

0



## 97. Did Glove Compartment Door Open During Collision(s)?

- (0) No  
 (1) Yes  
 (8) Not present  
 (9) Unknown

1

## VEHICLE INTERIOR SKETCHES

Note area of ejection/entrapment

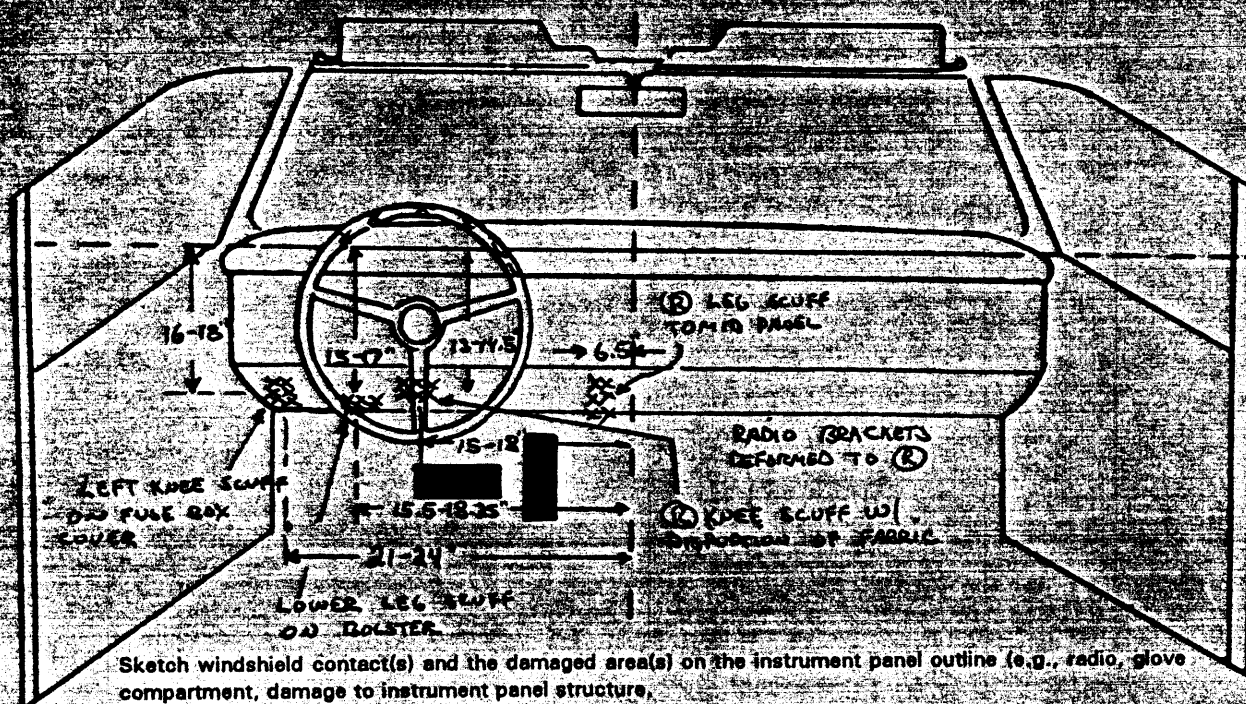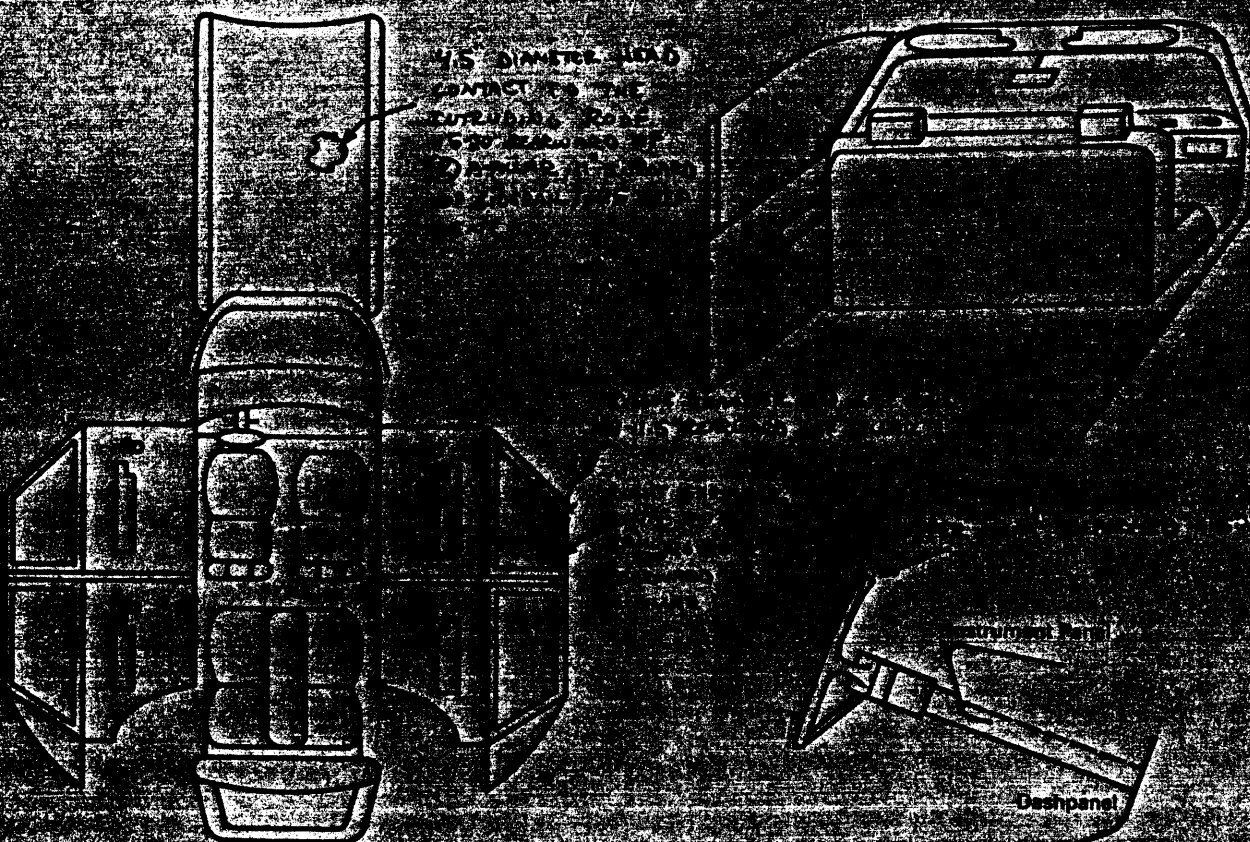

Sketch windshield contact(s) and the damaged area(s) on the instrument panel outline (e.g., radio, glove compartment, damage to instrument panel structure, Cross hatch contact points, draw spider webs or use other annotation as may be appropriate. Annotate the contacted area with a letter (begin with A) and list on the Points of Occupant Contact page.



## POINTS OF OCCUPANT CONTACT

Contact	Interior Component Contacted	Occupant No. If Known	Body Region If Known	Supporting Physical Evidence	Confidence Level of Contact Point
A	13	1	(1) KNEE	SCUFF	1
B	13	1	LEG	SCUFF	1
C	13	1	(1) KNEE	SCUFF w/ DISRUPTION OF FABRIC	1
D	10	1	(1) LEG	SCUFF	1
E	13	1	(1) LEG	BRACKETS DEFORMED	1
F	53	1	(1) SHOULDER	SCUFF	1
G	53	1	(1) ARM	TISSUE	1
H	54	1	HEAD	DENT	1
I					
J					
K					
L					
M					
N					

## CODES FOR INTERIOR COMPONENTS

## FRONT

- (01) Windshield
- (02) Mirror
- (03) Sunvisor
- (04) Steering wheel rim
- (05) Steering wheel hub/spoke
- (06) Steering wheel (combination of codes 04 and 05)
- (07) Steering column, transmission selector lever, other attachment
- (08) Add on equipment (e.g., CB, tape deck, air conditioner)
- (09) Left instrument panel and below
- (10) Center instrument panel and below
- (11) Right instrument panel and below
- (12) Glove compartment door
- (13) Knee bolster
- (14) Windshield including one or more of the following: front header, A-pillar, instrument panel, mirror, or steering assembly (driver side only)
- (15) Windshield including one or more of the following: front header, A-pillar, instrument panel, or mirror (passenger side only)
- (16) Other front object (specify):

## LEFT SIDE

- (20) Left side interior surface, excluding hardware or armrests
- (21) Left side hardware or armrest
- (22) Left A pillar
- (23) Left B pillar
- (24) Other left pillar (specify):
- (25) Left side window glass or frame

- (26) Left side window glass including one or more of the following: frame, window sill, A pillar, B pillar, or roof side rail.
- (27) Other left side object (specify):

## RIGHT SIDE

- (28) Left side window sill
- (30) Right side interior surface, excluding hardware or armrests
- (31) Right side hardware or armrest
- (32) Right A pillar
- (33) Right B pillar
- (34) Other right pillar (specify):
- (35) Right side window glass or frame
- (36) Right side window glass including one or more of the following: frame, window sill, A pillar, B pillar, or roof side rail.
- (37) Other right side object (specify):
- (38) Right side window sill

## INTERIOR

- (40) Seat, back support
- (41) Belt restraint webbing/buckle
- (42) Belt restraint B-pillar attachment point
- (43) Other restraint system component (specify):
- (44) Head restraint system
- (45) Air bag
- (46) Other occupants (specify):
- (47) Interior loose objects

- (48) Child safety seat (specify):

- (49) Other interior object (specify):  
POLICE RADIOS

## ROOF

- (50) Front header
- (51) Rear header
- (52) Roof left side rail
- (53) Roof right side rail
- (54) Roof or convertible top

## FLOOR

- (56) Floor (including toe pan)
- (57) Floor or console mounted transmission lever, including console
- (58) Parking brake handle
- (59) Foot controls including parking brake

## REAR

- (60) Backlight (rear window)
- (61) Backlight storage rack, door, etc.
- (62) Other rear object (specify):

## CONFIDENCE LEVEL OF CONTACT POINT

- (1) Certain
- (2) Probable
- (3) Possible
- (9) Unknown

# AUTOMATIC RESTRAINTS

**NOTES:** Encode the data for each applicable front seat position. The attribute for the variables may be found below. Restraint systems should be assessed during the vehicle inspection then coded on the Occupant Assessment Form.

## AIR BAGS

		Left	Right
E I R S T	Availability/Function		
	Deployment		
	Failure		
Air Bag System Availability/Function		Air Bag System Deployment	
(0) Not equipped/not available		(0) Not equipped/not available	
(1) Air bag		(1) Air bag	
(2) Air bag disconnected (specify)		(2) Air bag disconnected (specify)	
(3) Air bag not reinstalled		(3) Air bag not reinstalled	
(9) Unknown		(9) Unknown	

## AUTOMATIC BELTS

		Left	Right
E I R S T	Availability/Function		
	Use		
	Type		
	Proper Use		
	Failure Modes		
Automatic (Passive) Belt System		Automatic (Passive) Belt System	
Availability/Function		Availability/Function	
(0) Not equipped/not available		(0) Not equipped/not available/not used	
(1) 2 point automatic belts		(1) Automatic belt used properly	
(2) 3 point automatic belts		(2) Automatic belt used properly with child safety seat	
(3) Automatic belts - type unknown		(3) Automatic belt used improperly	
Non-functional		Automatic Belt Used Improperly	
(4) Automatic belts destroyed or rendered inoperative		(3) Automatic shoulder belt worn under arm	
(9) Unknown		(4) Automatic shoulder belt worn behind back	
Automatic (Passive) Belt System Use		(5) Automatic belt worn around more than one person	
(0) Not equipped/not available/destroyed or rendered inoperative		(6) Lap portion of automatic belt worn on abdomen	
(1) Automatic belt in use		(7) Automatic lap and shoulder belt or automatic shoulder belt used improperly	
(2) Automatic belt not in use (manually disconnected, motorized track inoperative)		(8) Other improper use of automatic belt system (specify):	
(3) Automatic belt use unknown		(9) Unknown	
(9) Unknown			
Automatic (Passive) Belt System Type		Automatic (Passive) Belt Failure Modes During Accident	
(0) Not equipped/not available		(0) Not equipped/not available/not in use	
(1) Non-motorized system		(1) No automatic belt failure(s)	
(2) Motorized system		(2) Torn webbing (stretched webbing not included)	
(9) Unknown		(3) Broken buckle or latchplate	
		(4) Upper anchorage separated	
		(5) Other anchorage separated (specify):	
		(6) Broken retractor	
		(7) Combination of above (specify):	
		(8) Other automatic belt failure (specify):	
		(9) Unknown	



## MANUAL RESTRAINTS

NOTES: Encode the applicable data for each seat position in the vehicle. The attribute for the variable may be found below. Restraint systems should be assessed during the vehicle inspection then coded on the Occupant Assessment Form.

If a Child safety seat is present, encode the data on the back of this page.

If the vehicle has automatic restraints available, encode the appropriate data on the back of the previous page.

		Left	Center	Right
F R O N T	Availability	4	3	4
	Use	04	03	04
	Failure Modes	1	1	1
D R I V E R	Availability	4	3	4
	Use	04	03	04
	Failure Modes	1	1	1
P A S S E N G E R	Availability	X		
	Use			
	Failure Modes			
H E A D C U S H	Availability	X		
	Use			
	Failure Modes			

## Manual (Active) Belt System Availability

- (0) None available
- (1) Belt removed/destroyed
- (2) Shoulder belt
- (3) Lap belt
- (4) Lap and shoulder belt
- (5) Belt available - type unknown

## Integral Belt Partially Destroyed

- (6) Shoulder belt (lap belt destroyed/removed)
- (7) Lap belt (shoulder belt destroyed/removed)

(8) Other belt (specify): \_\_\_\_\_

(9) Unknown

## Manual (Active) Belt System Use

- (00) None used, not available, or belt removed/destroyed
- (01) Inoperable (specify): \_\_\_\_\_
- (02) Shoulder belt
- (03) Lap belt
- (04) Lap and shoulder belt
- (05) Belt used - type unknown

## (08) Other belt used (specify): \_\_\_\_\_

- (12) Shoulder belt used with child safety seat
- (13) Lap belt used with child safety seat
- (14) Lap and shoulder belt used with child safety seat
- (15) Belt used with child safety seat - type unknown
- (18) Other belt used with child safety seat (specify): \_\_\_\_\_
- (99) Unknown if belt used

## Manual (Active) Belt Failure Modes During Accident

- (0) No manual belt used or not available
- (1) No manual belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify): \_\_\_\_\_
- (6) Broken retractor
- (7) Combination of above (specify): \_\_\_\_\_
- (8) Other manual belt failure (specify): \_\_\_\_\_
- (9) Unknown



# CHILD SAFETY SEAT FIELD ASSESSMENT

When a child safety seat is present enter the occupant's number in the first row and complete the column below the occupant's number using the codes listed below. Complete a column for each child safety seat present.

Occupant Number		NONE				
1. Type of Child Safety Seat						
2. Child Safety Seat Orientation						
3. Child Safety Seat Harness Usage						
4. Child Safety Seat Shield Usage						
5. Child Safety Seat Tether Usage						
6. Child Safety Seat Make/Model						

Specify Below for Each Child Safety Seat

1. Type of Child Safety Seat

(0) No child safety seat

(1) Infant seat

(2) Toddler seat

(3) Convertible seat

(4) Booster seat

(7) Other type child safety seat (specify):

(8) Unknown child safety seat type

(9) Unknown if child safety seat used

2. Child Safety Seat Orientation

(00) No child safety seat

Designed for Rear Facing for This Age/Weight

(01) Rear facing

(02) Forward facing

(08) Other orientation (specify):

(09) Unknown orientation

Designed for Forward Facing for This Age/Weight

(11) Rear facing

(12) Forward facing

(18) Other orientation (specify):

(19) Unknown orientation

Unknown Design or Orientation For This Age/Weight, or Unknown Age/Weight

(21) Rear facing

(22) Forward facing

(28) Other orientation (specify):

(29) Unknown orientation

(99) Unknown if child safety seat used

3. Child Safety Seat Harness Usage

(00) No child safety seat

Not Designed with Harness/Shield/Tether

(01) After market harness/shield/tether added, not used

(02) After market harness/shield/tether used

(03) Child safety seat used, but no after market harness/shield/tether added

(09) Unknown if harness/shield/tether added or used

Designed With Harness/Shield/Tether

(11) Harness/shield/tether not used

(12) Harness/shield/tether used

(19) Unknown if harness/shield/tether used

Unknown If Designed With Harness/Shield/Tether

(21) Harness/shield/tether not used

(22) Harness/shield/tether used

(29) Unknown if harness/shield/tether used

(99) Unknown if child safety seat used

4. Child Safety Seat Shield Usage

(00) No child safety seat

Not Designed with Harness/Shield/Tether

(01) After market harness/shield/tether added, not used

(02) After market harness/shield/tether used

(03) Child safety seat used, but no after market harness/shield/tether added

(09) Unknown if harness/shield/tether added or used

Designed With Harness/Shield/Tether

(11) Harness/shield/tether not used

(12) Harness/shield/tether used

(19) Unknown if harness/shield/tether used

Unknown If Designed With Harness/Shield/Tether

(21) Harness/shield/tether not used

(22) Harness/shield/tether used

(29) Unknown if harness/shield/tether used

(99) Unknown if child safety seat used

5. Child Safety Seat Tether Usage

(00) No child safety seat

Not Designed with Harness/Shield/Tether

(01) After market harness/shield/tether added, not used

(02) After market harness/shield/tether used

(03) Child safety seat used, but no after market harness/shield/tether added

(09) Unknown if harness/shield/tether added or used

Designed With Harness/Shield/Tether

(11) Harness/shield/tether not used

(12) Harness/shield/tether used

(19) Unknown if harness/shield/tether used

Unknown If Designed With Harness/Shield/Tether

(21) Harness/shield/tether not used

(22) Harness/shield/tether used

(29) Unknown if harness/shield/tether used

(99) Unknown if child safety seat used

6. Child Safety Seat Make/Model

(Specify make/model and occupant number)

**HEAD RESTRAINTS/SEAT EVALUATION**

**NOTES:** Encode the applicable data for each seat position in the vehicle. The attribute for these variables may be found at the bottom of the page. Head restraint type/damage and seat type/performance should be assessed during the vehicle inspection then coded on the Occupant Assessment Form.

		Left	Center	Right
<b>FIRST</b>	Head Restraint Type/Damage	3	-	4
	Seat Type	06	06	06
	Seat Performance	1	6	6
	Seat Orientation	1	1	1
<b>SECOND</b>	Head Restraint Type/Damage	0	0	0
	Seat Type	03	03	03
	Seat Performance	1	1	1
	Seat Orientation	1	1	1
<b>THIRD</b>	Head Restraint Type/Damage	X		
	Seat Type			
	Seat Performance			
	Seat Orientation			
<b>OTHER</b>	Head Restraint Type/Damage	X		
	Seat Type			
	Seat Performance			
	Seat Orientation			

**Head Restraint Type/Damage by Occupant at This Occupant Position**

- (0) No head restraints
- (1) Integral — no damage
- (2) Integral — damaged during accident
- (3) Adjustable — no damage
- (4) Adjustable — damaged during accident
- (5) Add-on — no damage
- (6) Add-on — damaged during accident
- (8) Other Specify: \_\_\_\_\_
- (9) Unknown

**Seat Type (this Occupant Position)**

- (00) No seat
- (01) Bucket
- (02) Bucket with folding back
- (03) Bench
- (04) Bench with separate back cushions
- (05) Bench with folding back(s)
- (06) Split bench with separate back cushions
- (07) Split bench with folding back(s)
- (08) Pedestal (i.e., column supported)
- (09) Other seat type (specify): \_\_\_\_\_
- (10) Box mounted seat (i.e., van type)
- (99) Unknown

**Seat Performance (this Occupant Position)**

- (0) No seat
- (1) No seat performance failure(s)
- (2) Seat adjusters failed
- (3) Seat back folding locks or "seat back" failed specify: \_\_\_\_\_
- (4) Seat tracks/anchors failed
- (5) Deformed by impact of occupant
- (6) Deformed by passenger compartment intrusion (specify): \_\_\_\_\_
- (7) Combination of above (specify): \_\_\_\_\_
- (8) Other (specify): \_\_\_\_\_
- (9) Unknown

**Seat Orientation (this Occupant Position)**

- (0) No seat
- (1) Forward facing seat
- (2) Rear facing seat
- (3) Side facing seat (inward)
- (4) Side facing seat (outward)
- (8) Other (specify): \_\_\_\_\_
- (9) Unknown

**DESCRIBE ANY INDICATION OF ABNORMAL OCCUPANT POSTURE (I.E., UNUSUAL OCCUPANT CONTACT PATTERN)**



**EJECTION/ENTRAPMENT DATA**

Complete the following if the researcher has any indication that an occupant was either ejected from or entrapped in the vehicle. Code the appropriate data on the Occupant Assessment Form.

**EJECTION**      No ☒ Yes ☐

Describe indications of ejection and body parts involved in partial ejection:

Occupant Name:

Location:

Ejection Medium:

Medium Status:

**Ejection**

- (1) Complete ejection
- (2) Partial ejection
- (3) Ejection, Unknown degree
- (9) Unknown

**Ejection Area**

- (1) Windshield
- (2) Left front
- (3) Right front
- (4) Left rear
- (5) Right rear
- (6) Rear

(7) Roof

(8) Other area (e.g., back of pickup, etc.) (specify):

(9) Unknown

**Ejection Medium**

- (1) Door/hatch/tailgate
- (2) Nonfixed roof structure
- (3) Fixed glazing
- (4) Nonfixed glazing (specify):

(5) Integral structure

(8) Other medium (specify):

(9) Unknown

**Medium Status (Immediately Prior to Impact)**

- (1) Open
- (2) Closed
- (3) Integral structure
- (9) Unknown

**ENTRAPMENT**      No ☒ Yes ☐

Describe entrapment mechanism:

Component(s):

(Note in vehicle interior diagram)

**APPENDIX D**

**NASS Occupant Forms**



# OCCUPANT ASSESSMENT FORM

1. ~~Primary Sampling Unit Number~~ \_\_\_\_\_

2. Case Number - ~~Stratum~~ 92-12

3. Vehicle Number 01

4. Occupant Number 01

## OCCUPANT'S CHARACTERISTICS

5. Occupant's Age 54  
Code actual age at time of accident.  
(00) Less than one year old (specify by month):

(97) 97 years and older  
(99) Unknown

6. Occupant's Sex 1

(1) Male  
(2) Female  
(9) Unknown

7. Occupant's Height 70.5"  
Code actual height to the nearest inch.  
(99) Unknown

8. Occupant's Weight 220 lbs. 220  
Code actual weight to the nearest pounds.  
(999) Unknown

9. Occupant's Role 1

(1) Driver  
(2) Passenger  
(9) Unknown

10. Occupant's Seat Position 11

### Front Seat

(11) Left side  
(12) Middle  
(13) Right side  
(14) Other (specify):  
(15) On or in the lap of another occupant

### Second Seat

(21) Left side  
(22) Middle  
(23) Right side  
(24) Other (specify):  
(25) On or in the lap of another occupant

### Third Seat

(31) Left side  
(32) Middle  
(33) Right side  
(34) Other (specify):  
(35) On or in the lap of another occupant

### Fourth Seat

(41) Left side  
(42) Middle  
(43) Right side  
(44) Other (specify):  
(45) On or in the lap of another occupant

(97) In or on unenclosed area  
(98) Other seat (specify):  
(99) Unknown

11. Occupant Posture 0

(0) Normal posture  
(1) Abnormal posture (specify):

(9) Unknown

## EJECTION/ENTRAPMENT

12. Ejection 0

(0) No ejection  
(1) Complete ejection  
(2) Partial ejection  
(3) Ejection, unknown degree  
(9) Unknown

13. Ejection Area 0

(0) No ejection  
(1) Windshield  
(2) Left front  
(3) Right front  
(4) Left rear  
(5) Right rear  
(6) Rear  
(7) Roof  
(8) Other area (e.g., back of pickup, etc.)  
(specify):  
(9) Unknown

14. Ejection Medium 0

(0) No ejection  
(1) Door/hatch/tailgate  
(2) Nonfixed roof structure  
(3) Fixed glazing  
(4) Nonfixed glazing (specify):

(5) Integral structure  
(8) Other medium (specify):

(9) Unknown

15. Medium Status (Immediately Prior To Impact) 0

(0) No ejection  
(1) Open  
(2) Closed  
(3) Integral structure  
(9) Unknown

16. Entrapment 0

(NOTE: Entrapped means that part of the person was in the vehicle and mechanically restrained; jammed doors and immobilizing injuries by themselves are not sufficient to constitute entrapment.)

(0) Not entrapped  
(1) Entrapped  
(9) Unknown



**RESTRAINT SYSTEM AND SEAT EVALUATION****17. Manual (Active) Belt System Availability**4

- (0) None available
- (1) Belt removed/destroyed
- (2) Shoulder belt
- (3) Lap belt
- (4) Lap and shoulder belt
- (5) Belt available—type unknown

*Integral Belt Partially Destroyed*

- (6) Shoulder belt (lap belt destroyed/removed)
- (7) Lap belt (shoulder belt destroyed/removed)

(8) Other belt (specify): \_\_\_\_\_

(9) Unknown

**18. Manual (Active) Belt System Use**04

(00) None used, not available, or belt removed/destroyed

(01) Inoperative (specify): \_\_\_\_\_

(02) Shoulder belt

(03) Lap belt

(04) Lap and shoulder belt

(05) Belt used—type unknown

(08) Other belt used (specify): \_\_\_\_\_

(12) Shoulder belt used with child safety seat

(13) Lap belt used with child safety seat

(14) Lap and shoulder belt used with child safety seat

(15) Belt used with child safety seat—type unknown

(18) Other belt used with child safety seat (specify): \_\_\_\_\_

(99) Unknown if belt used

**19. Proper Use of Manual (Active) Belts**1

(0) None used or not available

(1) Belt used properly

(2) Belt used properly with child safety seat

*Belt Used Improperly*

(3) Shoulder belt worn under arm

(4) Shoulder belt worn behind back or seat

(5) Belt worn around more than one person

(6) Lap belt worn on abdomen

(7) Lap belt or lap and shoulder belt used improperly with child safety seat (specify): \_\_\_\_\_

(8) Other improper use of manual belt system (specify): \_\_\_\_\_

(9) Unknown

**20. Manual (Active) Belt Failure Modes During Accident**1

(0) No manual belt used

(1) No manual belt failure(s)

(2) Torn webbing (stretched webbing not included)

(3) Broken buckle or latchplate

(4) Upper anchorage separated

(5) Other anchorage separated (specify): \_\_\_\_\_

(6) Broken retractor

(7) Combination of above (specify): \_\_\_\_\_

(8) Other manual belt failure (specify): \_\_\_\_\_

(9) Unknown

**21. Air Bag System Availability/Function**1

(0) Not equipped/not available

(1) Air bag

*Non-functional*

(2) Air bag disconnected (specify): \_\_\_\_\_

(3) Air bag not reinstalled

(9) Unknown

**22. Air Bag System Deployment**1

(0) Not equipped/not available

(1) Air bag deployed during accident (as a result of impact)

(2) Air bag deployed inadvertently just prior to accident

(3) Air bag deployed, accident sequence undetermined

(4) Nondeployed

(5) Unknown if deployed

(6) Air bag deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)

(9) Unknown

**23. Did Air Bag System Fail?**1

(0) Not equipped/not available

(1) No

(2) Yes (specify): \_\_\_\_\_

(9) Unknown

Note: See Variables 44 through 48 (Page 5) for Information on Automatic Belts

**24. Police Reported Restraint Use**4

(0) None used

(1) Police did not indicate restraint use

(2) Shoulder belt

(3) Lap belt

(4) Lap and shoulder belt

(5) Belt used, type not specified

(6) Child safety seat

(7) Other or automatic restraint (specify): \_\_\_\_\_

(8) Restrained, type unknown

(9) Police indicated "unknown"

**25. Head Restraint Type/Damage by Occupant at This Occupant Position**3

(0) No head restraints

(1) Integral—no damage

(2) Integral—damaged during accident

(3) Adjustable—no damage

(4) Adjustable—damaged during accident

(5) Add-on—no damage

(6) Add-on—damaged during accident

(8) Other (specify): \_\_\_\_\_

(9) Unknown

26. Seat Type (this Occupant Position) 0 6  
 (00) Occupant not seated or no seat  
 (01) Bucket  
 (02) Bucket with folding back  
 (03) Bench  
 (04) Bench with separate back cushions  
 (05) Bench with folding back(s)  
 (06) Split bench with separate back cushions  
 (07) Split bench with folding back(s) *POWER*  
 (08) Pedestal (i.e., column supported)  
 (09) Other seat type (specify):  
 (10) Box mounted seat (i.e., van type)  
 (99) Unknown
27. Seat Performance (this Occupant Position) 1  
 (0) Occupant not seated or no seat  
 (1) No seat performance failure(s)  
 (2) Seat adjusters failed  
 (3) Seat back folding locks or "seat back" failed  
 (4) Seat track/anchors failed  
 (5) Deformed by impact of occupant  
 (6) Deformed by passenger compartment intrusion (specify):  
 \_\_\_\_\_  
 \_\_\_\_\_  
 (7) Combination of above (specify):  
 \_\_\_\_\_  
 (8) Other (specify):  
 \_\_\_\_\_  
 (9) Unknown

**CHILD SAFETY SEAT**

28. Child Safety Seat Make/Model 0 0 0  
 (000) No child safety seat  
 Applicable codes are found in your NASS CDS Data Collection, Coding and Editing  
 (950) Built-in child safety seat  
 (997) Other make/model (specify):  
 \_\_\_\_\_  
 (998) Unknown make/model  
 (999) Unknown if child safety seat used
29. Type of Child Safety Seat 0  
 (0) No child safety seat  
 (1) Infant seat  
 (2) Toddler seat  
 (3) Convertible seat  
 (4) Booster seat  
 (7) Other type child safety seat (specify):  
 \_\_\_\_\_  
 (8) Unknown child safety seat type  
 (9) Unknown if child safety seat used

30. Child Safety Seat Orientation 0 0  
 (00) No child safety seat  
*Designed for Rear Facing for This Age/Weight*  
 (01) Rear facing  
 (02) Forward facing  
 (08) Other orientation (specify):  
 \_\_\_\_\_  
 (09) Unknown orientation  
*Designed For Forward Facing for This Age/Weight*  
 (11) Rear facing  
 (12) Forward facing  
 (18) Other orientation (specify):  
 \_\_\_\_\_  
 (19) Unknown orientation  
*Unknown Design or Orientation For This Age/Weight, or Unknown Age/Weight*  
 (21) Rear facing  
 (22) Forward facing  
 (28) Other orientation (specify):  
 \_\_\_\_\_  
 (29) Unknown orientation  
 (99) Unknown if child safety seat used
31. Child Safety Seat Harness Usage 0 0
32. Child Safety Seat Shield Usage 0 0
33. Child Safety Seat Tether Usage 0 0  
 Note: Options below applicable to Variables OA31-OA33.  
 (00) No child safety seat  
*Not Designed With Harness/Shield/Tether*  
 (01) After market harness/shield/tether added, not used  
 (02) After market harness/shield/tether used  
 (03) Child safety seat used, but no after market harness/shield/tether added  
 (09) Unknown if harness/shield/tether added or used  
*Designed With Harness/Shield/Tether*  
 (11) Harness/shield/tether not used  
 (12) Harness/shield/tether used  
 (19) Unknown if harness/shield/tether used  
*Unknown If Designed With Harness/Shield/Tether*  
 (21) Harness/shield/tether not used  
 (22) Harness/shield/tether used  
 (29) Unknown if harness/shield/tether used  
 (99) Unknown if child safety seat used

**INJURY CONSEQUENCES****34. Injury Severity (Police Rating)**3

- (0) O - No injury
- (1) C - Possible injury
- (2) B - Nonincapacitating injury
- (3) A - Incapacitating injury
- (4) K - Killed
- (5) U - Injury, severity unknown
- (6) Died prior to accident
- (9) Unknown

**35. Treatment - Mortality**3

- (0) No treatment
- (1) Fatal
- (2) Fatal - ruled disease

**Nonfatal**

- (3) Hospitalization
- (4) Transported and released
- (5) Treatment at scene - nontransported
- (6) Treatment later
- (8) Treatment - other (specify): \_\_\_\_\_

(9) Unknown

**36. Type Of Medical Facility (for Initial Treatment)** 1

- (0) Not treated at a medical facility
- (1) Trauma center
- (2) Hospital
- (3) Medical clinic
- (4) Physician's office
- (5) Treatment later at medical facility
- (8) Other (specify): \_\_\_\_\_

(9) Unknown

**37. Hospital Stay**23

- (00) Not Hospitalized
- \_\_\_\_\_ Code the number of days (up through 60) that the occupant stayed in hospital.
- (61) 61 days or more
- (99) Unknown

**38. Working Days Lost**61

- \_\_\_\_\_ Code the number of days (up through 60) that the occupant lost from work due to the accident
- (00) No working days lost
- (61) 61 days or more
- (62) Fatally injured
- (97) Not working prior to accident
- (99) Unknown

**39. Time to Death**00

- \_\_\_\_\_ Code number of hours from time of accident to time of death up through 24 hours. If time of death is greater than 24 hours, code number of days. (Note: 1 day = 31, 2 days = 32, ... n days = 30 + n up through 30 days = 60)
- (00) Not fatal
- (96) Fatal - ruled disease
- (99) Unknown

**40. 1st Medically Reported Cause of Death** 00**41. 2nd Medically Reported Cause of Death** 00**42. 3rd Medically Reported Cause of Death** 00

- \_\_\_\_\_ Code the Occupant Injury from line number(s) for the medically reported injury(s) which reportedly contributed to this occupant's death
- (00) Not fatal or no additional causes
- (97) Other result (specify): \_\_\_\_\_

(99) Unknown

**43. Number of Recorded Injuries for This Occupant**14

- \_\_\_\_\_ Code the actual number of injuries recorded for this occupant.
- (00) No recorded injuries
- (97) Injured, details unknown
- (99) Unknown if injured

**AUTOMATIC BELT SYSTEM****44. Automatic (Passive) Belt System Availability/ Function** 0

- (0) Not equipped/not available
- (1) 2 point automatic belts
- (2) 3 point automatic belts
- (3) Automatic belts - type unknown

*Non-functional*

- (4) Automatic belts destroyed or rendered inoperative
- (9) Unknown

**45. Automatic (Passive) Belt System Use** 0

- (0) Not equipped/not available/destroyed or rendered inoperative
- (1) Automatic belt in use
- (2) Automatic belt not in use (manually disconnected, motorized track inoperative) (specify): \_\_\_\_\_
- (3) Automatic belt use unknown
- (9) Unknown

**46. Automatic (Passive) Belt System Type** 0

- (0) Not equipped/not available
- (1) Non-motorized system
- (2) Motorized system
- (9) Unknown

**47. Proper Use of Automatic (Passive) Belt System** 0

- (0) Not equipped/not available/not used
- (1) Automatic belt used properly
- (2) Automatic belt used properly with child safety seat

*Automatic Belt Used Improperly*

- (3) Automatic shoulder belt worn under arm
- (4) Automatic shoulder belt worn behind back
- (5) Automatic belt worn around more than one person
- (6) Lap portion of automatic belt worn on abdomen
- (7) Automatic lap and shoulder belt or automatic shoulder belt used improperly with child safety seat (specify): \_\_\_\_\_
- (8) Other improper use of automatic belt system (specify): \_\_\_\_\_
- (9) Unknown

**48. Automatic (Passive) Belt Failure Modes During Accident** 0

- (0) Not equipped/not available/not in use
- (1) No automatic belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify): \_\_\_\_\_
- (6) Broken retractor
- (7) Combination of above (specify): \_\_\_\_\_
- (8) Other automatic belt failure (specify): \_\_\_\_\_
- (9) Unknown

**49. Seat Orientation (this Occupant Position)** 1

- (0) Occupant not seated or no seat
- (1) Forward facing seat
- (2) Rear facing seat
- (3) Side facing seat (inward)
- (4) Side facing seat (outward)
- (8) Other (specify): \_\_\_\_\_
- (9) Unknown

**TRAUMA DATA****50. Glasgow Coma Scale (GCS) Score (at Medical Facility)** 02

- (00) Not injured
- (01) Injured - not treated at medical facility
- (02) No GCS Score at medical facility
- (03-15) Code the actual value of the initial GCS Score recorded at medical facility.
- (97) Injured, details unknown
- (99) Unknown if injured

**51. Was the Occupant Given Blood?** 9

- (1) No - blood not given
- (2) Yes - blood given (specify units): \_\_\_\_\_
- (9) Unknown if blood given

**52. Arterial Blood Gases (ABG) - HCO<sub>3</sub>** 01

- (00) Not injured
- (01) Injured, ABGs not measured or reported
- (02-50) Code the actual value of the HCO<sub>3</sub>
- (96) ABGs reported, HCO<sub>3</sub> unknown
- (97) Injured, details unknown
- (99) Unknown if injured

UPDATE CANDIDATE? NO [☒] YES [ ]OCCUPANT INJURY FORM INCLUDED WITH INITIAL SUBMISSION? NO [☒] YES [ ]

\*\*\* STOP HERE \*\*\*  
 IF THERE ARE NO RECORDED INJURIES  
 (I.E., OA43 = 00,97,99)



# OCCUPANT INJURY FORM

1. Primary Sampling Unit Number

2. Case Number - Stratum

3. Vehicle Number

4. Occupant Number

## INJURY DATA

Record below the actual injuries sustained by this occupant that were identified from the official and unofficial data sources. Remember not to double count an injury just because it was identified from two different sources. If greater than ten injuries have been documented, encode the balance on the Occupant Injury Supplement.

Source of Injury Data	O.I.C.-A.I.S					Injury Source	Injury Source Confidence Level	Direct/Indirect Injury	Occupant Area Intrusion No.	
	Body Region	Aspect	Lesion	System Organ	A.I.S. Severity					
1st	5. <u>2</u>	6. <u>C</u>	7. <u>R</u>	8. <u>F</u>	9. <u>S</u>	10. <u>4</u>	11. <u>33</u>	12. <u>1</u>	13. <u>1</u>	14. <u>03/04</u>
2nd	15. <u>2</u>	16. <u>C</u>	17. <u>R</u>	18. <u>C</u>	19. <u>P</u>	20. <u>3</u>	21. <u>33</u>	22. <u>1</u>	23. <u>1</u>	24. <u>03/04</u>
3rd	25. <u>2</u>	26. <u>W</u>	27. <u>L</u>	28. <u>B</u>	29. <u>I</u>	30. <u>1</u>	31. <u>45</u>	32. <u>1</u>	33. <u>1</u>	34. <u>00</u>
4th	35. <u>2</u>	36. <u>H</u>	37. <u>W</u>	38. <u>K</u>	39. <u>B</u>	40. <u>2</u>	41. <u>54</u>	42. <u>1</u>	43. <u>1</u>	44. <u>01</u>
5th	45. <u>2</u>	46. <u>F</u>	47. <u>B</u>	48. <u>F</u>	49. <u>S</u>	50. <u>2</u>	51. <u>54</u>	52. <u>1</u>	53. <u>1</u>	54. <u>01</u>
6th	55. <u>2</u>	56. <u>R</u>	57. <u>R</u>	58. <u>F</u>	59. <u>S</u>	60. <u>2</u>	61. <u>53</u>	62. <u>1</u>	63. <u>1</u>	64. <u>01</u>
7th	65. <u>2</u>	66. <u>B</u>	67. <u>S</u>	68. <u>F</u>	69. <u>S</u>	70. <u>2</u>	71. <u>40/20</u>	72. <u>1</u>	73. <u>1</u>	74. <u>00</u>
8th	75. <u>2</u>	76. <u>F</u>	77. <u>C</u>	78. <u>F</u>	79. <u>S</u>	80. <u>2</u>	81. <u>54</u>	82. <u>1</u>	83. <u>1</u>	84. <u>01</u>
9th	85. <u>2</u>	86. <u>S</u>	87. <u>R</u>	88. <u>F</u>	89. <u>S</u>	90. <u>2</u>	91. <u>53</u>	92. <u>1</u>	93. <u>1</u>	94. <u>02</u>
10th	95. <u>2</u>	96. <u>R</u>	97. <u>R</u>	98. <u>F</u>	99. <u>S</u>	100. <u>3</u>	101. <u>53</u>	102. <u>1</u>	103. <u>1</u>	104. <u>02</u>



# OCCUPANT INJURY DATA

	Source of Injury Data	O.I.C.-A.I.S					Injury Source	Injury Source Confidence Level	Direct/ Indirect Injury	Occupant Area Intrusion No.
		Body Region	Aspect	Lesion	System Organ	A.I.S. Severity				
11th	<u>2</u>	<u>F</u>	<u>C</u>	<u>L</u>	<u>I</u>	<u>1</u>	<u>54</u>	<u>1</u>	<u>1</u>	<u>01</u>
12th	<u>2</u>	<u>H</u>	<u>R</u>	<u>L</u>	<u>E</u>	<u>1</u>	<u>54</u>	<u>1</u>	<u>1</u>	<u>01</u>
13th	<u>2</u>	<u>H</u>	<u>S</u>	<u>L</u>	<u>I</u>	<u>1</u>	<u>54</u>	<u>1</u>	<u>1</u>	<u>01</u>
14th	<u>2</u>	<u>F</u>	<u>I</u>	<u>D</u>	<u>S</u>	<u>1</u>	<u>54</u>	<u>1</u>	<u>1</u>	<u>01</u>
15th	—	—	—	—	—	—	—	—	—	—
16th	—	—	—	—	—	—	—	—	—	—
17th	—	—	—	—	—	—	—	—	—	—
18th	—	—	—	—	—	—	—	—	—	—
19th	—	—	—	—	—	—	—	—	—	—
20th	—	—	—	—	—	—	—	—	—	—
21st	—	—	—	—	—	—	—	—	—	—
22nd	—	—	—	—	—	—	—	—	—	—
23rd	—	—	—	—	—	—	—	—	—	—
24th	—	—	—	—	—	—	—	—	—	—
25th	—	—	—	—	—	—	—	—	—	—

AGE 54  
SEX MALE  
WT. 220 lbs.  
HT. 179.1 cm  
(70.5")

Right earlobe laceration  
(AIS-1), intruding roof

Superior scalp laceration  
(AIS-1), intruding roof

Closed head injury with  
brief loss of consciousness  
and residual cognitive deficits  
(AIS-2), roof

Dislocated teeth, #D5-8  
(AIS-1), intruding roof

Displaced nasal fracture (AIS-2),  
intruding roof

Non-displaced fracture of the  
right zygoma (AIS-2),  
intruding roof

Nasal laceration (AIS-1),  
intruding roof

Right clavicle fracture  
(AIS-2), intruding  
right roof side rail

Fractured right ribs 2-9  
with flail chest and  
right hemothorax  
(AIS-4), right B-pillar


T-12 spinous process fracture  
(AIS-2), rebound contact into  
seatback/door

Right pulmonary  
contusion (AIS-3),  
right B-pillar

Full thickness thermal burn  
of the dorsal left middle,  
ring and fifth fingers  
(AIS-1) air bag inflator  
module

Comminuted fracture  
of the right radial  
head (AIS-3), right  
roof side rail

Fracture of the right  
proximal ulna (AIS-2),  
right roof side rail

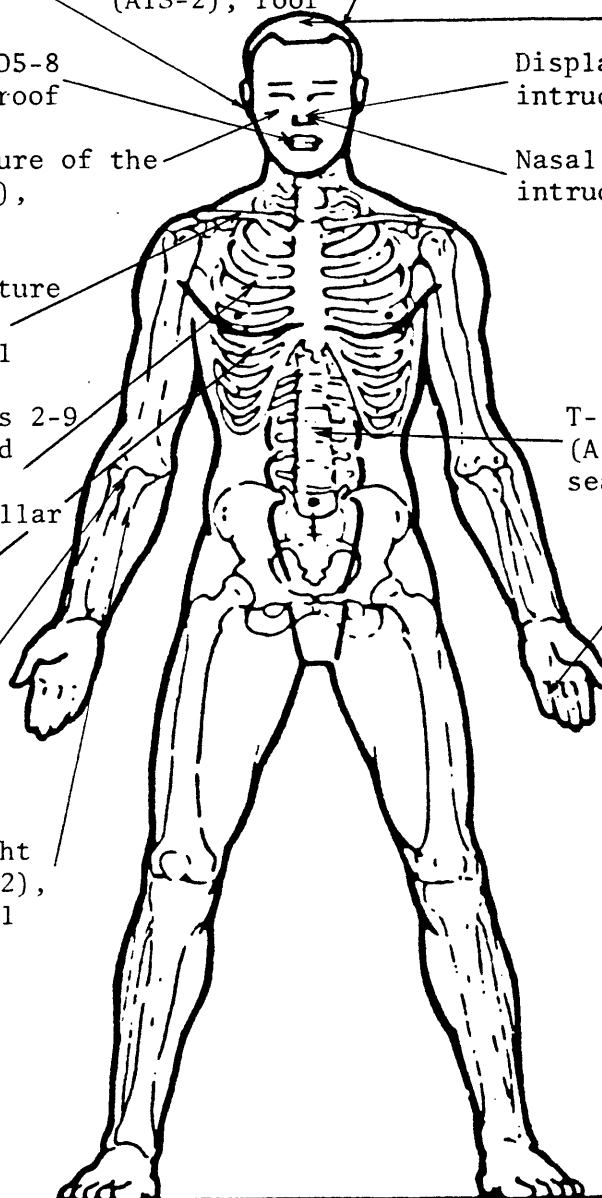

**SOURCE OF INJURY DATA****OFFICIAL**

- (1) Autopsy records with or without hospital medical records
- (2) Hospital medical records other than emergency room (e.g., discharge summary)
- (3) Emergency room records only (including associated X-rays or other lab reports)
- (4) Private physician, walk-in or emergency clinic

**UNOFFICIAL**

- (5) Lay coroner report
- (6) E.M.S. personnel
- (7) Interviewee
- (8) Other source (specify): \_\_\_\_\_
- (9) Police

**INJURY SOURCE****FRONT**

- (01) Windshield
- (02) Mirror
- (03) Sunvisor
- (04) Steering wheel rim
- (05) Steering wheel hub/spoke
- (06) Steering wheel (combination of codes 04 and 05)
- (07) Steering column, transmission selector lever, other attachment
- (08) Add on equipment (e.g., CB, tape deck, air conditioner)
- (09) Left instrument panel and below
- (10) Center instrument panel and below
- (11) Right instrument panel and below
- (12) Glove compartment door
- (13) Knee bolster
- (14) Windshield including one or more of the following: front header, A-pillar, instrument panel, mirror, or steering assembly (driver side only)
- (15) Windshield including one or more of the following: front header, A-pillar, instrument panel, or mirror (passenger side only)
- (16) Other front object (specify): \_\_\_\_\_

**LEFT SIDE**

- (20) Left side interior surface, excluding hardware or armrests
- (21) Left side hardware or armrest
- (22) Left A pillar
- (23) Left B pillar
- (24) Other left pillar (specify): \_\_\_\_\_
- (25) Left side window glass or frame

- (26) Left side window glass including one or more of the following: frame, window sill, A-pillar, B-pillar, or roof side rail.
- (27) Other left side object (specify): \_\_\_\_\_

- (28) Left side window sill

**RIGHT SIDE**

- (30) Right side interior surface, excluding hardware or armrests
- (31) Right side hardware or armrest
- (32) Right A pillar
- (33) Right B pillar
- (34) Other right pillar (specify): \_\_\_\_\_

- (35) Right side window glass or frame
- (36) Right side window glass including one or more of the following: frame, window sill, A pillar, B pillar, or roof side rail.
- (37) Other right side object (specify): \_\_\_\_\_

- (38) Right side window sill

**INTERIOR**

- (40) Seat, back support
- (41) Belt restraint webbing/buckle
- (42) Belt restraint B-pillar attachment point
- (43) Other restraint system component (specify): \_\_\_\_\_
- (44) Head restraint system
- (45) Air bag
- (46) Other occupants (specify): \_\_\_\_\_
- (47) Interior loose objects
- (48) Child safety seat (specify): \_\_\_\_\_
- (49) Other interior object (specify): \_\_\_\_\_

**ROOF**

- (50) Front header
- (51) Rear header
- (52) Roof left side rail
- (53) Roof right side rail
- (54) Roof or convertible top

**FLOOR**

- (56) Floor (including toe pan)
- (57) Floor or console mounted transmission lever, including console
- (58) Parking brake handle
- (59) Foot controls including parking brake

**REAR**

- (60) Backlight (rear window)

- (61) Backlight storage rack, door, etc.
- (62) Other rear object (specify): \_\_\_\_\_

**EXTERIOR of OCCUPANT'S VEHICLE**

- (65) Hood
- (66) Outside hardware (e.g., outside mirror, antenna)
- (67) Other exterior surface or tires (specify): \_\_\_\_\_
- (68) Unknown exterior objects

**EXTERIOR OF OTHER MOTOR VEHICLE**

- (70) Front bumper
- (71) Hood edge
- (72) Other front of vehicle (specify): \_\_\_\_\_
- (73) Hood
- (74) Hood ornament
- (75) Windshield, roof rail, A-pillar
- (76) Side surface
- (77) Side mirrors
- (78) Other side protrusions (specify): \_\_\_\_\_

- (79) Rear surface
- (80) Undercarriage
- (81) Tires and wheels
- (82) Other exterior of other motor vehicle (specify): \_\_\_\_\_
- (83) Unknown exterior of other motor vehicle

**OTHER VEHICLE OR OBJECT IN THE ENVIRONMENT**

- (84) Ground
- (85) Other vehicle or object (specify): \_\_\_\_\_
- (86) Unknown vehicle or object

**NONCONTACT INJURY**

- (90) Fire in vehicle
- (91) Flying glass
- (92) Other noncontact injury source (specify): \_\_\_\_\_
- (93) Air bag exhaust gases
- (97) Injured, unknown source

**INJURY SOURCE CONFIDENCE LEVEL**

- (1) Certain
- (2) Probable
- (3) Possible
- (9) Unknown

**DIRECT/INDIRECT INJURY**

- (1) Direct contact injury
- (2) Indirect contact injury
- (3) Noncontact injury
- (7) Injured, unknown source

**OCCUPANT INJURY CLASSIFICATION****O.I.C. Body Region**

- (M) Abdomen
- (Q) Ankle-foot
- (A) Arm (upper)
- (B) Back-thoracolumbar spine
- (C) Chest
- (E) Elbow
- (F) Face
- (R) Forearm
- (H) Head-skull
- (U) Injured, unknown region
- (K) Knee
- (L) Leg (lower)
- (Y) Lower limb(s) (whole or unknown part)
- (N) Neck-cervical spine
- (P) Pelvic-hip
- (S) Shoulder
- (T) Thigh
- (X) Upper limb(s) (whole or unknown part)
- (O) Whole body
- (W) Wrist-hand

**Aspect of Injury**

- (A) Anterior-front
- (B) Bilateral (rib fracture only)
- (C) Central
- (I) Inferior-lower
- (U) Injured, unknown aspect
- (L) Left
- (P) Posterior-back
- (R) Right
- (S) Superior-upper
- (W) Whole region

**Lesion**

- (A) Abrasion
- (M) Amputation
- (V) Avulsion
- (B) Burn
- (K) Concussion
- (C) Contusion
- (N) Crush
- (G) Detachment, separation
- (D) Dislocation

- (F) Fracture
- (Z) Fracture and dislocation
- (U) Injured, unknown lesion
- (L) Laceration
- (O) Other
- (P) Perforation, puncture
- (R) Rupture
- (S) Sprain
- (T) Strain
- (E) Total severance, transection

**System/Organ**

- (W) All systems in region
- (A) Arteries-veins
- (B) Brain
- (D) Digestive
- (E) Ears
- (O) Eye
- (H) Heart
- (U) Injured, unknown system
- (I) Integumentary
- (J) Joints
- (K) Kidneys

- (L) Liver
- (M) Muscles
- (N) Nervous system
- (P) Pulmonary-lungs
- (R) Respiratory
- (S) Skeletal
- (C) Spinal cord
- (Q) Spleen
- (T) Thyroid, other endocrine gland
- (V) Vertebrae

**Abbreviated Injury Scale**

- (1) Minor injury
- (2) Moderate injury
- (3) Serious injury
- (4) Severe injury
- (5) Critical injury
- (6) Maximum (untreatable)
- (7) Injured, unknown severity